


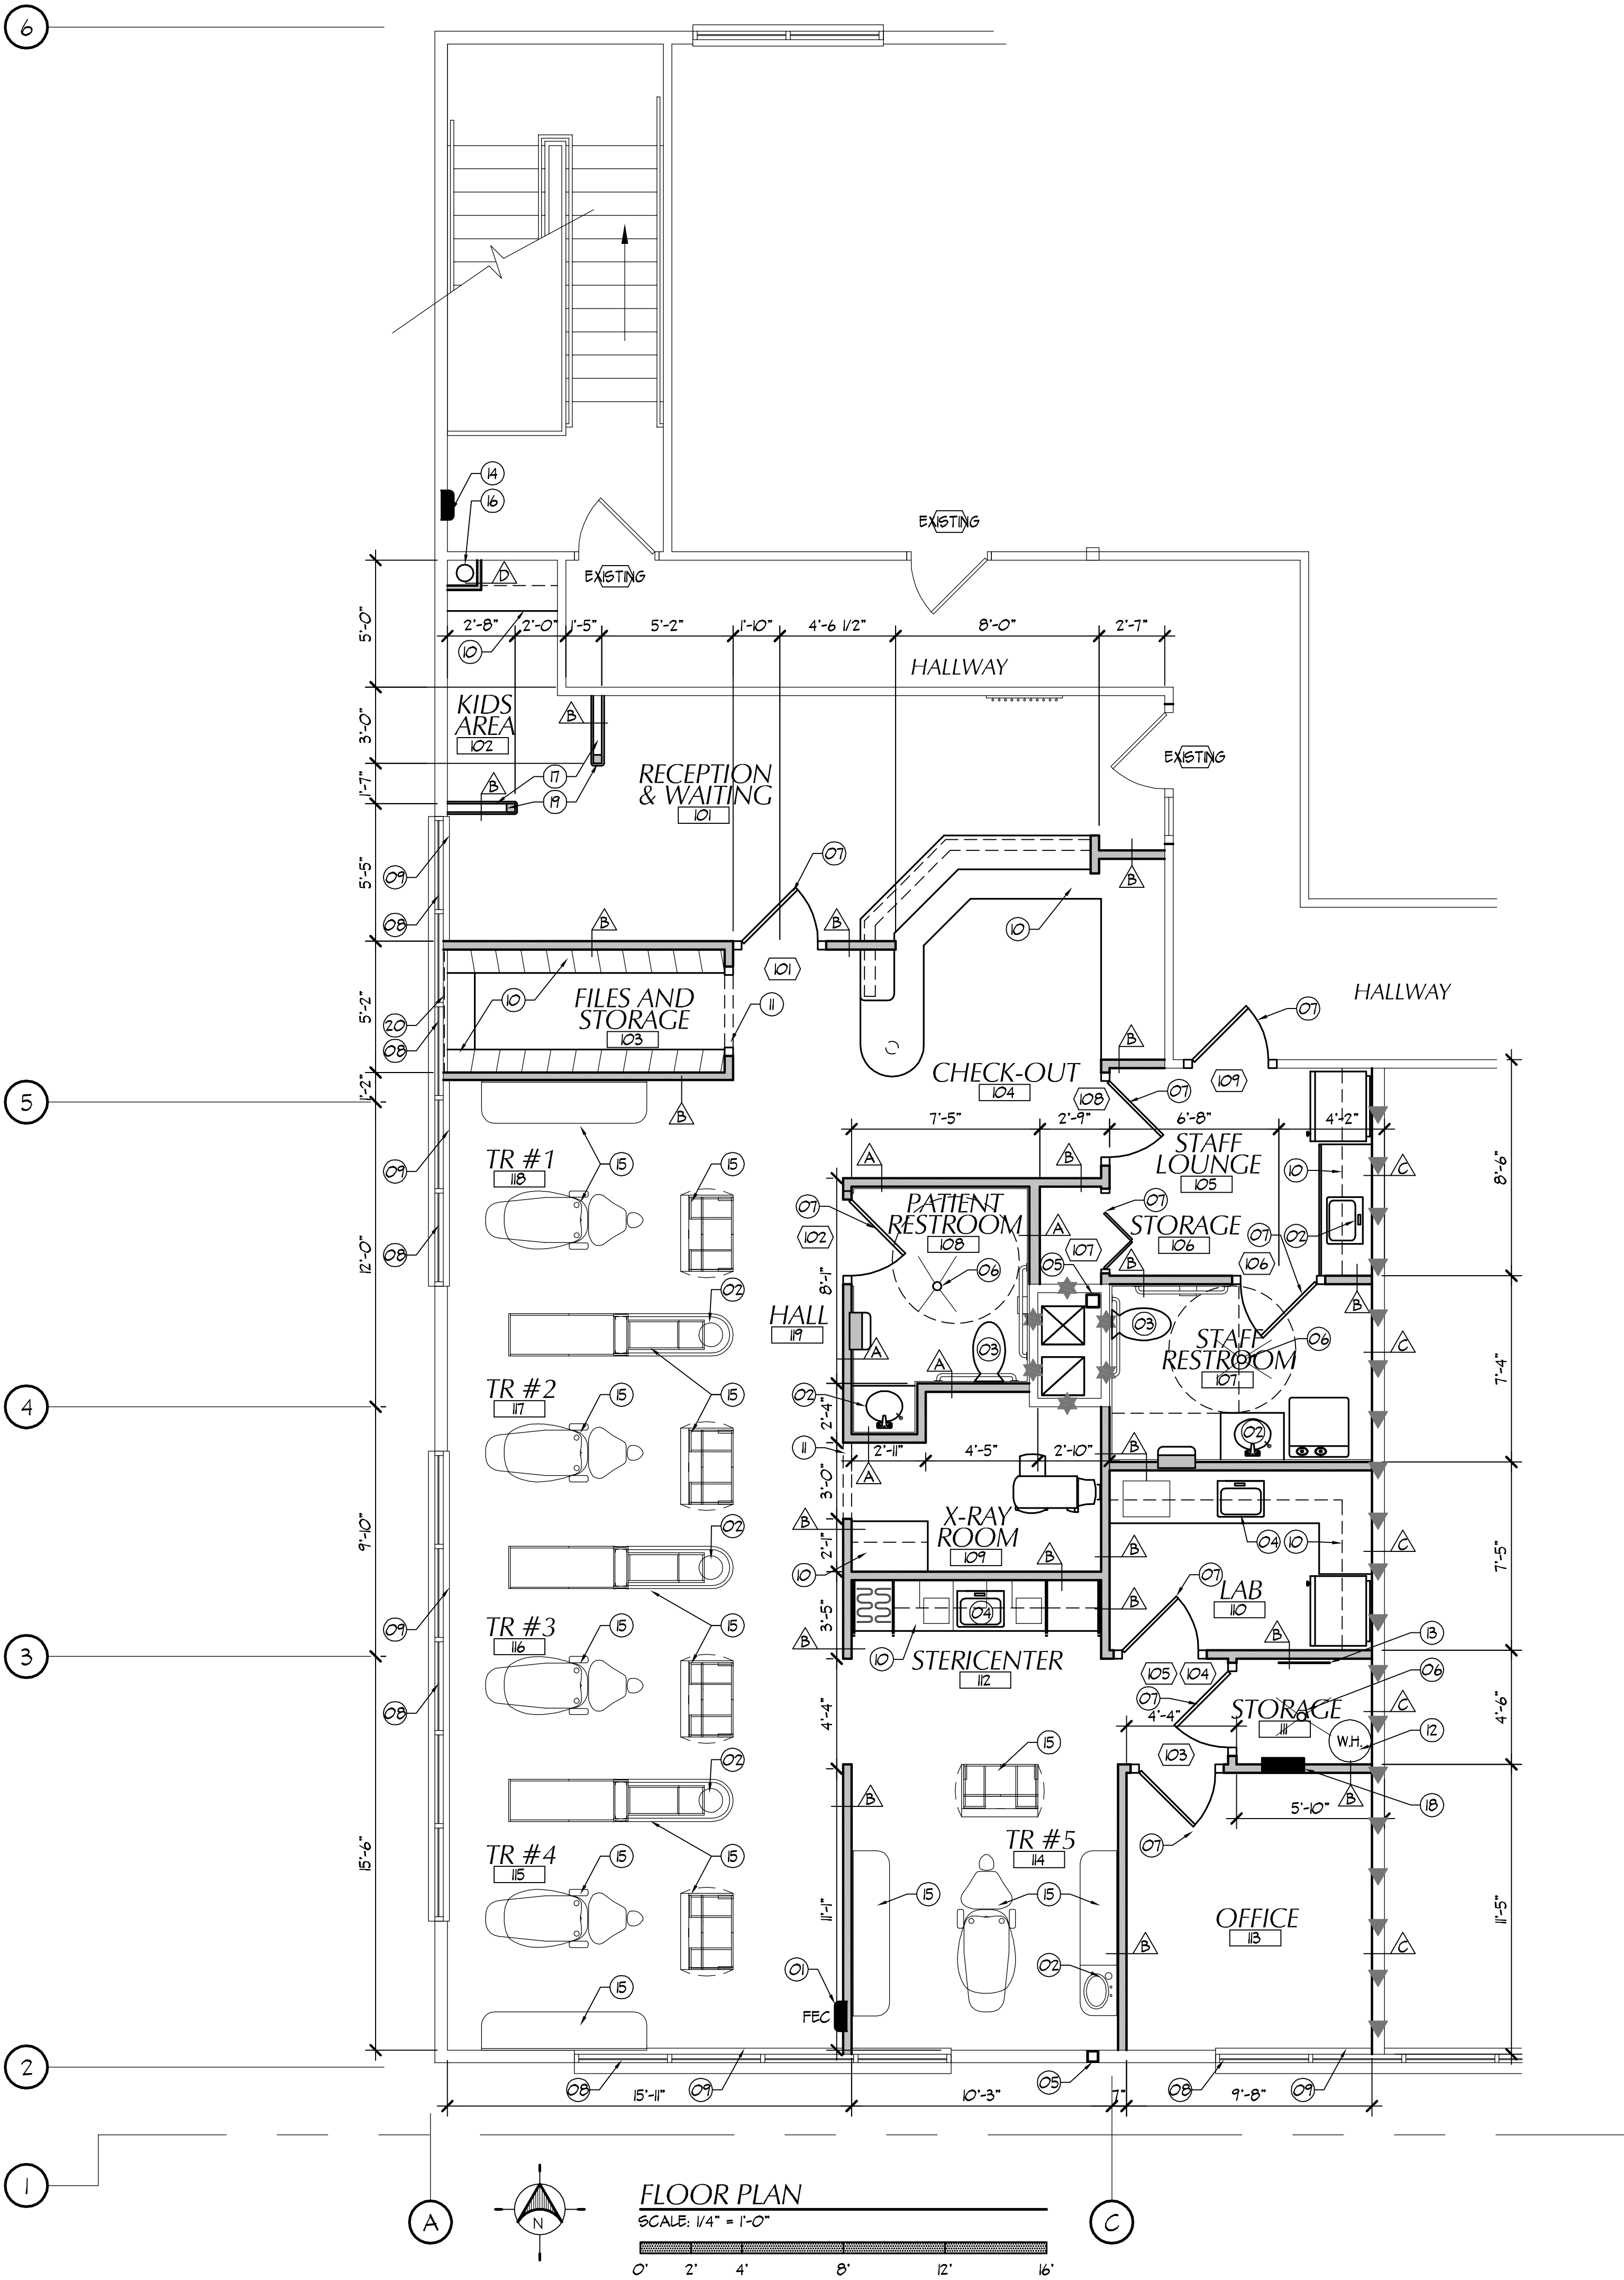


△ MARK	REVISION	DATE

- SHEET NOTES**
- 01- SEMI-RECESSED FIRE EXTINGUISHER CABINET WITH 2A10BC FIRE EXTINGUISHER INSIDE.
 - 02- ADA COMPLIANT SINK, COUNTERTOP TO BE 34" MAXIMUM ABOVE FINISHED FLOOR.
 - 03- ADA COMPLIANT TOILET.
 - 04- SINK.
 - 05- EXISTING STRUCTURAL STEEL COLUMN.
 - 06- FLOOR DRAIN. SLOPE 1/8" PER FOOT TOWARDS FLOOR DRAIN.
 - 07- STAIN GRADE WOOD FRAME WITH DOOR.
 - 08- EXISTING PRE-FINISHED ALUMINUM WINDOW SYSTEM.
 - 09- STAIN GRADE WINDOW SILL. SEE DETAIL B/A4.1.
 - 10- MILLWORK. DESIGN CONCEPT ONLY. FINAL LAYOUT AND DETAILING TO BE SELECTED BY TENANT EXCEPT FOR CODE REQUIRED DESIGN ELEMENTS.
 - 11- DASHED LINES INDICATE DRYWALL UNTEL ABOVE. MAINTAIN 7'-0" HEADROOM. OPENING TO BE CAGED WITH STAIN GRADE MOLDINGS.
 - 12- WATER HEATER. SEE DETAIL 5/A4.1.
 - 13- PHONE BOARD.
 - 14- EXISTING SEMI-RECESSED FIRE EXTINGUISHER CABINET WITH 2A10BC FIRE EXTINGUISHER INSIDE.
 - 15- PRE FABRICATED CABINETRY UNIT BY SULLIVAN SCHEIN (NIC).
 - 16- EXISTING ROOF DRAIN LINE.
 - 17- 36" HIGH PONY WALLS.
 - 18- ELECTRICAL PANEL.
 - 19- PONY WALL UPRIGHT SUPPORT.
 - 20- INSTALL WINDOW BLINDS PROVIDED BY TENANT, BEFORE INSTALLATION OF MILLWORK.

- SEPARATION LEGEND**
- ★ EXISTING ONE-HOUR SHAFT ENCLOSURE (FIRE BARRIER).
 - ▼ NEW NON-RATED SOUND ISOLATION WALL EXTENDING TO THE BOTTOM OF STRUCTURE ABOVE.

- GENERAL NOTES**
- A- GENERAL CONTRACTOR SHALL VERIFY ALL CONDITIONS AND DIMENSIONS PRIOR TO CONSTRUCTION. REPORT ANY SIGNIFICANT DISCREPANCIES TO THE ARCHITECT AND TENANT.
 - B- SEE ORIGINAL DRAWINGS FOR CASCADE PROFESSIONAL OFFICE PLAZA, DATED 15 FEBRUARY 2005, FOR INFORMATION AND CLARIFICATIONS RELATED TO THE SHELL STRUCTURE AND DETAILING.
 - C- COORDINATE INSTALLATIONS OF ALL "AFTER CONTRACT" ASSEMBLIES WITH TENANT PRIOR TO CONSTRUCTION OF ADTONGING OR RELATED STRUCTURES.
 - D- AN AUTOMATIC FIRE SPRINKLER SYSTEM IS TO BE INSTALLED THROUGHOUT THE ENTIRE TENANT BUILDOUT.
 - E- PROVIDE 18" MINIMUM CLEAR FLOOR SPACE AT PULL SIDE OF ALL DOORS. PROVIDE 12" MINIMUM CLEAR FLOOR SPACE AT PUSH SIDE OF ALL DOORS.
 - F- PROVIDE 3/4" BULLNOSE AT ALL INTERIOR DRYWALL CORNERS.
 - G- WALL TYPES SHOWN DO NOT ADDRESS CERAMIC TILE INSTALLATION ON WALL SURFACES AS SHOWN ON THE FLOOR PLANS. REFER TO THE CURRENT EDITION OF THE HANDBOOK FOR CERAMIC TILE INSTALLATION PUBLISHED BY THE TILE COUNCIL OF AMERICA, INC., FOR PROPER CERAMIC TILE INSTALLATION MATERIALS AND METHODS.
 - H- SEE DETAILS B/A5.1 AND H/A5.1 FOR TYPICAL FIXTURE MOUNTING HEIGHTS.
 - J- BLOCK WALLS AS REQUIRED FOR HANGING FIXTURES AND FURNISHINGS. SEE DETAIL 12/A5.1.

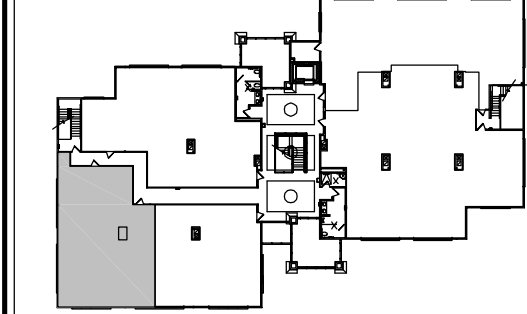

SECOND LEVEL FLOOR

KEY PLAN



357 EAST 1200 SOUTH
OREM, UTAH 84058
PHONE: (801) 229-7907
FAX: (801) 229-0040
cma@curtisminerarchitecture.com

DATE: 26 AUGUST 2005
PROJECT #: CMA0545
PROT. MAN.: KWM
CHECKED BY: CNM

THE INFORMATION HEREIN IS THE PROPERTY OF CURTIS MINER ARCHITECTURE AND MAY NOT BE REPRODUCED WITHOUT WRITTEN CONSENT. © 2005 CURTIS MINER ARCHITECTURE, LLC

PROJECT:

**DR. JERRY BROWN
TENANT BUILDOUT
CASCADE OFFICE PLAZA
1375 EAST 800 NORTH STREET
OREM, UTAH 84097**

SHEET DESCRIPTION:

FLOOR PLAN

SHEET:

A1.1