

Phase I Environmental Site Assessment

Hurst Industrial Site

111 and 113 Souder Drive

Hurst, Tarrant County, Texas

August 12, 2020

Terracon Project No. 95207416



Prepared for:

Trinity Bank National Association
Fort Worth, Texas

Prepared by:

Terracon Consultants, Inc.
Fort Worth, Texas

terracon.com

Terracon

Environmental



Facilities



Geotechnical



Materials

August 12, 2020



Trinity Bank National Association
3500 West Vickery Boulevard
Fort Worth, Texas 76107

Attn: Mr. Barney Wiley
P: (817) 763-9966
E: bwiley@TrinityBk.com

Re: Phase I Environmental Site Assessment
Hurst Industrial Site
111 and 113 Souder Drive
Hurst, Tarrant County, Texas
Terracon Project No. 95207416

Dear Mr. Wiley:

Terracon Consultants, Inc. (Terracon) is pleased to submit the enclosed Phase I Environmental Site Assessment (ESA) report for the above-referenced site. This assessment was performed in accordance with Terracon Proposal No. P95207416 dated July 27, 2020.

We appreciate the opportunity to be of service to you on this project. In addition to Phase I services, our professionals provide geotechnical, environmental, construction materials, and facilities services on a wide variety of projects locally, regionally and nationally. For more detailed information on all of Terracon's services please visit our website at www.terracon.com. If there are any questions regarding this report or if we may be of further assistance, please do not hesitate to contact us.

Sincerely,
Terracon Consultants, Inc.

Ana C. Salamanca
Staff Scientist

Jack A. McCranie
Environmental Department Manager

Attachments



Terracon Consultants Inc. 2501 E Loop 820 N Fort Worth, TX 76118-6978

P 817-268-8600 F 817-268-8602 terracon.com

Environmental



Facilities



Geotechnical



Materials

TABLE OF CONTENTS

	Page No.
EXECUTIVE SUMMARY	i
Findings and Opinions	i
Significant Data Gaps	ii
Conclusions.....	ii
Recommendations	ii
1.0 INTRODUCTION.....	1
1.1 Site Description	1
1.2 Scope of Services	1
1.3 Standard of Care.....	2
1.4 Additional Scope Limitations, ASTM Deviations and Data Gaps	2
1.5 Reliance	3
1.6 Client Provided Information.....	3
2.0 PHYSICAL SETTING	4
3.0 HISTORICAL USE INFORMATION	5
3.1 Historical Topographic Maps, Aerial Photographs, and Sanborn Maps	5
3.2 Historical City Directories	6
3.3 Site Ownership.....	8
3.4 Title Search	8
3.5 Environmental Liens and Activity and Use Limitations (AULs)	8
3.6 Interviews Regarding Current and Historical Site Uses	8
3.7 Prior Report Review	9
4.0 RECORDS REVIEW	9
4.1 Federal and State/Tribal Databases	9
4.2 Local Agency Inquiries	12
4.3 Local Area Knowledge	12
5.0 SITE RECONNAISSANCE	13
5.1 General Site Information	13
5.2 Overview of Current Site Occupants.....	14
5.3 Overview of Current Site Operations	14
5.4 Site Observations	14
6.0 ADJOINING PROPERTY RECONNAISSANCE	16
7.0 ADDITIONAL SERVICES.....	16
8.0 DECLARATION	16

TABLE OF CONTENTS (continued)

APPENDICES

APPENDIX A	Exhibit 1 - Topographic Map, Exhibit 2 - Site Diagram
APPENDIX B	Site Photographs
APPENDIX C	Historical Documentation and User Questionnaire
APPENDIX D	Environmental Database Information
APPENDIX E	Credentials
APPENDIX F	Description of Terms and Acronyms

EXECUTIVE SUMMARY

This Phase I Environmental Site Assessment (ESA) was performed in accordance with Terracon Proposal No. P95207416 dated July 27, 2020, and was conducted consistent with the procedures included in ASTM E1527-13, *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process*. The ESA was conducted under the supervision or responsible charge of Jack A. McCranie, Environmental Professional. Ana C. Salamanca performed the site reconnaissance on August 6, 2020.

Findings and Opinions

A summary of findings is provided below. It should be recognized that details were not included or fully developed in this section, and the report must be read in its entirety for a comprehensive understanding of the items contained herein.

Site Description and Use

The site consists of an approximate 0.465-acre tract of land located at 111 and 113 Souder Drive in Hurst, Tarrant County, Texas. The site is improved with a 3,239-square foot (sf) office/showroom building, a 1,441-sf storage/warehouse building, asphalt-paved parking areas, and utilities. At the time of the site reconnaissance, the site buildings were vacant and no operations were occurring at the site.

Historical Information

The site consisted of undeveloped land from at least 1942 until 1957 when the site was developed with an apparent residential building on the northern portion of the site and a portion of the existing office building on the southern portion. By the late-1970s, the existing storage/warehouse building on the northwest corner of the site had been constructed, an addition to the west side of the office building had been constructed, and an apparent construction trailer and/or storage shed had replaced the northern residential building. The construction trailer/storage shed was removed from the northern portion of the site, and the area appeared utilized as parking and storage for construction trucks and trailers by 2005. The site was most recently occupied by a general contractor from at least 2008 until 2019, when it was vacated.

The north adjoining property consisted of undeveloped land and a pond in 1942. By 1958, the pond was removed the existing Hurst Water Utilities Division Pump Station was constructed abutting the site to the north and west. Souder Drive has abutted the site to the east followed by undeveloped land from at least 1942 until the late 1950s when the existing commercial store building was constructed beyond Souder Drive. The south adjoining property consisted of undeveloped land from at least 1942 until the late 1950s, when the existing commercial buildings were constructed to the south. By 1984, the existing building was constructed to the

southwest of the site. The historical uses of the site and adjoining properties do not constitute recognized environmental concerns (RECs) to the site, as discussed in the report text.

Records Review

Selected federal and state environmental regulatory databases were reviewed. The site was not listed in the regulatory databases. The facilities listed in the database report do not appear to represent RECs to the site at this time based upon regulatory status, apparent topographic gradient, and/or distance from the site.

Site Reconnaissance

Based on Terracon's observations, RECs were not identified during the site reconnaissance.

Adjoining Properties

Currently, the adjoining properties consists of City of Hurst Water Utilities Division Pump Station (120 Hurstview Drive) to the north and west of the site; Souder Drive to the east, followed by a Fun N Sun Sports Center Inc. (316 Souder Drive); and The Motor Cycle Shop (332 West Hurst Boulevard), A&A Tire and Wheels (336 West Hurst Boulevard), and Cody Air Conditioning and Heating (348 West Hurst Boulevard) to the south.

Significant Data Gaps

No significant data gaps were identified during the course of this assessment.

Conclusions

We have performed a Phase I ESA consistent with the procedures included in ASTM Practice E 1527-13 of the 0.465-acre tract of land located at 111 and 113 Souder Drive, Hurst, Tarrant County, Texas, the site. RECs or Controlled RECs (CREC) were not identified in connection with the site.

Recommendations

Based on the scope of services, limitations, and conclusions of this assessment, Terracon did not identify RECs or CRECs. As such, no additional investigation is warranted at this time.

1.0 INTRODUCTION

1.1 Site Description

Site Name	Hurst Industrial Site
Site Location/Address	111 and 113 Souder Drive, Hurst, Tarrant County, Texas
Land Area	Approximately 0.465 acres
Site Improvements	The site is improved with a 3,239-square foot (sf) office/showroom building, a 1,441-sf storage/warehouse building, asphalt-paved parking areas, and utilities.
Anticipated Future Site Use	Continued use as office/storage
Purpose of the ESA	Site Acquisition

The location of the site is depicted on Exhibit 1 of Appendix A, which was reproduced from a portion of the USGS 7.5-minute series topographic map. The site and adjoining properties are depicted on the Site Diagram, which is included as Exhibit 2 of Appendix A. Acronyms and terms used in this report are described in Appendix F.

1.2 Scope of Services

This Phase I ESA was performed in accordance with Terracon Proposal No. P95207416 dated July 27, 2020, and was conducted consistent with the procedures included in ASTM E1527-13, *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process*. The purpose of this ESA was to assist the client in developing information to identify RECs in connection with the site as reflected by the scope of this report. This purpose was undertaken through user-provided information, a regulatory database review, historical and physical records review, interviews, including local government inquiries, as applicable, and a visual noninvasive reconnaissance of the site and adjoining properties. Limitations, ASTM deviations, and significant data gaps (if identified) are noted in the applicable sections of the report.

ASTM E1527-13 contains a new definition of "migrate/migration," which refers to "the movement of hazardous substances or petroleum products in any form, including, for example, solid and liquid at the surface or subsurface, and vapor in the subsurface." By including this explicit reference to migration in ASTM E1527-13, the Standard clarifies that the potential for vapor migration should be addressed as part of a Phase I ESA. This Phase I ESA has considered vapor migration in evaluation of RECs associated with the site.

1.3 Standard of Care

This ESA was performed in accordance with generally accepted practices of this profession, undertaken in similar studies at the same time and in the same geographical area. We have endeavored to meet this standard of care, but may be limited by conditions encountered during performance, a client-driven scope of work, or inability to review information not received by the report date. Where appropriate, these limitations are discussed in the text of the report, and an evaluation of their significance with respect to our findings has been conducted.

Phase I ESAs, such as the one performed at this site, are of limited scope, are noninvasive, and cannot eliminate the potential that hazardous, toxic, or petroleum substances are present or have been released at the site beyond what is identified by the limited scope of this ESA. In conducting the limited scope of services described herein, certain sources of information and public records were not reviewed. It should be recognized that environmental concerns may be documented in public records that were not reviewed. No ESA can wholly eliminate uncertainty regarding the potential for RECs in connection with a property. Performance of this practice is intended to reduce, but not eliminate, uncertainty regarding the potential for RECs. No warranties, express or implied, are intended or made. The limitations herein must be considered when the user of this report formulates opinions as to risks associated with the site or otherwise uses the report for any other purpose. These risks may be further evaluated – but not eliminated – through additional research or assessment. We will, upon request, advise you of additional research or assessment options that may be available and associated costs.

1.4 Additional Scope Limitations, ASTM Deviations and Data Gaps

Based upon the agreed-on scope of services, this ESA did not include subsurface or other invasive assessments, vapor intrusion assessments or indoor air quality assessments (i.e. evaluation of the presence of vapors within a building structure), business environmental risk evaluations, or other services not particularly identified and discussed herein. Credentials of the company (Statement of Qualifications) have not been included in this report but are available upon request. Pertinent documents are referred to in the text of this report, and a separate reference section has not been included. Reasonable attempts were made to obtain information within the scope and time constraints set forth by the client; however, in some instances, information requested is not, or was not, received by the issuance date of the report. Information obtained for this ESA was received from several sources that we believe to be reliable; nonetheless, the authenticity or reliability of these sources cannot and is not warranted hereunder. This ESA was further limited by the following:

- Historical information was not provided back to 1940. Uses of the site were described only as far back as 1942. Based on the undeveloped nature of the site in 1942, this data gap is not deemed significant.
- A written request was submitted to the local government agency regarding documented RECs on the site. At the issuance of this report, a response has not

been received. Based on alternate sources of information, the absence of this information does not constitute a significant data gap.

An evaluation of the significance of limitations and missing information with respect to our findings has been conducted, and where appropriate, significant data gaps are identified and discussed in the text of the report. However, it should be recognized that an evaluation of significant data gaps is based on the information available at the time of report issuance, and an evaluation of information received after the report issuance date may result in an alteration of our conclusions, recommendations, or opinions. We have no obligation to provide information obtained or discovered by us after the issuance date of the report, or to perform any additional services, regardless of whether the information would affect any conclusions, recommendations, or opinions in the report. This disclaimer specifically applies to any information that has not been provided by the client.

This report represents our service to you as of the report date and constitutes our final document; its text may not be altered after final issuance. Findings in this report are based upon the site's current utilization, information derived from the most recent reconnaissance and from other activities described herein; such information is subject to change. Certain indicators of the presence of hazardous substances or petroleum products may have been latent, inaccessible, unobservable, or not present during the most recent reconnaissance and may subsequently become observable (such as after site renovation or development). Further, these services are not to be construed as legal interpretation or advice.

1.5 Reliance

This ESA report is prepared for the exclusive use and reliance of Trinity Bank National Association. Use or reliance by any other party is prohibited without the written authorization of Trinity Bank National Association and Terracon Consultants, Inc. (Terracon).

Reliance on the ESA by the client and all authorized parties will be subject to the terms, conditions and limitations stated in the proposal, ESA report, and Terracon's Agreement for Services. The limitation of liability defined in the Agreement for Services is the aggregate limit of Terracon's liability to the client and all relying parties.

Continued viability of this report is subject to ASTM E1527-13 Sections 4.6 and 4.8. If the ESA will be used by a different user (third party) than the user for whom the ESA was originally prepared, the third party must also satisfy the user's responsibilities in Section 6 of ASTM E1527-13.

1.6 Client Provided Information

Prior to the site visit, Mr. Barney C. Wiley, client's representative, was asked to provide the following user questionnaire information as described in ASTM E1527-13 Section 6.

Client Questionnaire Responses

Client Questionnaire Item	Client Did Not Respond	Client's Response	
		Yes	No
Specialized Knowledge or Experience that is material to a REC in connection with the site.			X
Actual Knowledge of Environmental Liens or Activity Use Limitations (AULs) that may encumber the site.			X
Actual Knowledge of a Lower Purchase Price because contamination is known or believed to be present at the site.			X
Commonly Known or Reasonably Ascertainable Information that is material to a REC in connection with the site.			X
Obvious Indicators of Contamination at the site.			X

Terracon's consideration of the client provided information did not identify RECs. A copy of the questionnaire is included in Appendix C.

2.0 PHYSICAL SETTING

Physical Setting Information		Source
Topography		
Site Elevation	Approximately 535 feet above sea level	USGS Topographic Map, Hurst, Texas Quadrangle, 1959 Map Revised 1981 (Appendix A)
Topographic Gradient	Gently sloping towards the south	
Closest Surface Water	Unnamed tributary to Walker Branch, approximately 1,300 feet to the west of the site.	
Soil Characteristics		
Site Soil Type and Description	Bastsil-Urban land complex, 0 to 5 percent slopes. The soil in this complex is deep and nearly level and gently sloping. It is on high terraces above the flood plains of major streams. The complex is about 40 to 60 percent Bastsil soil, 15 to 40 percent Urban land, and as much as 25 percent other soils. The Bastsil soil and Urban land are so intricately mixed that it is not practical to map them separately. The Bastsil soil is	Tarrant County, Texas USDA, Natural Resource Conservation Service Soil Survey issued June 1981

Physical Setting Information		Source
	well drained. Permeability is moderate, available water capacity is high and surface runoff is medium. The hazard of erosion is moderate and the risk of corrosion to uncoated steel is moderate.	
Geology/Hydrogeology		
Formation	Quaternary Terrace Deposits	Bureau of Economic Geology, The University of Texas at Austin, Geologic Atlas of Texas Dallas Sheet, 1972 Revised 1987
Description	Flood-plain deposits including indistinct low terrace deposits. The Quaternary Terrace Deposits consist of interbedded layers of gravel, sand, silty, silty clay and organic matter and generally coarsens downward.	
Estimated Depth to First Occurrence of Groundwater	Within 30 feet below ground surface (bgs)	Terracon's experience in the site area
*Hydrogeologic Gradient	Not known - may be inferred to be parallel to topographic gradient (primarily to the south).	

* The groundwater flow direction and the depth to shallow, unconfined groundwater, if present, would likely vary depending upon seasonal variations in rainfall and other hydrogeological features. Without the benefit of on-site groundwater monitoring wells surveyed to a datum, groundwater depth and flow direction beneath the site cannot be directly ascertained.

3.0 HISTORICAL USE INFORMATION

Terracon reviewed the following historical sources to develop a history of the previous uses of the site and surrounding area, in order to help identify RECs associated with past uses. Copies of selected historical documents are included in Appendix C.

3.1 Historical Topographic Maps, Aerial Photographs, and Sanborn Maps

Readily available historical USGS topographic maps, selected historical aerial photographs (at approximately 10 to 15 year intervals) and historical fire insurance maps produced by the Sanborn Map Company were reviewed to evaluate land development and obtain information concerning the history of development on and near the site. Reviewed historical topographic maps, and aerial photographs are summarized below. Sanborn maps requested from GeoSearch were not available for the site.

- Topographic map: Hurst, Texas, published in **1959**, photorevised in **1968, 1973** and **1981**, Scale: 1"=1,000'
- Aerial photograph: Agricultural Stabilization and Conservation Service (ASCS), **1942, and 1958** Scale: 1"=500'
- Aerial photograph: Army Map Service (AMS), **1953**, Scale: 1"=500'

- Aerial photographs: United States Geological Survey (USGS), **1968**, and **1995**, Scale: 1"=500'
- Aerial photograph: Texas Department of Transportation (TXDOT), **1976**, **1984**, and **1987** Scale: 1"=500'
- Aerial photographs: United States Department of Agriculture (USDA), **2004**, **2005**, **2006**, **2008**, **2010**, **2012**, **2014**, **2016** and **2018**, Scale: 1"=500'

Historical Maps and Aerial Photographs

Direction	Description
Site	Undeveloped land (1942-1952); the site is developed with an apparent residential building on the northern portion of the site and the existing office building on the southern portion (1958-1968); the existing storage/warehouse building on the northwest corner of the site has been constructed, an addition to the west side of the office building has been constructed, and an apparent construction trailer or storage shed has replaced the northern residential building (1976-2004); the construction trailer/storage shed has been removed from the northern portion of the site, and the area appears utilized as parking and storage for construction trucks and trailers, additionally industrial size dumpsters were located south of the storage/warehouse building (2005-2018).
North	Undeveloped land and a pond (1942); pond is no longer visible (1953); the existing Hurst Water Utilities Division Pump Station was constructed abutting the site to the north and west (1988-2018).
East	Souder Drive followed by undeveloped land (1942-1953); the current Sun & Fun building was constructed (1958-2018).
South	Undeveloped land (1942-1953); the existing commercial buildings were constructed to the south (1958-1976); an additional existing building was constructed to the southwest of the site (1984-2018).
West	Undeveloped land and a pond (1942); pond is no longer visible (1953); the existing Hurst Water Utilities Division Pump Station was constructed abutting the site to the north and west (1958-2018).

3.2 Historical City Directories

The Cole, Polk, and Worley's city directories used in this study were made available through the GeoSearch (selected years reviewed: 1965-2019) and were reviewed at approximate five-year intervals, if readily available. Listings which were not identified or available within the city directories for the years reviewed are not listed below. The current street address for the site was identified as 111 and 113 Souder Drive.

Historical City Directories

Direction	Description
Site	111 Souder Drive – No listings. 113 Souder Drive – Noble Paint & Sporting (1965); No Listing (1970); Us Sport Sales (1975); No Listing (1980-1995); Gilbert Marine (1999); Dal-Worth Boat & Marine (2002-2008); Gregg Construction (2008); Watermatress Restoration Inc (2008); Gregg Construction (2014-2019); Tina Johnson (2014); <i>Watermatress Restoration</i> (2014-2019); Designer Lane (2019).
North	116 Hurstview Drive – No listings. 120 Hurstview Drive – No listings. 123 Souder Drive – No listings.
East	316 West Hurst Boulevard – Myers Dept Stores (1965-1970); AL's Formal Wear (1975); Harold S Maddux (1980); Us Sport Sales Inc (1983/84-1999); No Listing (2002-2008); DFW Reconditioning (2014); No Listing (2019).
South	300 West Hurst Boulevard – Worth Food Mart (1965); Piggly Wiggly Food (1970); <i>Hurst Salvage</i> (1975); Howard Colbert (1980); Warehouse Foods (1983/84); No Listing (1990-2019). 332 West Hurst Boulevard – Bell Glass&Mirror (1970-1975); W T Montgomery (1970-1975); No Listing (1980); Hurst Pawn Shop (1983/84-1990); First Cash Pawn (1995); N Tx Combat Mortal (1999); Dal-Worth Plumbing Co (2002); No Listing (2008); Motorcycle Shop (2014-2019). 336 West Hurst Boulevard – Mcknight Builders Supply (1965); Richs Pharmacy (1965); Amer Legn Post 379 (1970-1975); Dorman Little Advertise (1970-1975); No Listing (1980); Amer Legn Post 379 (1983/84); Dorman Little Advertise (1983/84-1995); Little Dorman Adv (1983/84-1995); No Listing (1999-2002); Dc Upholstery (2008); All Brand's Appliance (2014); Denton Edward (2014-2019); A & A Tire & Wheels (2019). 348 West Hurst Boulevard (southwest) – Allied Termite & Pest (1965); Industrial Dcl&Nmplt (1965); No Listing (1970); Tec-Com (1975); No Listing (1980); <i>Cody Air Conditioning & Heating</i> (1983/84-2019); Frank Heating & Air (1983/84); Colleyville Air Cd (1995-1999); Fume Investments (2008); Brazil Martin (2014-2019); Hutchins Heather (2014); Cirrus Mechanical LLC (2019).
West	120 Hurstview Drive – No listings.

South

Hurst Salvage was listed in the 1975 city directory at 300 West Hurst Boulevard, which is located south adjacent to the site. Based on the short duration of operations the Hurst Salvage facility formerly located south of the site does not constitute a REC to the site.

The existing Cody Air Conditioning and Heating facility was listed in the 1983 through 2019 city directories at 348 West Hurst Boulevard. This facility was listed in the regulatory database report and is further discussed in Section 4.1.

RECs were not identified within the historical city directory review.

3.3 Site Ownership

Based on a review of information obtained from the Tarrant County Appraisal District records, the current site owner of the 111 Souder Drive site tract is Everett Charles R Jr, and the current owner of the 113 Souder Drive site tract is Trinity Bank NA. In addition, previous owners for the site tracts included:

- 111 Souder Drive – Berry James R (2005) and Hamilton Robert Estate (2004)
- 113 Souder Drive – Charles R Jr Everett (2014) and Berry James (2005)

3.4 Title Search

At the direction of the client, a title search was not included as part of the scope of services. Unless notified otherwise, we assume that the client is evaluating this information outside the scope of this report.

3.5 Environmental Liens and Activity and Use Limitations (AULs)

The GeoSearch regulatory database report included a review of both Federal and State Engineering Control (EC) and Institutional Control (IC) databases. Based on a review of the database report, the site was not listed on the EC or IC databases. Please note that in addition to these federal and state listings, AULs can be recorded at the county and municipal level that may not be listed in the regulatory database report. Environmental lien and activity and use limitation records recorded against the site were not provided by the client. At the direction of the client, performance of a review of these records was not included as part of the scope of services and unless notified otherwise, we assume that the client is evaluating this information outside the scope of this report.

3.6 Interviews Regarding Current and Historical Site Uses

The following individuals were interviewed regarding the current and historical use of the site.

Interviews

Interviewer	Name / Phone #	Title	Date/Time
Ana Salamanca	Gibson Duwe / (817) 713-9238	Property Broker	8/6/2020 10:00 am
Ana Salamanca	Barney Wiley / (817) 247-8368	Current Owner Representative	8/6/2020 4:10 pm

Terracon interviewed Mr. Duwe, the property broker/sales agent during the site reconnaissance. Mr. Duwe indicated that he has been familiar with the site for approximately one year in association with the sale of the property. He indicated that the site buildings have been vacant since he has been familiar with the site and was not aware of the previous operations on the site. Mr. Duwe was not aware of any environmental concerns associated with the site or any

pending, threatened or past environmental litigation, liens, governmental proceedings or notices of possible violations of environmental laws in connection with the site or adjoining properties.

Terracon interviewed Mr. Barney, the current site owner representative. Mr. Barney has owned the site since approximately 2015 when Trinity Bank acquired the site from the previous owner. He indicated that the site was previously owned and operated by a construction general contractor under the name Gregg Construction and he noted that the owner of the general contractor business also worked under various other names such as Water Mattress Restoration and/or Watermasters. Gregg Construction and Watermasters were identified through the review of historical city directories from 2008 through 2019. To his knowledge, the general contractor utilized the main building as offices and showrooms for insurance claim type of repair jobs. Mr. Barney indicated that the storage/warehouse building was utilized for the storage of carpentry equipment and where installations (such as cabinets) were assembled. Mr. Barney was not aware of site operations prior to the general contracting business. He was not aware of any environmental concerns associated with the site or any pending, threatened or past environmental litigation, liens, governmental proceedings or notices of possible violations of environmental laws in connection with the site or adjoining properties.

3.7 Prior Report Review

Terracon requested the client provide any previous environmental reports they are aware of for the site. Previous reports were not provided by the client to Terracon for review.

4.0 RECORDS REVIEW

Regulatory database information was provided by GeoSearch, a contract information services company. The purpose of the records review was to identify RECs in connection with the site. Information in this section is subject to the accuracy of the data provided by the information services company and the date at which the information is updated. The scope herein did not include confirmation of facilities listed as "unmappable" by regulatory databases.

In some of the following subsections, the words up-gradient, cross-gradient and down-gradient refer to the topographic gradient in relation to the site. As stated previously, the groundwater flow direction and the depth to shallow groundwater, if present, would likely vary depending upon seasonal variations in rainfall and the depth to the soil/bedrock interface. Without the benefit of on-site groundwater monitoring wells surveyed to a datum, groundwater depth and flow direction beneath the site cannot be directly ascertained.

4.1 Federal and State/Tribal Databases

Listed below are the facility listings identified on federal and state/tribal databases within the ASTM-required search distances from the approximate site boundaries. Database definition, descriptions, and the database search report are included in Appendix D.

Federal Databases

Database	Description	Distance (miles)	Listings
NPL	National Priorities List	1.0	0
PNPL	Proposed National Priorities List	1.0	0
DNPL	Delisted National Priorities List	1.0	0
RCRAC	Resource Conservation & Recovery Act - Corrective Action Facilities	1.0	0
RCRAT	Resource Conservation & Recovery Act - Treatment Storage & Disposal Facilities	0.5	0
NLRRCRAT	No Longer Regulated RCRA Non-CORRACTS TSD Facilities	0.5	0
SEMS	Superfund Enforcement Management System (formerly CERCLIS)	0.5	0
SEMSARCH	Superfund Enforcement Management System Archive (formerly CERCLIS NFRAP)	0.5	0
BF	Brownfields Management System	0.5	0
LUCIS	Land Use Control Information System	0.5	0
RCRAG	RCRA Generator Facilities, including RCRA Non-Generator and No Longer Regulated RCRA Generator facilities.	0.1	1
EC/IC	Federal Engineering and Institutional Control Sites	Site	0
ERNS	Emergency Response Notification System	Site	0
FRS	Facility Registration System	Site	0

State/Tribal Databases

Database	Description	Distance (miles)	Listings
SF	State Superfund	1.0	0
IHWCA	Industrial and Hazardous Waste Corrective Action Sites	1.0	2
VCP	Voluntary Cleanup Program	0.5	2
DCRPS	Dry Cleaner Remediation Program Sites	0.5	0
LPST	Leaking Petroleum Storage Tanks	0.5	5
LUSTRO6	Leaking Underground Storage Tanks on Tribal Lands (Region 6 States)	0.5	0
APAR	Affected Property Assessment Reports	0.5	0
BSA	Brownfields Site Assessments	0.5	0
MSWLF	Municipal Solid Waste Landfill Sites	0.5	0
CALF	Closed & Abandoned Landfill Inventory	0.5	0
WMRF	Recycling Facilities	0.5	0

Database	Description	Distance (miles)	Listings
DCR	Dry Cleaner Registration Database	0.25	0
IOP	Innocent Owner / Operator Database	0.25	0
PST	Petroleum Storage Tanks	0.1	1
IHW	Industrial and Hazardous Waste Sites	0.1	1
MSD	Municipal Setting Designations	Site	0
GWCC	Groundwater Contamination Cases	Site	0
LANDAPP	Land Application Permits	Site	0
LIENS	TCEQ Liens	Site	0
NOV	Notice of Violations	Site	0
SIEC01	State Institutional/Engineering Control Sites	Site	0
SPILLS	Spills Listing	Site	0

In addition to the above ASTM-required listings, Terracon reviewed other federal, state, local, and proprietary databases provided by the database firm. A list of the additional reviewed databases is included in the regulatory database report included in Appendix D.

The following table summarizes the site-specific information provided by the database and/or gathered by this office for identified facilities within 500 feet of the site. Facilities are listed in order of proximity to the site. Additional discussion for selected facilities follows the summary table.

Listed Facilities

Facility Name And Location	Estimated Distance / Direction/Gradient	Database Listings	Is a REC, CREC, or HREC to the Site
City Of Hurst Pump Station #1 116 Hurstview Drive	Approximately 25 feet W / down-gradient	TIERII (3)	No, discussed below
Cody AC & Heating 348 W Hurst Blvd	Approximately 100 feet SW / down-gradient	PST	No, discussed below
Kelly Moore Paint Co 301 W Hurst Blvd	Approximately 350 feet / south / down-gradient	LPST (2), IHW, PST, RCRAGR	No, based on distance and gradient

City of Hurst Pump Station #1

The north adjoining City of Hurst Pump Station #1 was listed in the regulatory database report as a Tier II Chemical Reporting Program facility. According to the listing, the City of Hurst Pump Station #1 (city water treatment and supply) stores up to 300 pounds of chlorine and ammonia in a chemical storage building. No releases or incidents at this facility have been reported. Based on the nature of operations (city water storage, treatment and supply), the north and west adjoining City of Hurst Pump Station #1 does not constitute a REC to the site.

Cody AC & Heating

The Cody AC & Heating, formerly located southwest of the site and topographically down-gradient relative to the site, was identified in the regulatory database report as a TCEQ PST facility. The main site building at this facility is located approximately 100 feet southwest of the site in a topographic down-gradient position relative to the site. According to the regulatory database report, Cody AC & Heating previously operated one 2,000-gallon gasoline underground storage tank (UST), which was installed in May 1983 and removed from the ground in August 1993. The UST and associated piping were constructed of steel. Based on the review of historical aerial photographs it appears that the tankhold was located approximately 245 feet southwest of the site along West Hurst Boulevard. The facility was not listed as a TCEQ LPST facility in the regulatory database report. Based on the distance, topographic gradient, and regulatory non-LPST status, the Cody AC & Heating facility does not constitute a REC to the site.

The remaining facilities listed in the database report do not appear to represent RECs to the site at this time based upon regulatory status, apparent topographic gradient, and/or distance from the site.

Unmapped facilities are those that do not contain sufficient address or location information to evaluate the facility listing locations relative to the site. The report did not list facilities in the unmapped section.

4.2 Local Agency Inquiries

Agency Contacted/ Contact Method	Response
Hurst City Secretary / By on-line form	The Hurst City Secretary was contacted by on-line form requesting environmental records or information indicating environmental concerns for the site. At the issuance of this report, a response has not been received.

4.3 Local Area Knowledge

Pipeline and Oil/Gas Well Review

Based on a review of the Railroad Commission of Texas (RRC) website, no gas wells, oil wells, or pipelines were identified on the site or within tenth of a mile from the site.

North Central Texas Council of City Governments (NCTCOG)

The NCTCOG maintains a multi-county database of permitted and unpermitted closed landfills. According to the NCTCOG website, no closed landfills have been recorded within a tenth of mile from the site.

Texas Water Development Board

Terracon reviewed the on-line Texas Water Development Board interactive water data map to identify registered water wells or monitoring wells on or adjacent to the site. Based on a review of the on-line records, no water wells or monitoring wells were located on or adjacent to the site.

5.0 SITE RECONNAISSANCE

5.1 General Site Information

Information contained in this section is based on a visual reconnaissance conducted while walking through the site and the accessible interior areas of structures, if any, located on the site. The site and adjoining properties are depicted on the Site Diagram, which is included in Exhibit 2 of Appendix A. Photo documentation of the site at the time of the visual reconnaissance is provided in Appendix B. Credentials of the individuals planning and conducting the site visit are included in Appendix E.

General Site Information

Site Reconnaissance				
Field Personnel	Ana C. Salamanca			
Reconnaissance Date	August 6, 2020			
Weather Conditions	~ 95 F, Sunny			
Site Contact/Title	Gibson Duwe / Property Broker			
Building Description				
Building Identification	Building Use	Approx. Construction Date	Number of Stories	Approx. Size (ft²)
Main Building	Offices and showrooms	1957	1	3,239
Storage/Warehouse	Wood shop and product storage	Late-1970s	1	1,441
Site Utilities				
Drinking Water	City of Hurst			
Wastewater				
Electric	TXU/Oncor			
NaturalGas	Atmos			

5.2 Overview of Current Site Occupants

The site is improved with a 3,239-square foot (sf) office/showroom building, a 1,441-sf storage/warehouse building, asphalt-paved parking areas, and utilities. The site is currently vacant.

5.3 Overview of Current Site Operations

At the time of the site reconnaissance, the site buildings were vacant and no operations were occurring at the site

5.4 Site Observations

The following table summarizes site observations and interviews. Affirmative responses (designated by an “X”) are discussed in more detail following the table.

Site Characteristics

Category	Item or Feature	Observed or Identified
Site Operations, Processes, and Equipment	Emergency generators	
	Elevators	
	Air compressors	
	Hydraulic lifts	
	Dry cleaning	
	Photo processing	
	Ventilation hoods and/or incinerators	
	Waste treatment systems and/or water treatment systems	
	Heating and/or cooling systems	X
	Paint booths	
	Sub-grade mechanic pits	
	Wash-down areas or carwashes	
	Pesticide/herbicide production or storage	
	Printing operations	
	Metal finishing (e.g., electroplating, chrome plating, galvanizing, etc.)	
	Salvage operations	
	Oil, gas or mineral production	
	Other processes or equipment	
Aboveground	Aboveground storage tanks	

Category	Item or Feature	Observed or Identified
Chemical or Waste Storage	Drums, barrels and/or containers ≥ 5 gallons	
	MSDS or SDS	
Underground Chemical or Waste Storage, Drainage or Collection Systems	Underground storage tanks or ancillary UST equipment	
	Sumps, cisterns, French drains, catch basins and/or dry wells	
	Grease traps	
	Septic tanks and/or leach fields	
	Oil/water separators, clarifiers, sand traps, triple traps, interceptors	
	Pipeline markers	
	Interior floor drains	
Electrical Transformers/PCBs	Transformers and/or capacitors	
	Other equipment	
Releases or Potential Releases	Stressed vegetation	
	Stained soil	
	Stained pavement or similar surface	
	Leachate and/or waste seeps	
	Trash, debris and/or other waste materials	
	Dumping or disposal areas	
	Construction/demolition debris and/or dumped fill dirt	
	Surface water discoloration, odor, sheen, and/or free floating product	
	Strong, pungent or noxious odors	
	Exterior pipe discharges and/or other effluent discharges	
Other Notable Site Features	Surface water bodies	
	Quarries or pits	
	Wastewater lagoons	
	Wells	

Site Operations, Processes, and Equipment

Heating and/or cooling systems

The on-site main office building was equipped with floor-mounted HVAC units located on the northern side of the building. Based on observation, the HVAC equipment does not constitute a REC to the site.

6.0 ADJOINING PROPERTY RECONNAISSANCE

Visual observations of adjoining properties (from site boundaries) are summarized below.

Adjoining Properties

Direction	Description
North	City of Hurst Water Utilities Division Pump Station (120 Hurstview Drive).
East	Souder Drive followed by a Fun N Sun Sports Center (316 Souder Drive).
South	The Motor Cycle Shop (332 West Hurst Boulevard), A&A Tire and Weheels (336 West Hurst Boulevard), <u>Cody Air Conditioning and Heating</u> (southwest of the site at 348 West. Hurst Boulevard).
West	City of Hurst Water Utilities Division Pump Station (120 Hurstview Drive).

Cody Air Conditioning and Heating located to the southwest of the site was listed in the regulatory database report and was previously discussed in Section 4.1. RECs were not observed with the current adjoining properties.

7.0 ADDITIONAL SERVICES


Per the agreed scope of services specified in the proposal, additional services (e.g. asbestos sampling, lead-based paint sampling, wetlands evaluation, lead in drinking water testing, radon testing, vapor encroachment screening, etc.) were not conducted.

8.0 DECLARATION

I, Jack A. McCranie, declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in Section 312.10 of 40 CFR 312; and I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the site. I have developed and performed the All Appropriate Inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Jack A. McCranie
Environmental Professional

APPENDIX A
EXHIBIT 1 – TOPOGRAPHIC MAP
EXHIBIT 2 – SITE DIAGRAM

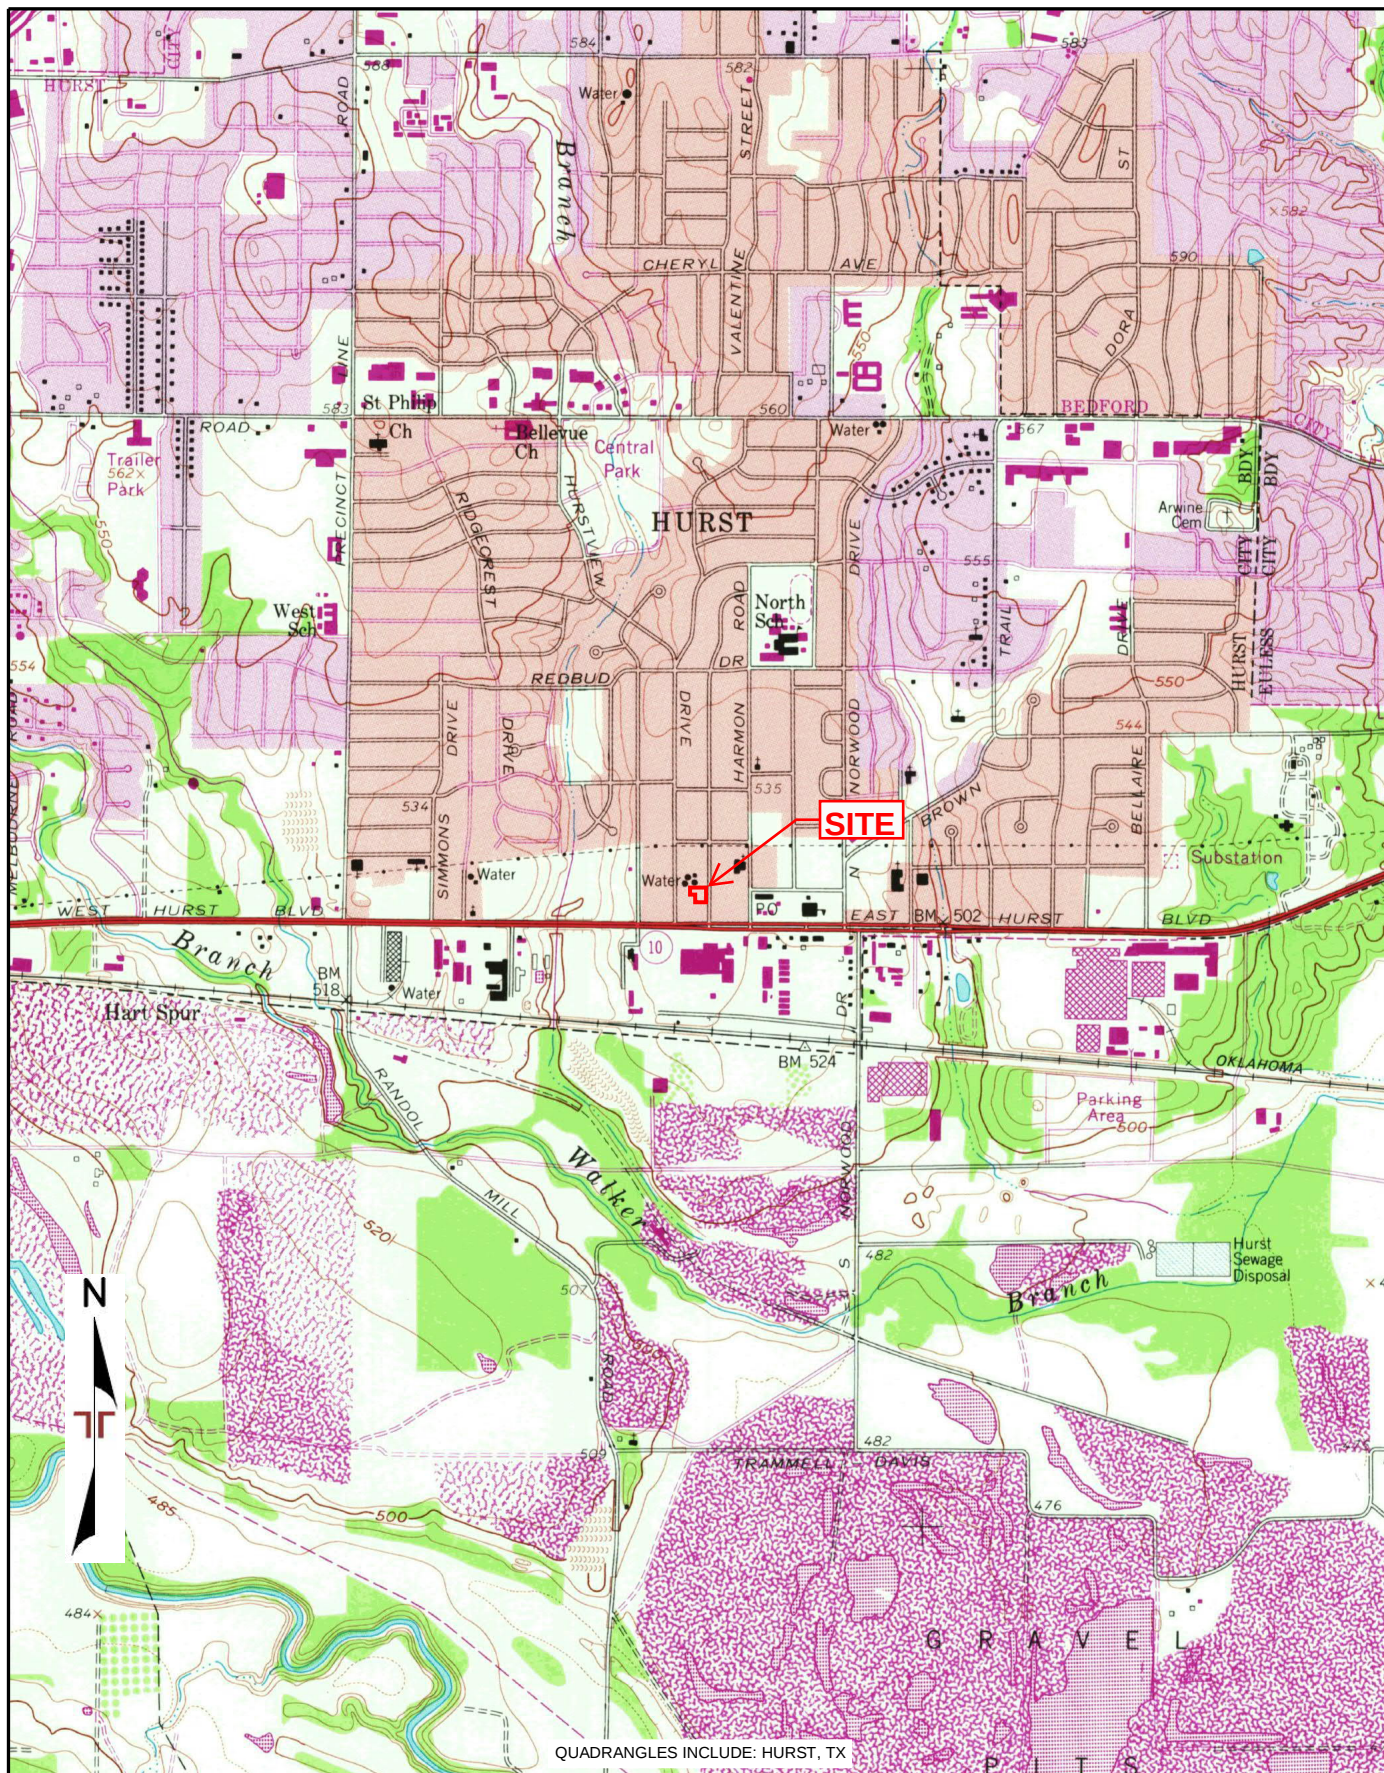


Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 2000'
Checked by:	File Name:
Approved by:	Date: 1981

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

TOPOGRAPHIC MAP
Hurst Industrial Site
111 and 113 Souder Drive
Hurst, Tarrant County, Texas

EXHIBIT
1

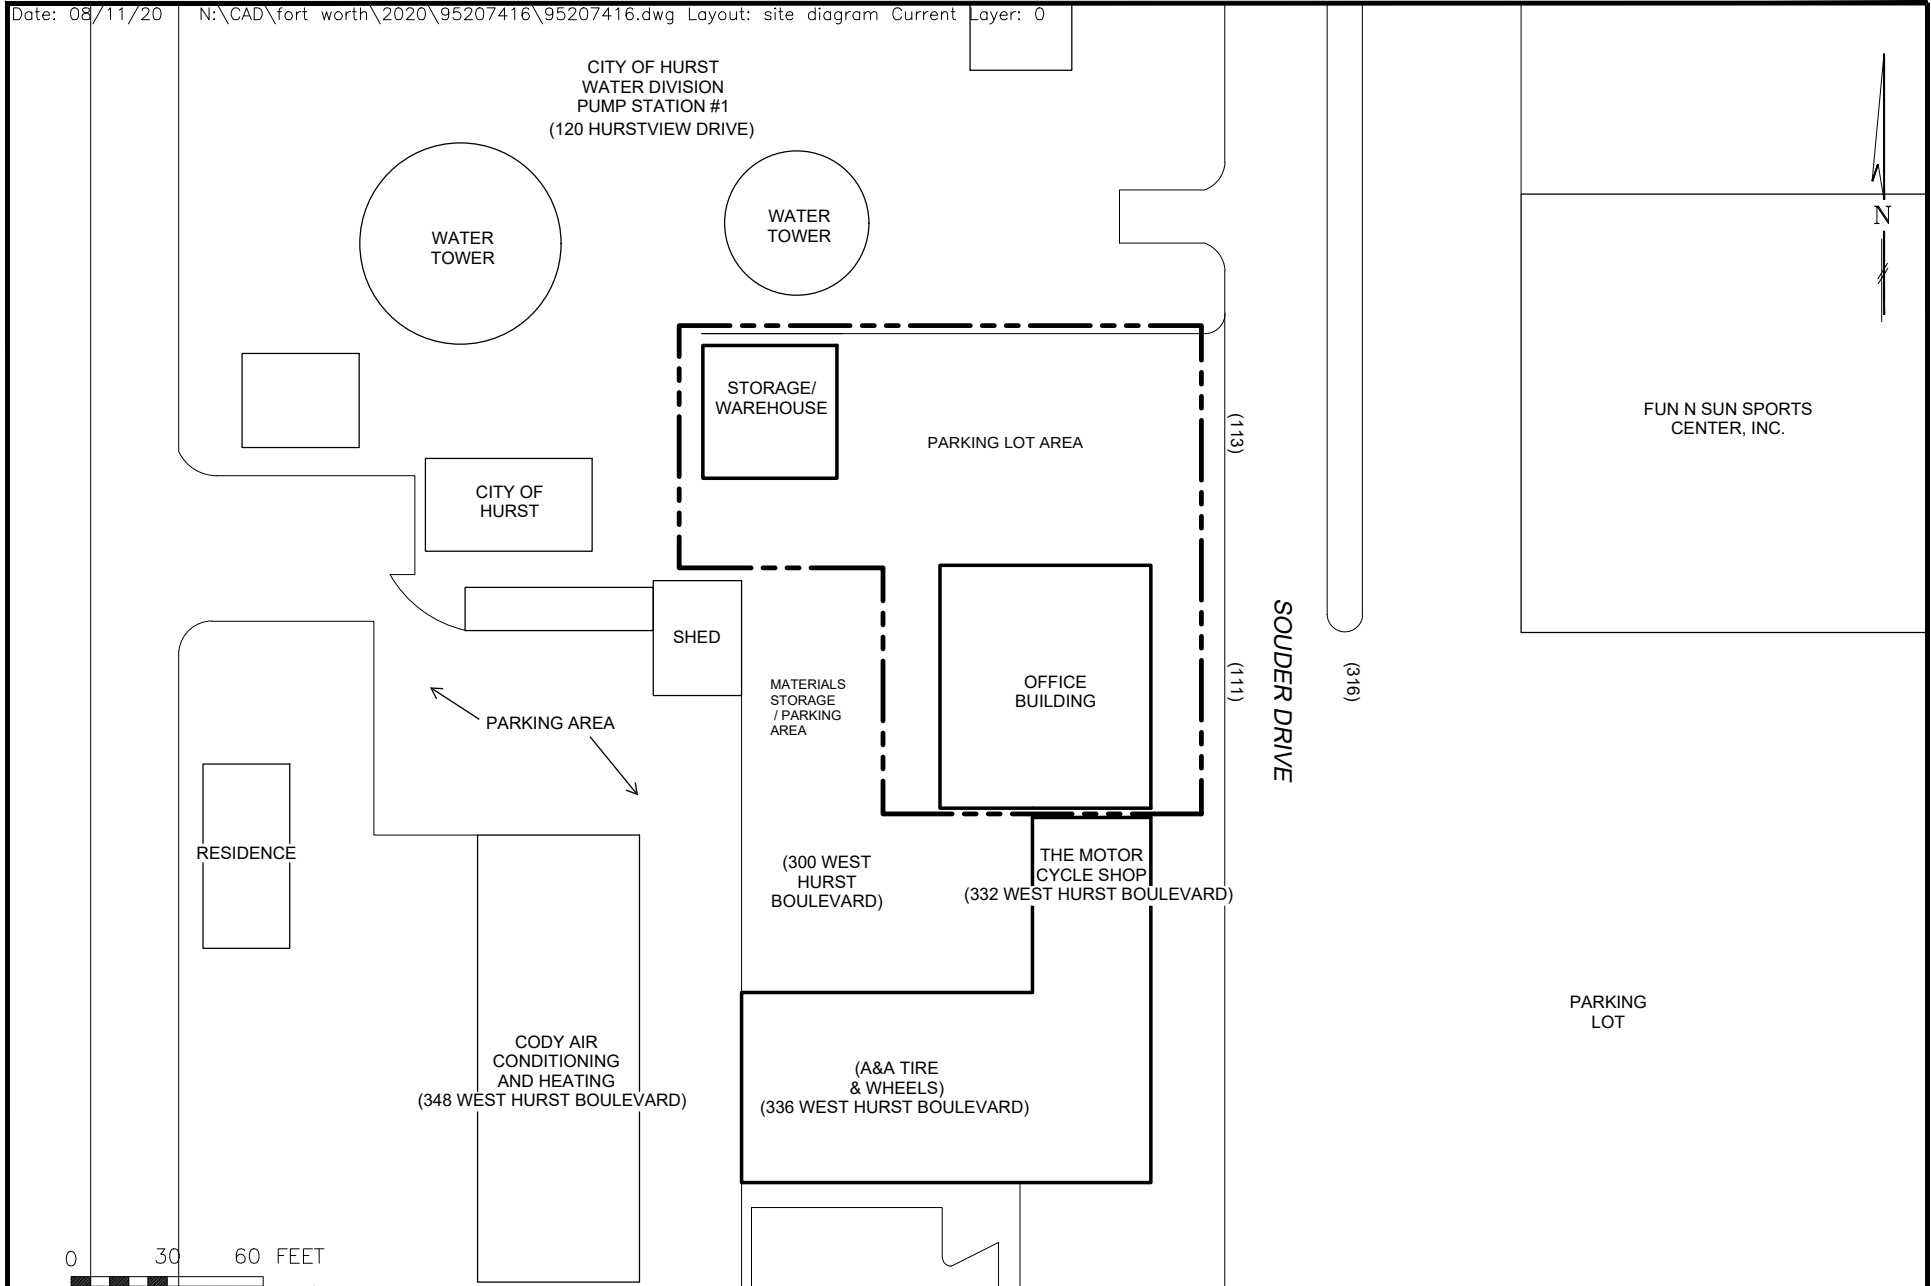

0 30 60 FEET

APPROXIMATE SCALE

THIS DRAWING SHOULD
NOT BE USED SEPARATELY
FROM ORIGINAL REPORT.

Project Mngnr:	ACS	Project No.	95207416
Drawn By:	JJD	Scale:	AS SHOWN
Checked By:	ACS	Date:	08/11/20
Approved By:	JAM		

Terracon
Consulting Engineers and Scientists
(Registration No.: F-3272)
2501 EAST LOOP 820 N. FORT WORTH, TX 76118
PH. (817) 268-8600 FAX. (817) 268-8602

SITE DIAGRAM

HURST INDUSTRIAL SITE
111 AND 113 SOUDER DRIVE
HURST, TARRANT COUNTY, TEXAS

EXHIBIT

2

APPENDIX B
SITE PHOTOGRAPHS

Phase I Environmental Site Assessment

Hurst Industrial Site ■ Hurst, Texas

Date Photos Taken: August 6, 2020 ■ Terracon Project No. 95207416



Photo #1 View of the site as seen from the southeast corner of the site.



Photo #2 View of the site as seen from the northeast corner of the site.



Photo #3 Typical view of the front entrance area of the office building.



Photo #4 Typical view of an office.



Photo #5 Typical view of the showroom area of the office building.



Photo #6 Typical view of the light fixture room located in the western portion of the office building.

Phase I Environmental Site Assessment

Hurst Industrial Site ■ Hurst, Texas

Date Photos Taken: August 6, 2020 ■ Terracon Project No. 95207416



Photo #7 View of the exterior of the storage/warehouse building.



Photo #8 View of the cabinet/carpentry portion of the storage/warehouse building.



Photo #9 View of the equipment storage portion of the storage/warehouse building.



Photo #10 View of the asphalt-paved parking area on the northern portion of the site.



Photo #11 View of the City of Hurst Water Utilities Division Pump Station located to the north and west of the site.



Photo #12 View of Souder Drive to the east of the site followed by a Fun N Suns Sports store.

Phase I Environmental Site Assessment

Hurst Industrial Site ■ Hurst, Texas

Date Photos Taken: August 6, 2020 ■ Terracon Project No. 95207416



Photo #13 View of the south adjoining Motor Cycle Shop, A&A Tire & Wheels, and Cody Air Conditioning and Heating.

APPENDIX C
HISTORICAL DOCUMENTATION AND USER QUESTIONNAIRE



Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2018

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C



Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2016

Terracon
2501 E. Loop 820 North Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C



Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2014

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C



Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2012

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C



Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2010

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C




Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2008

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C

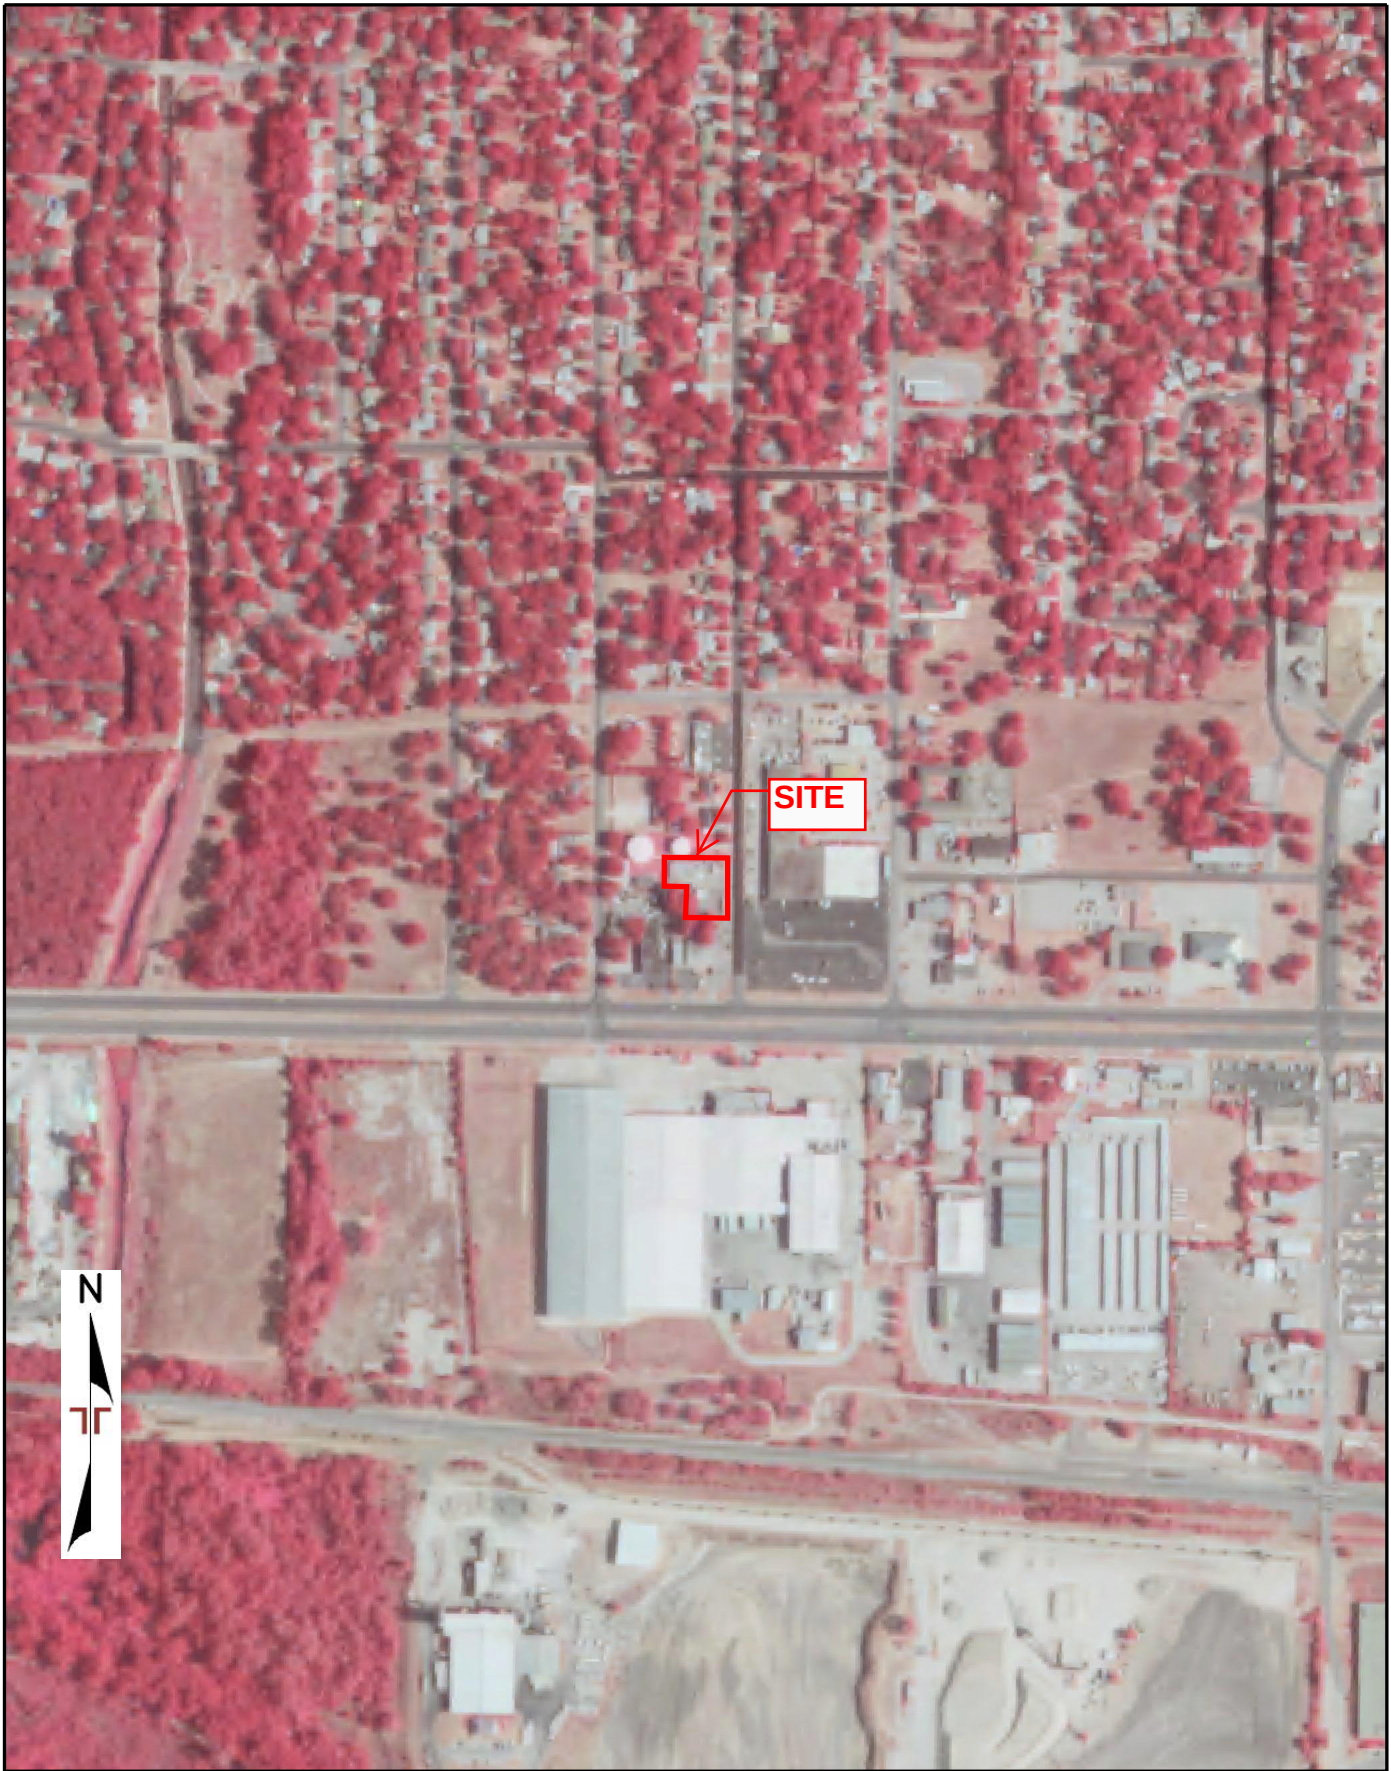


Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2006

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C

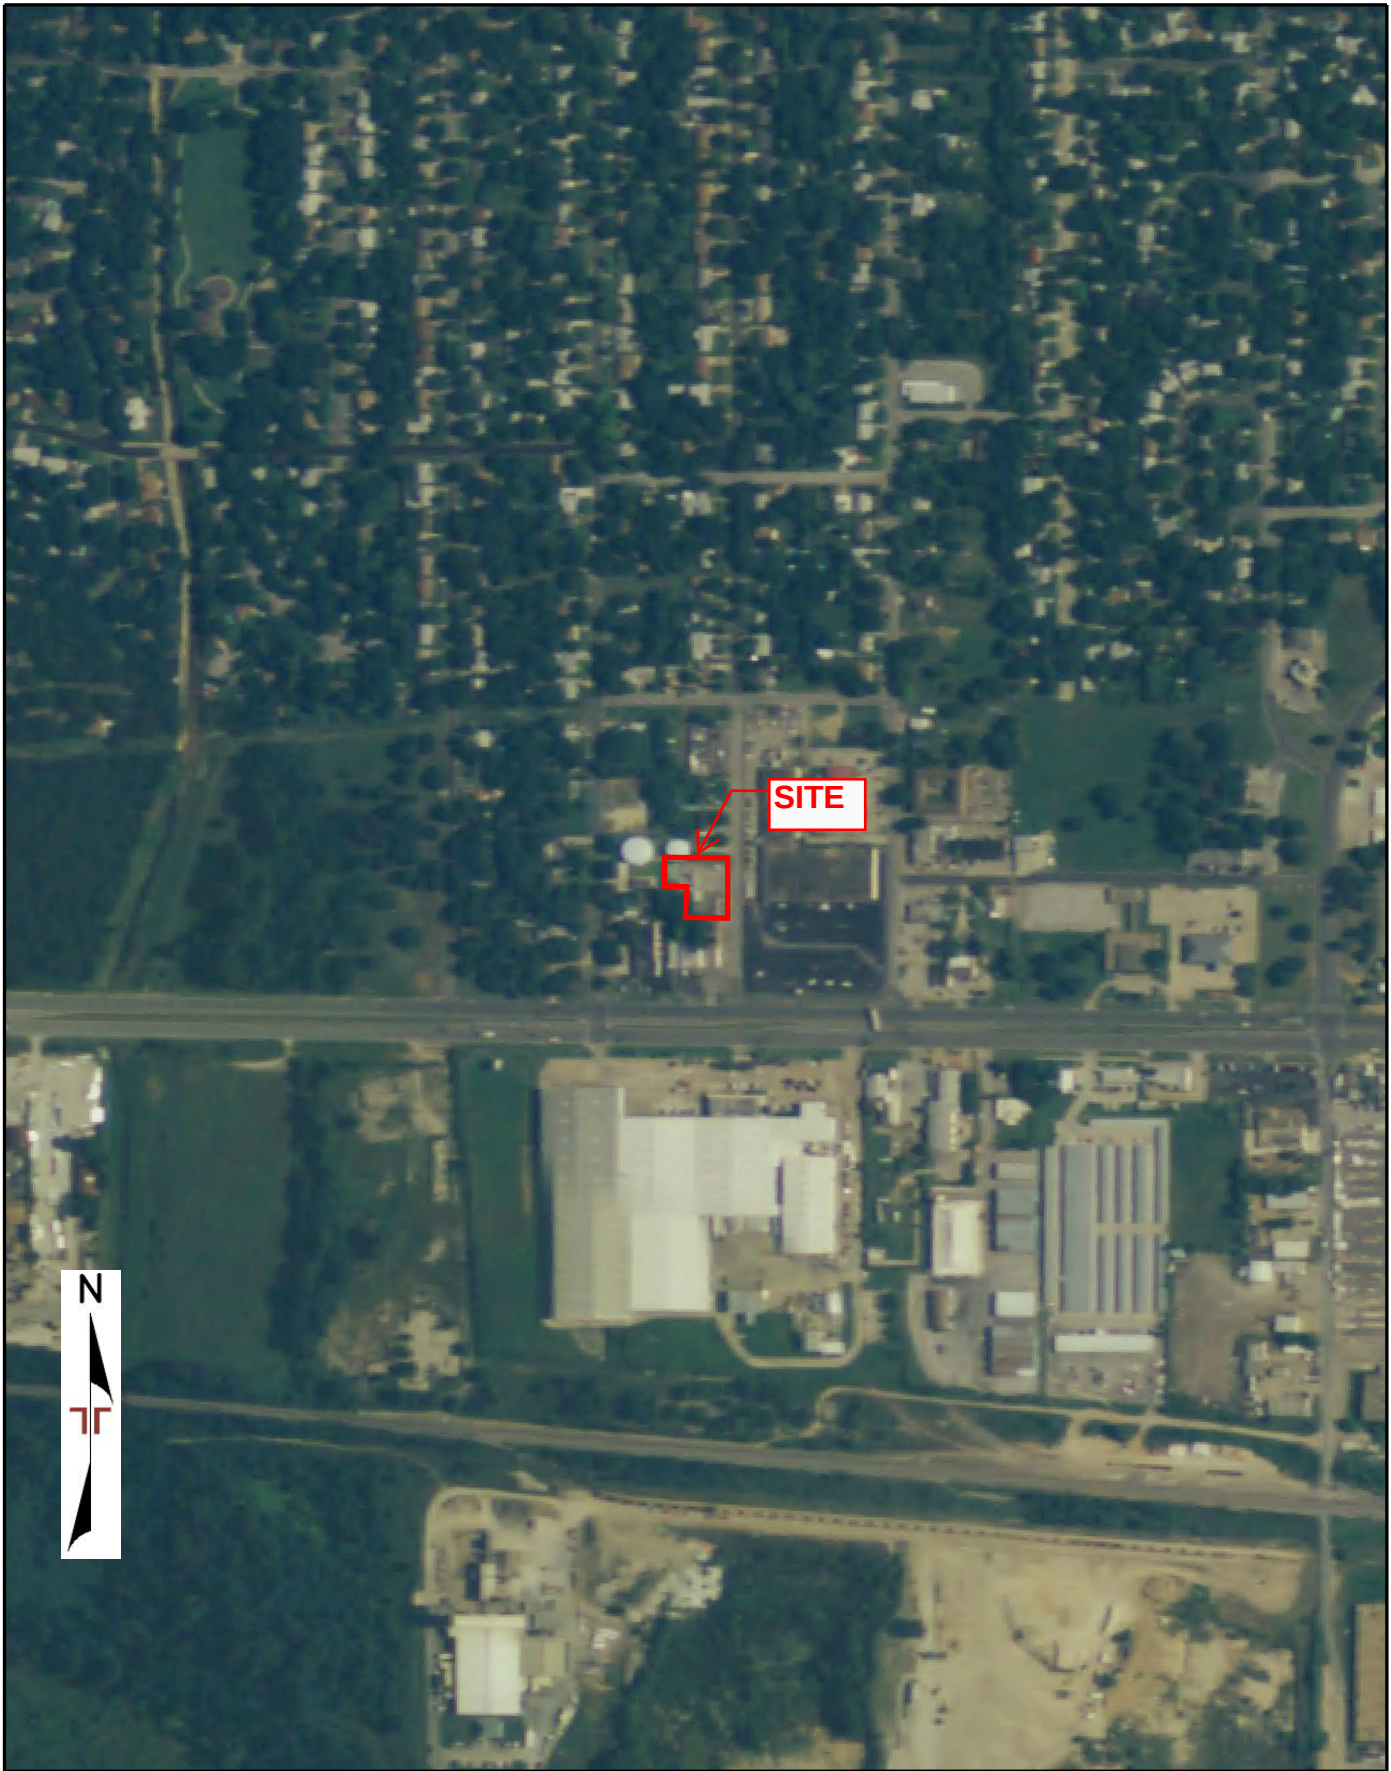

Project Manager:
Drawn by:
Checked by:
Approved by:

Project No:	95207416
Scale:	1" = 500'
File Name:	USDA
Date:	2005

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C




Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USDA
Approved by:	Date: 2004

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH

Hurst Industrial Site
111 and 113 Souder Drive
Hurst, Tarrant County, Texas 76053

Appendix
C

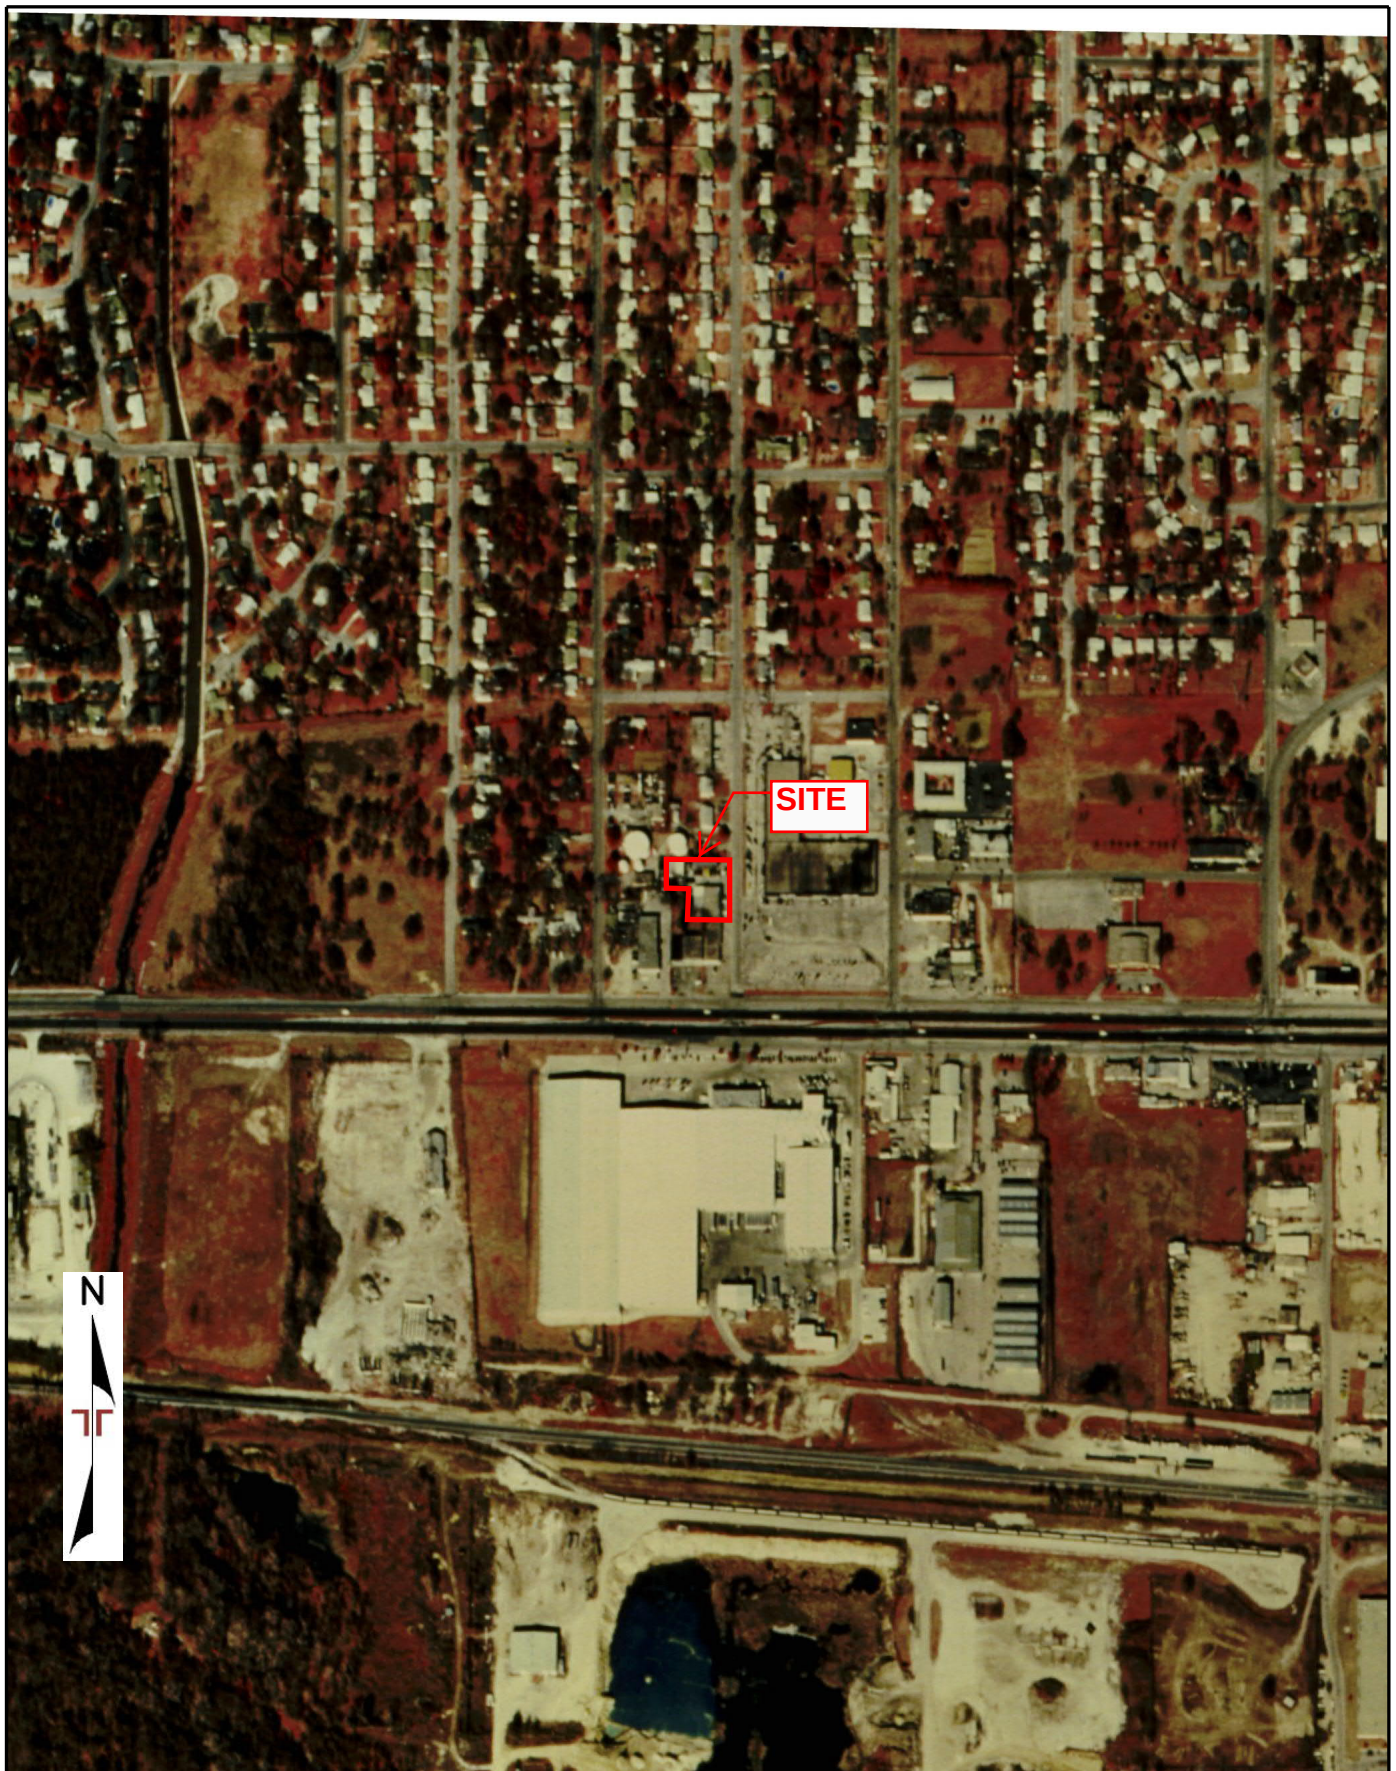


Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USGS
Approved by:	Date: 01/31/1995

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C

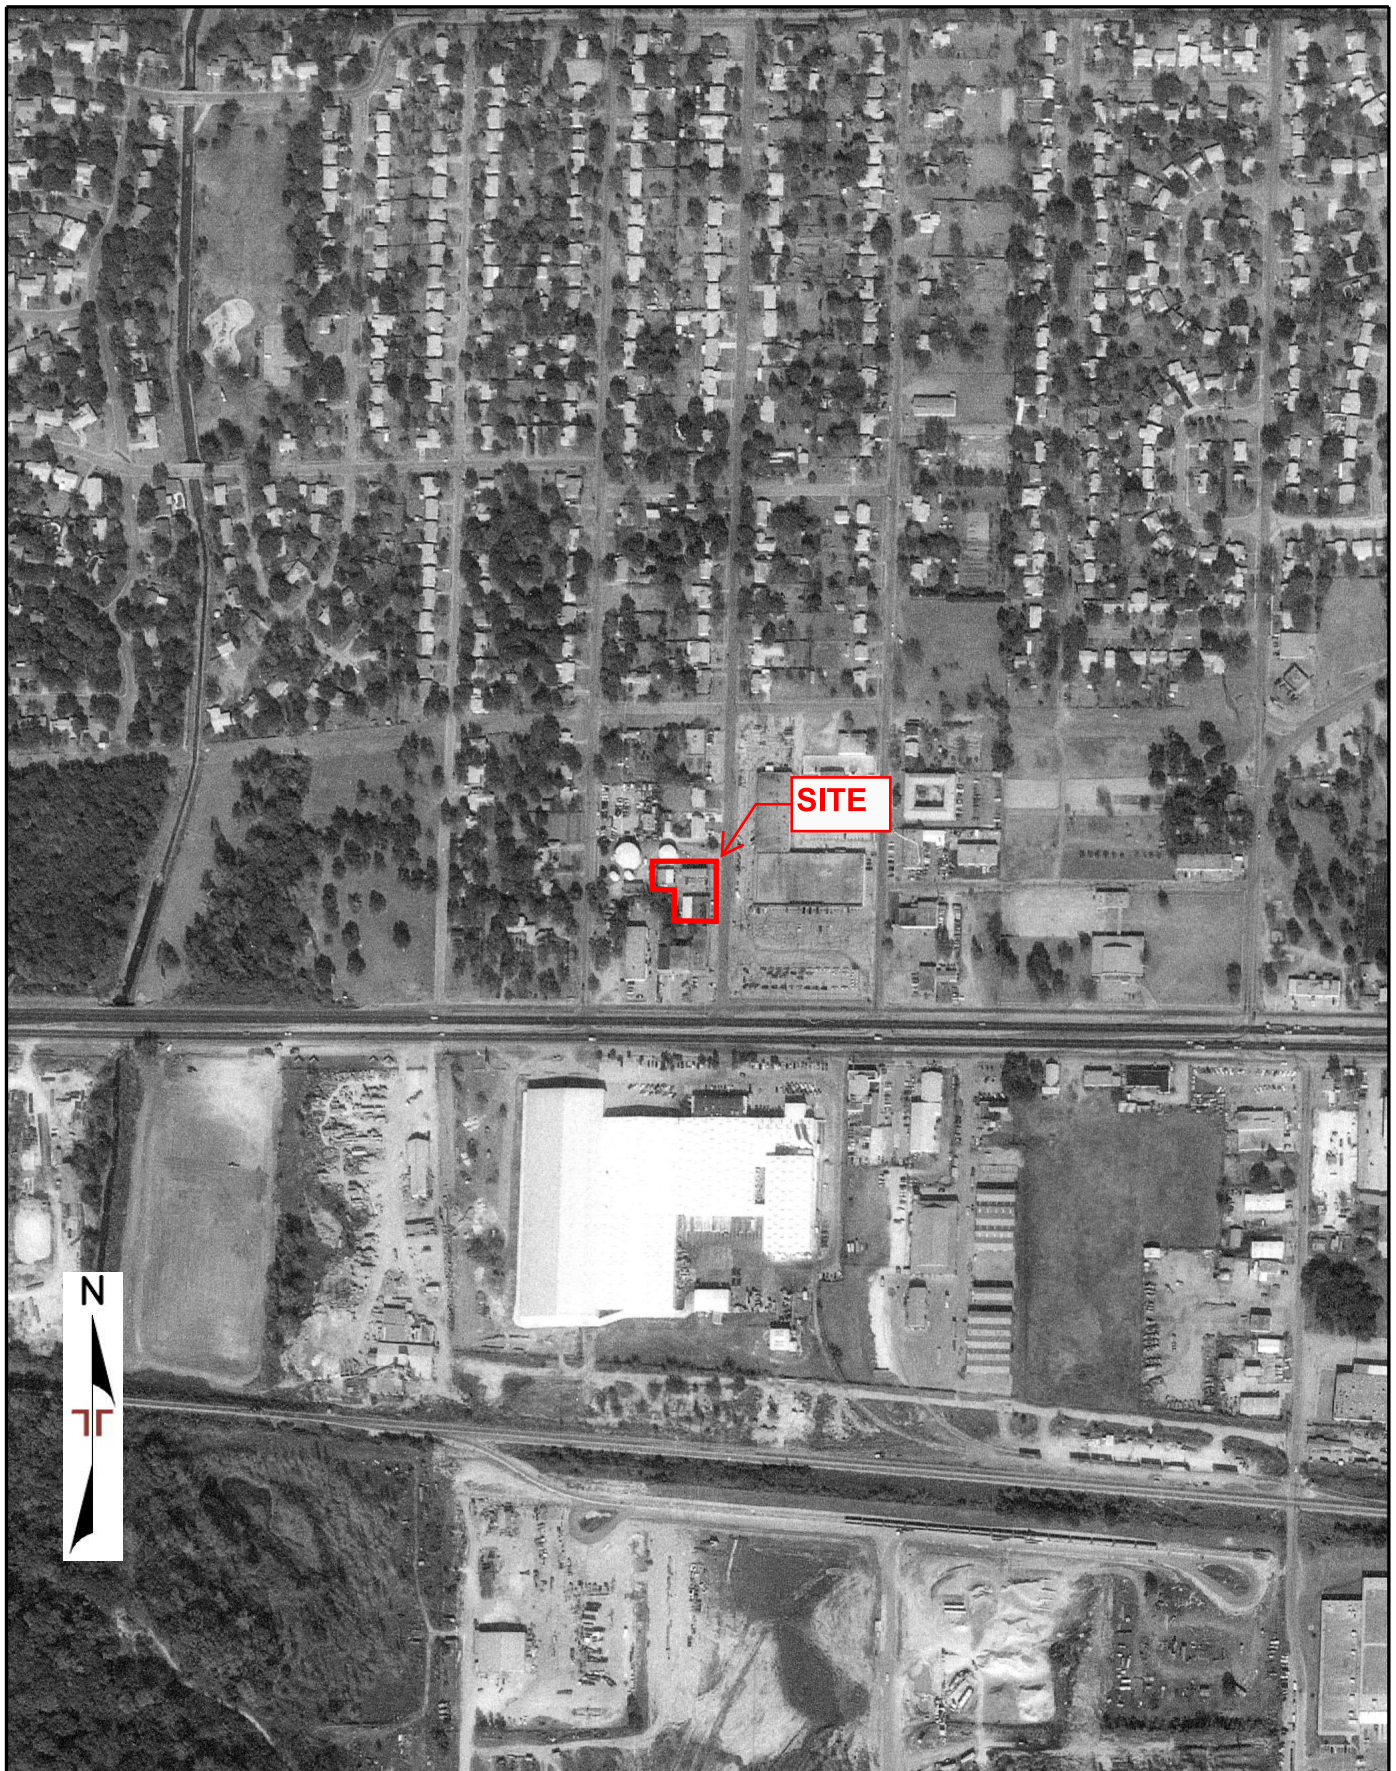


Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: TXDOT
Approved by:	Date: 11/13/1987

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site
 111 and 113 Souder Drive
 Hurst, Tarrant County, Texas 76053

Appendix
C

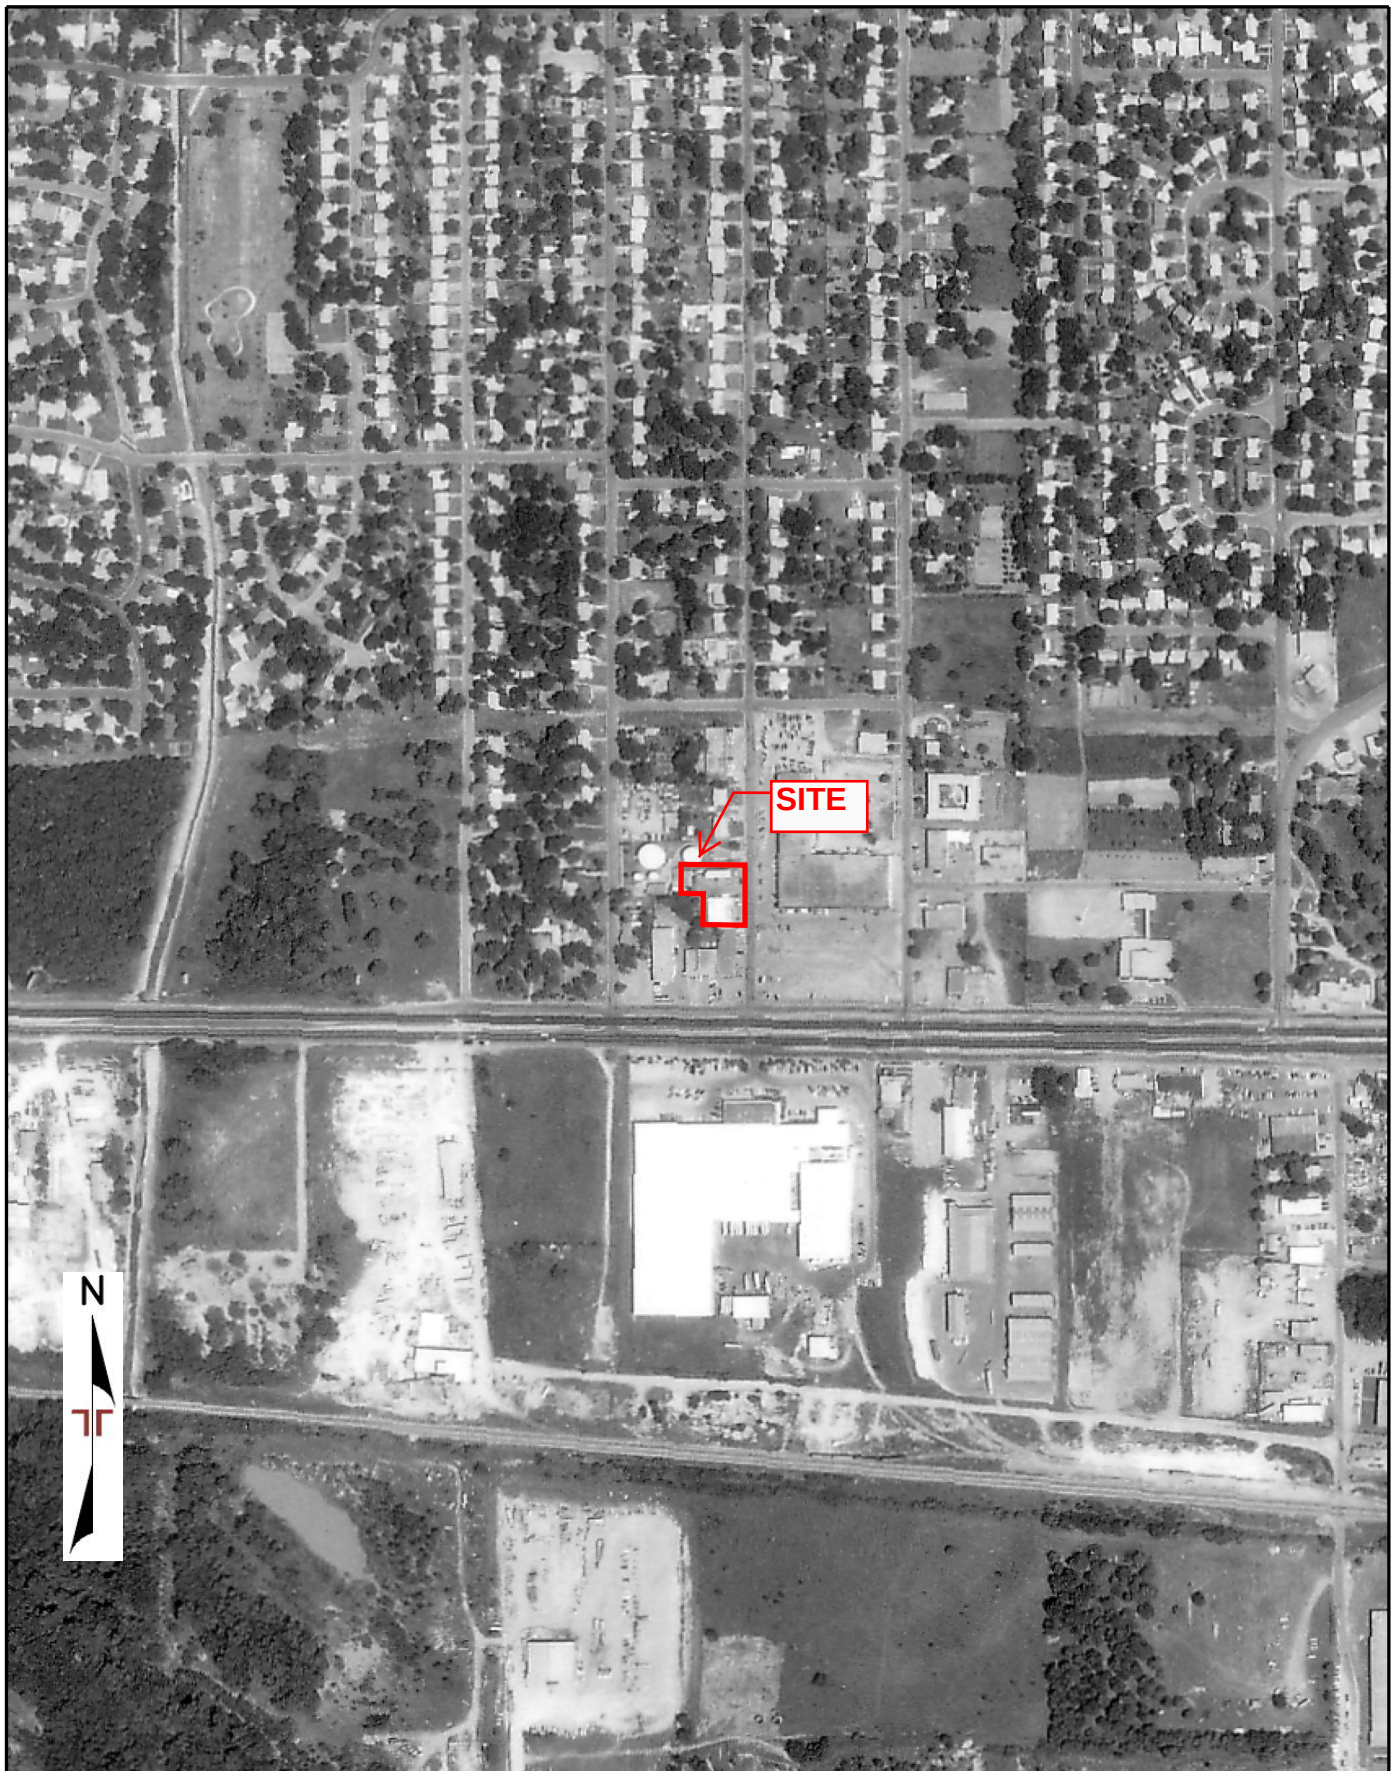


Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: TXDOT
Approved by:	Date: 05/11/1984

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C

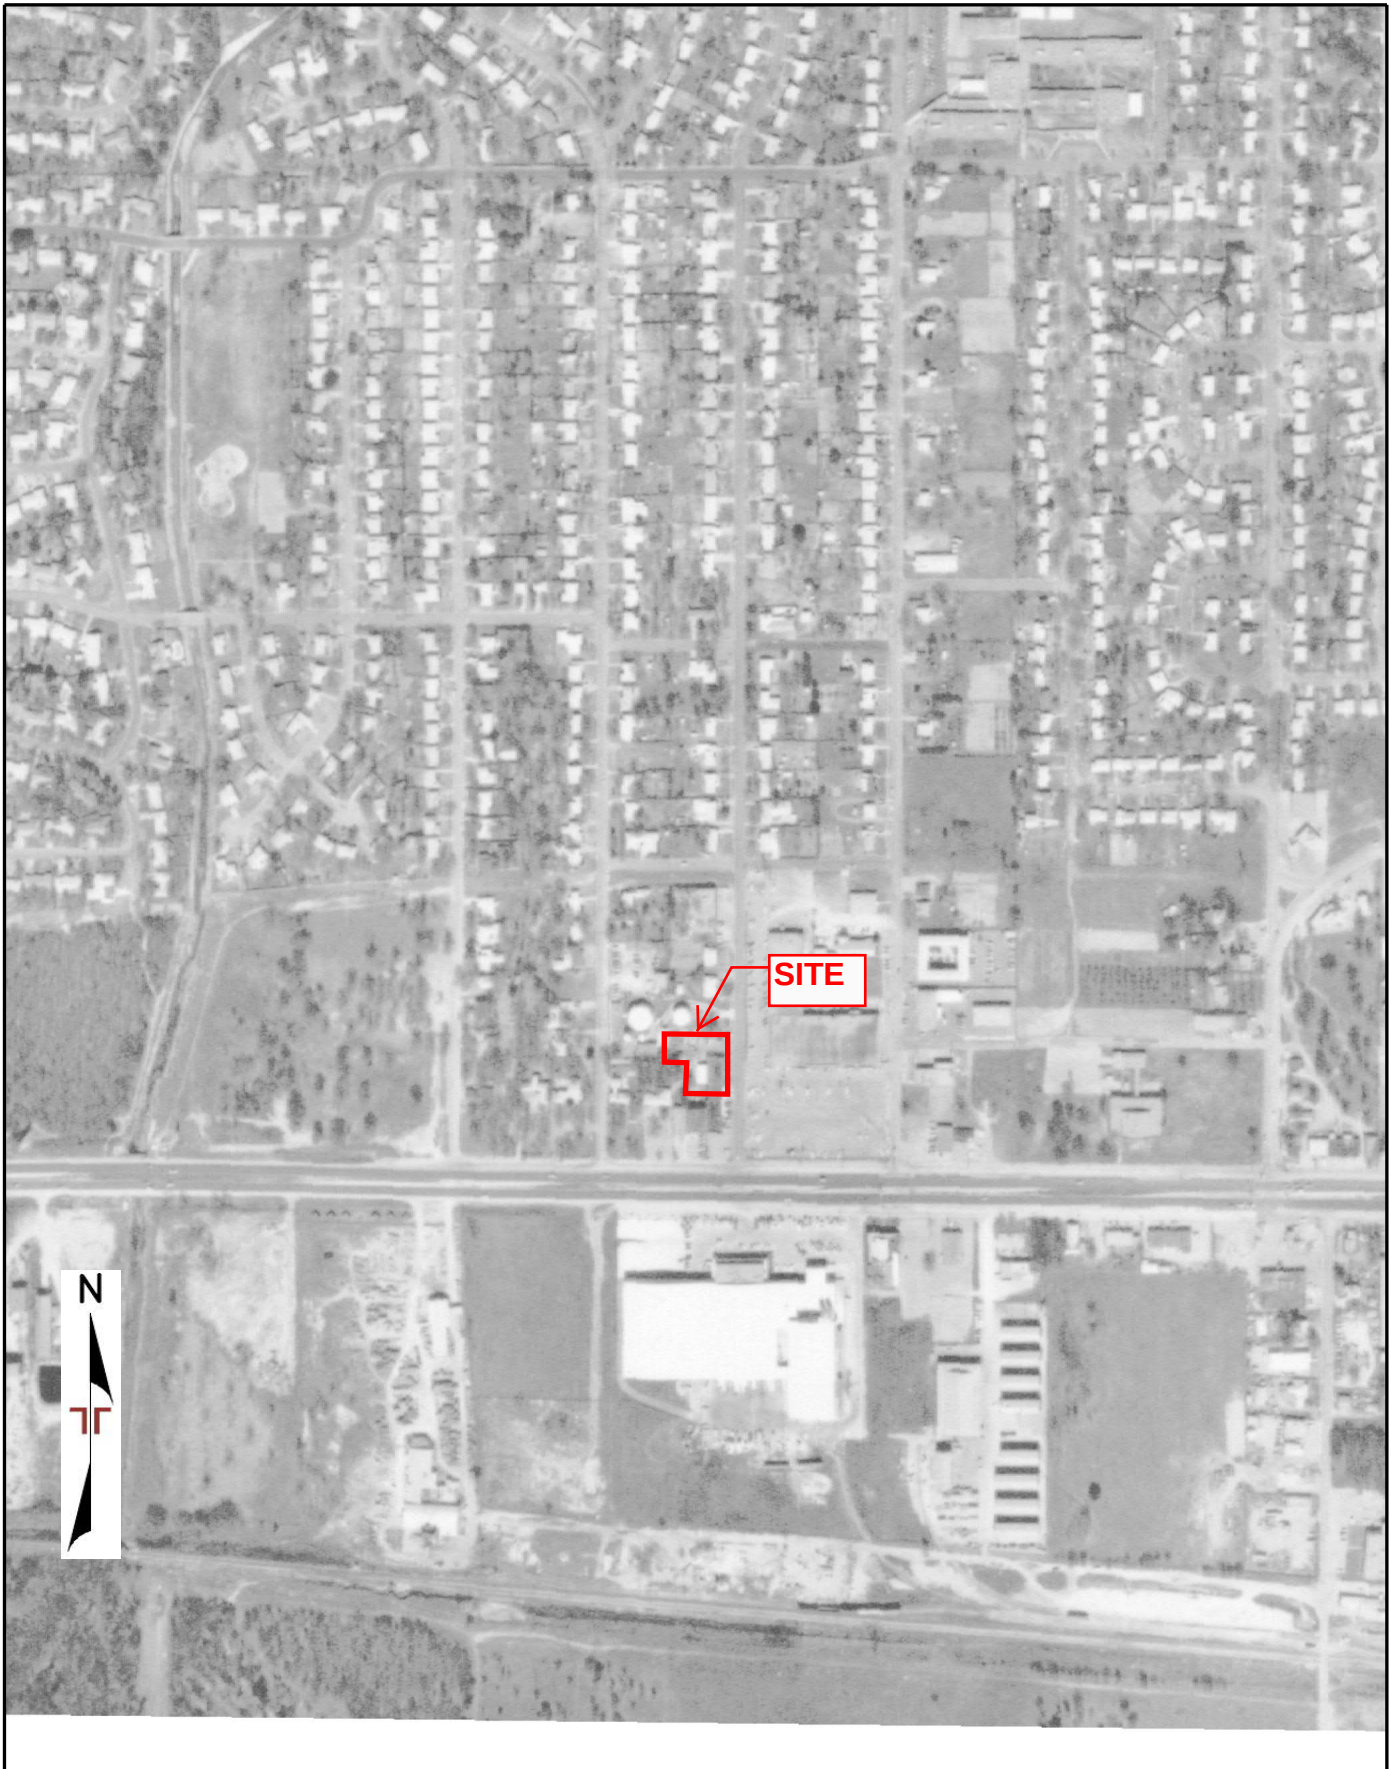

Project Manager:
Drawn by:
Checked by:
Approved by:

Project No:
Scale:
File Name:
Date:

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH

Hurst Industrial Site
111 and 113 Souder Drive
Hurst, Tarrant County, Texas 76053

Appendix
C




Project Manager:
Drawn by:
Checked by:
Approved by:

Project No:	95207416
Scale:	1" = 500'
File Name:	TXDOT
Date:	03/16/1976

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C

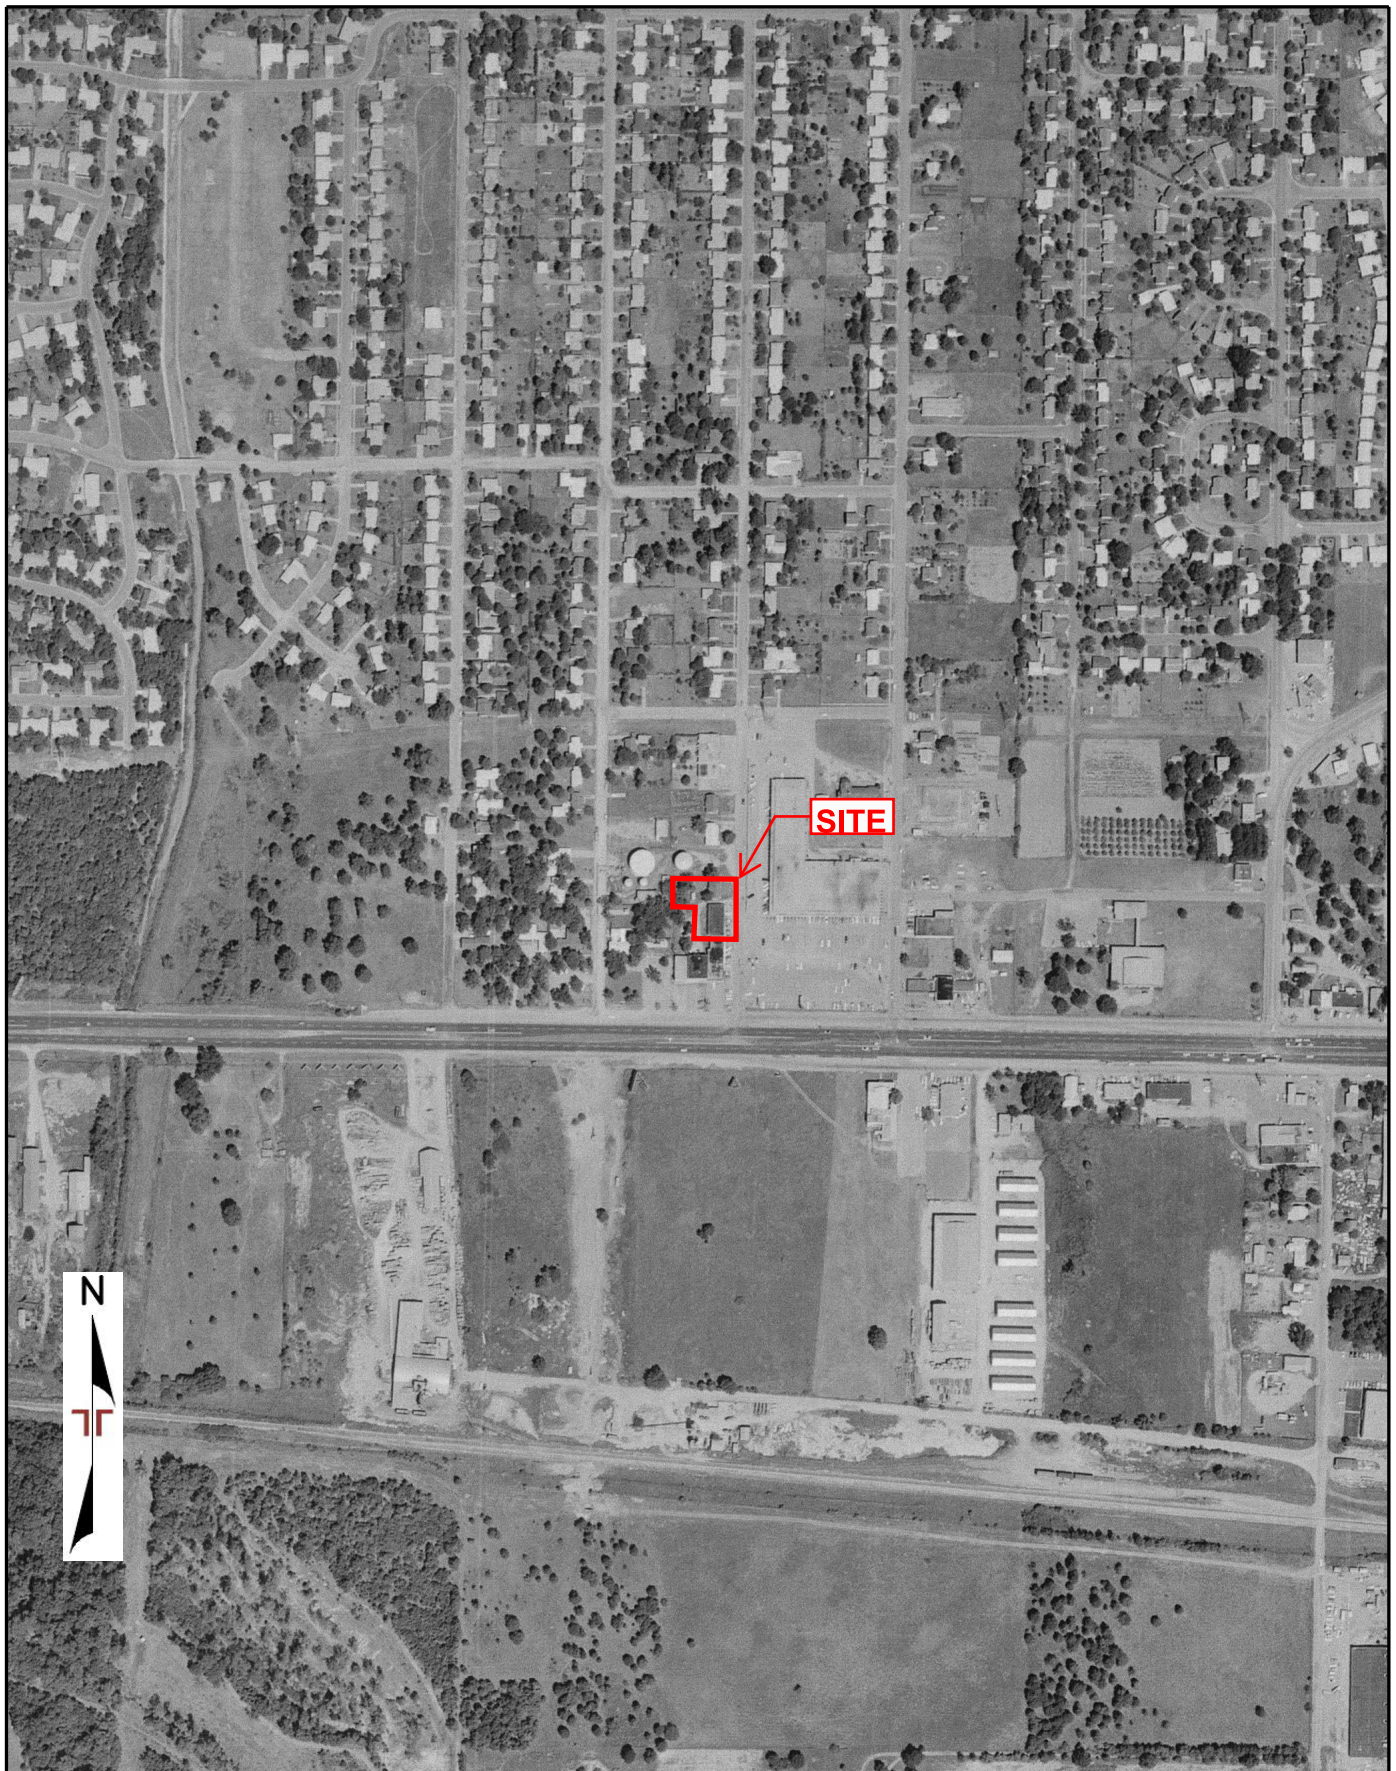


Project Manager:	Project No: 95207416
Drawn by:	Scale: 1" = 500'
Checked by:	File Name: USGS
Approved by:	Date: 09/18/1968

Terracon
 2501 E. Loop 820 North
 Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant, County Texas 76053

Appendix
C

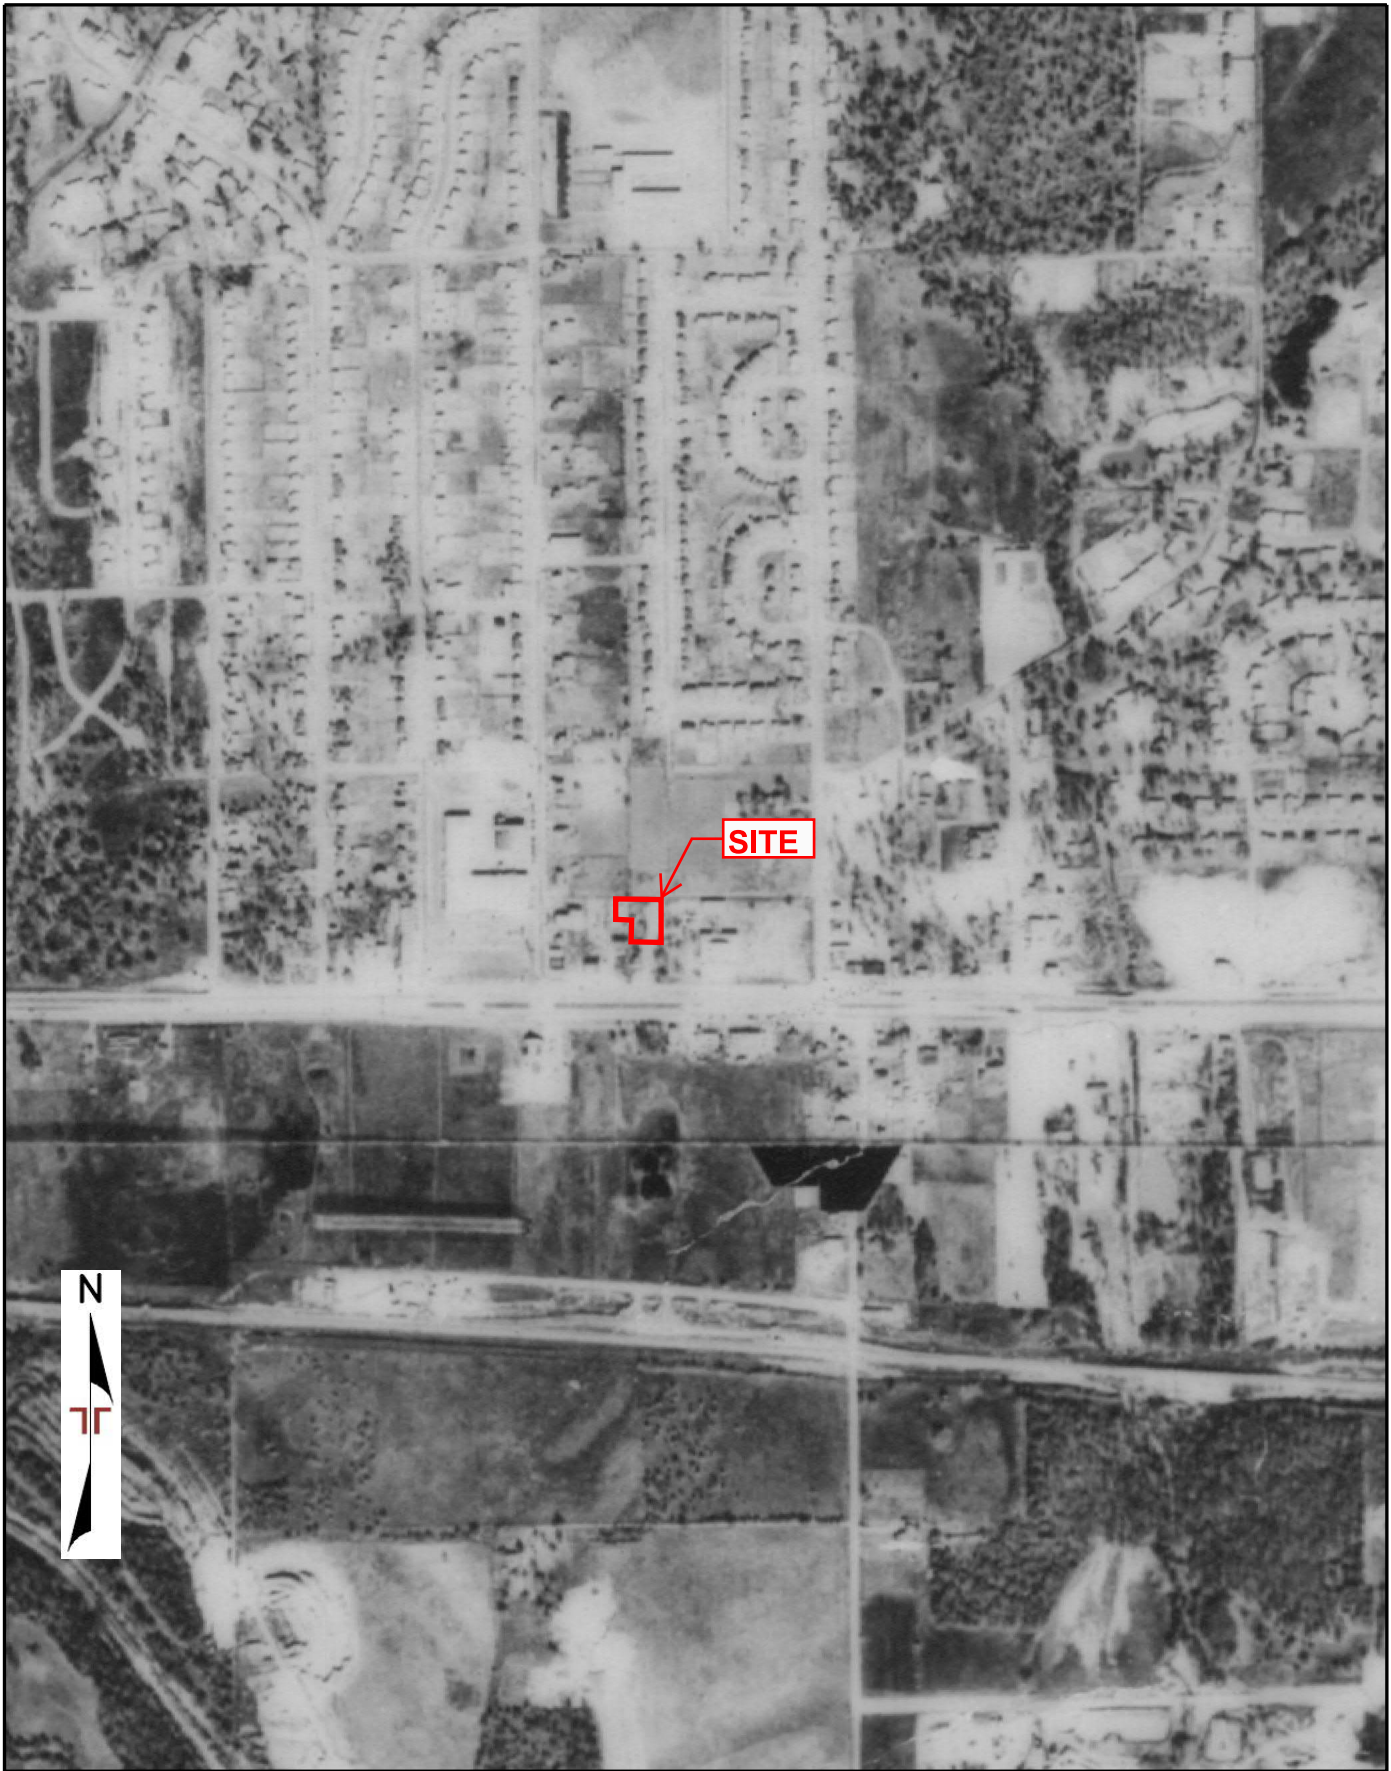

Project Manager:
Drawn by:
Checked by:
Approved by:

Project No:
Scale:
File Name:
Date:

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH

Hurst Industrial Site
111 and 113 Souder Drive
Hurst, Tarrant County, Texas 76053

Appendix
C



Project Manager:
Drawn by:
Checked by:
Approved by:

Project No:	95207416
Scale:	1" = 500'
File Name:	AMS
Date:	01/04/1953

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C



Project Manager:
Drawn by:
Checked by:
Approved by:

Project No:	95207416
Scale:	1" = 500'
File Name:	ASCS
Date:	04/02/1942

Terracon
2501 E. Loop 820 North
Fort Worth, Texas 76118

AERIAL PHOTOGRAPH
Hurst Industrial Site 111 and 113 Souder Drive Hurst, Tarrant County, Texas 76053

Appendix
C

Client/User Required Questionnaire

Terracon

Person Completing Questionnaire	Name: <u>Barney C. Wiley</u> Company: <u>Trinity Bank NA</u>	Phone: <u>817-569-7225</u> Email: <u>bwiley@trinitybk.com</u>
Site Name	<u>Hurst Industrial Site</u>	
Site Address	<u>111-113 Souder Drive, Hurst, Texas</u>	
Point of Contact for Access	Name: <u>Gibson Duwe</u> Company: <u>Transwestern</u>	Phone: Email: <u>gibson.duwe@transwestern.com</u>
Access Restrictions or Special Site Requirements?	☒ No ☐ Yes (If yes, please explain)	
Confidentiality Requirements?	☒ No ☐ Yes (If yes, please explain)	
Current Site Owner	Name: Company: <u>Trinity Bank, NA</u>	Phone: <u>817-569-7225</u> Email: <u>bwiley@trinitybk.com</u>
Current Site Operator	Name: Company:	Phone: Email:
Reasons for ESA (e.g., financing, acquisition, lease, etc.)		
Anticipated Future Site Use		
Relevant Documents?	Please provide Terracon copies of prior Phase I or II ESAs, Asbestos Surveys, Environmental Permits or Audit documents, Underground Storage Tank documents, Geotechnical Investigations, Site Surveys, Diagrams or Maps, or other relevant reports or documents.	

ASTM User Questionnaire In order to qualify for one of the Landowner Liability Protections (LLPs) offered by the Small Business Relief and Brownfields Revitalization Act of 2001 (the "Brownfields Amendments"), the user must respond to the following questions. Failure to provide this information to the environmental professional may result in significant data gaps, which may limit our ability to identify recognized environmental conditions resulting in a determination that "all appropriate inquiry" is not complete. This form represents a type of interview and as such, the user has an obligation to answer all questions in good faith, to the extent of their actual knowledge. 1) Did a search of recorded land title records (or judicial records where appropriate) identify any environmental liens filed or recorded against the property under federal, tribal, state, or local law (40 CFR 312.25)? ☒ No ☐ Yes (If yes, explain below and send Terracon a copy of the title records or judicial records reviewed.) 2) Did a search of recorded land title records (or judicial records where appropriate) identify any activity and use limitations (AULs), such as engineering controls, land use restrictions, or institutional controls that are in place at the property and/or have been filed or recorded against the property under federal, tribal, state, or local law (40 CFR 312.26)? ☒ No ☐ Yes (If yes, explain below and send Terracon a copy of the title records or judicial records reviewed.) 3) Do you have any specialized knowledge or experience related to the site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business (40 CFR 312.28)? ☒ No ☐ Yes (If yes, explain below) 4) Do you have actual knowledge of a lower purchase price because contamination is known or believed to be present at the site (40 CFR 312.29)? ☒ No ☐ Yes ☐ Not applicable (If yes or Not applicable, explain below) 5) Are you aware of commonly known or reasonably ascertainable information about the site that would help the environmental professional to identify conditions indicative of releases or threatened releases (40 CFR 312.30)? ☒ No ☐ Yes (If yes, explain below) 6) Based on your knowledge and experience related to the site, are there any obvious indicators that point to the presence or likely presence of contamination at the site (40 CFR 312.31)? ☒ No ☐ Yes (If yes, explain below) Comments or explanations:

Please return this form with the signed authorization to proceed.

Proposal No. P95207416

APPENDIX D
ENVIRONMENTAL DATABASE INFORMATION

Radius Report

[GeoLens by GeoSearch](#)

Target Property:

***Hurst Industrial Site
111 and 113 Souder Dr
Hurst, Tarrant County, Texas 76053***

Prepared For:

Terracon Consultants-Fort Worth

Order #: 150681

Job #: 364680

Project #: 95207416

Date: 08/04/2020

Table of Contents

<i>Target Property Summary</i>	1
<i>Database Summary</i>	2
<i>Database Radius Summary</i>	7
<i>Radius Map</i>	11
<i>Ortho Map</i>	13
<i>Topographic Map</i>	14
<i>Located Sites Summary</i>	15
<i>Site Summary By Database</i>	17
<i>Elevation Summary</i>	19
<i>Unlocated Sites Summary</i>	157
<i>Environmental Records Definitions</i>	158
<i>Unlocatable Report</i>	See Attachment
<i>Zip Report</i>	See Attachment

Disclaimer

This report was designed by GeoSearch to meet or exceed the records search requirements of the All Appropriate Inquiries Rule (40 CFR §312.26) and the current version of the ASTM International E1527, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process or, if applicable, the custom requirements requested by the entity that ordered this report. The records and databases of records used to compile this report were collected from various federal, state and local governmental entities. It is the goal of GeoSearch to meet or exceed the 40 CFR §312.26 and E1527 requirements for updating records by using the best available technology. GeoSearch contacts the appropriate governmental entities on a recurring basis. Depending on the frequency with which a record source or database of records is updated by the governmental entity, the data used to prepare this report may be updated monthly, quarterly, semi-annually, or annually.

The information provided in this report was obtained from a variety of public sources. GeoSearch cannot ensure and makes no warranty or representation as to the accuracy, reliability, quality, errors occurring from data conversion or the customer's interpretation of this report. This report was made by GeoSearch for exclusive use by its clients only. Therefore, this report may not contain sufficient information for other purposes or parties. GeoSearch and its partners, employees, officers And independent contractors cannot be held liable For actual, incidental, consequential, special or exemplary damages suffered by a customer resulting directly or indirectly from any information provided by GeoSearch.

Target Property Summary

Target Property Information

Hurst Industrial Site
111 and 113 Souder Dr
Hurst, Texas 76053

Coordinates

Area centroid (-97.174464, 32.8099448)
532 feet above sea level

USGS Quadrangle

Hurst, TX

Geographic Coverage Information

County/Parish: Tarrant (TX)

ZipCode(s):

Hurst TX: 76053

Fort Worth TX: 76118

Database Summary

FEDERAL LISTING

Standard Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
EMERGENCY RESPONSE NOTIFICATION SYSTEM	ERNSTX	0	0	TP/AP
FEDERAL ENGINEERING INSTITUTIONAL CONTROL SITES	EC	0	0	TP/AP
LAND USE CONTROL INFORMATION SYSTEM	LUCIS	0	0	TP/AP
RCRA SITES WITH CONTROLS	RCRASC	0	0	TP/AP
RESOURCE CONSERVATION & RECOVERY ACT - GENERATOR	RCRAGR06	1	0	0.1250
RESOURCE CONSERVATION & RECOVERY ACT - NON-GENERATOR	RCRANGR06	0	0	0.1250
BROWNFIELDS MANAGEMENT SYSTEM	BF	0	0	0.5000
DELISTED NATIONAL PRIORITIES LIST	DNPL	0	0	0.5000
NO LONGER REGULATED RCRA NON-CORRACTS TSD FACILITIES	NLRRCRAT	0	0	0.5000
RESOURCE CONSERVATION & RECOVERY ACT - NON-CORRACTS TREATMENT, STORAGE & DISPOSAL FACILITIES	RCRAT	1	0	0.5000
SUPERFUND ENTERPRISE MANAGEMENT SYSTEM	SEMS	0	0	0.5000
SUPERFUND ENTERPRISE MANAGEMENT SYSTEM ARCHIVED SITE INVENTORY	SEMSARCH	2	0	0.5000
NATIONAL PRIORITIES LIST	NPL	0	0	1.0000
NO LONGER REGULATED RCRA CORRECTIVE ACTION FACILITIES	NLRRCRAC	0	0	1.0000
PROPOSED NATIONAL PRIORITIES LIST	PNPL	0	0	1.0000
RESOURCE CONSERVATION & RECOVERY ACT - CORRECTIVE ACTION FACILITIES	RCRAC	3	0	1.0000
RESOURCE CONSERVATION & RECOVERY ACT - SUBJECT TO CORRECTIVE ACTION FACILITIES	RCRASUBC	1	0	1.0000
SUB-TOTAL		8	0	

Additional Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
AEROMETRIC INFORMATION RETRIEVAL SYSTEM / AIR FACILITY SUBSYSTEM	AIRSAFS	0	0	TP/AP
BIENNIAL REPORTING SYSTEM	BRS	0	0	TP/AP
CERCLIS LIENS	SFLIENS	0	0	TP/AP
CLANDESTINE DRUG LABORATORY LOCATIONS	CDL	0	0	TP/AP
EPA DOCKET DATA	DOCKETS	0	0	TP/AP
ENFORCEMENT AND COMPLIANCE HISTORY INFORMATION	ECHOR06	0	0	TP/AP
FACILITY REGISTRY SYSTEM	ERSTX	0	0	TP/AP

Database Summary

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
HAZARDOUS MATERIALS INCIDENT REPORTING SYSTEM	HMIRSR06	0	0	TP/AP
HAZARDOUS WASTE COMPLIANCE DOCKET FACILITIES	HWCD	0	0	TP/AP
INTEGRATED COMPLIANCE INFORMATION SYSTEM (FORMERLY DOCKETS)	ICIS	0	0	TP/AP
INTEGRATED COMPLIANCE INFORMATION SYSTEM NATIONAL POLLUTANT DISCHARGE ELIMINATION SYSTEM	ICISNPDES	0	0	TP/AP
MATERIAL LICENSING TRACKING SYSTEM	MLTS	0	0	TP/AP
NATIONAL POLLUTANT DISCHARGE ELIMINATION SYSTEM	NPDESR06	0	0	TP/AP
PCB ACTIVITY DATABASE SYSTEM	PADS	0	0	TP/AP
PERMIT COMPLIANCE SYSTEM	PCSR06	0	0	TP/AP
SEMS LIEN ON PROPERTY	SEMSLIENS	0	0	TP/AP
SSEHRI PFAS CONTAMINATION SITES	SSEHRIPFAS	0	0	TP/AP
SECTION SEVEN TRACKING SYSTEM	SSTS	0	0	TP/AP
TOXIC SUBSTANCE CONTROL ACT INVENTORY	TSCA	0	0	TP/AP
TOXICS RELEASE INVENTORY	TRI	0	0	TP/AP
ALTERNATIVE FUELING STATIONS	ALTFUELS	0	0	0.2500
FEMA OWNED STORAGE TANKS	FEMAUST	0	0	0.2500
HISTORICAL GAS STATIONS	HISTPST	0	0	0.2500
INTEGRATED COMPLIANCE INFORMATION SYSTEM DRYCLEANERS	ICISCLEANERS	0	0	0.2500
MINE SAFETY AND HEALTH ADMINISTRATION MASTER INDEX FILE	MSHA	0	0	0.2500
MINERAL RESOURCE DATA SYSTEM	MRDS	0	0	0.2500
OPEN DUMP INVENTORY	ODI	0	0	0.5000
SURFACE MINING CONTROL AND RECLAMATION ACT SITES	SMCRA	0	0	0.5000
URANIUM MILL TAILINGS RADIATION CONTROL ACT SITES	USUMTRCA	0	0	0.5000
DEPARTMENT OF DEFENSE SITES	DOD	0	0	1.0000
FORMER MILITARY NIKE MISSILE SITES	NMS	0	0	1.0000
FORMERLY USED DEFENSE SITES	FUDS	0	0	1.0000
FORMERLY UTILIZED SITES REMEDIAL ACTION PROGRAM	FUSRAP	0	0	1.0000
RECORD OF DECISION SYSTEM	RODS	0	0	1.0000
SUB-TOTAL		0	0	

Database Summary

STATE (TX) LISTING

Standard Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
STATE INSTITUTIONAL/ENGINEERING CONTROL SITES	SIEC01	0	0	TP/AP
PETROLEUM STORAGE TANKS	PST	6	0	0.2500
BROWNFIELDS SITE ASSESSMENTS	BSA	0	0	0.5000
CLOSED & ABANDONED LANDFILL INVENTORY	CALE	0	0	0.5000
COMMERCIAL MANAGEMENT FACILITIES FOR HAZARDOUS WASTE AND INDUSTRIAL SOLID WASTES	WSTMGMT	0	0	0.5000
LEAKING PETROLEUM STORAGE TANKS	LPST	5	0	0.5000
MUNICIPAL SOLID WASTE LANDFILL SITES	MSWLF	2	0	0.5000
OPERATOR CLEANUP PROGRAM SITES	OCP	0	0	0.5000
RAILROAD COMMISSION VCP AND BROWNFIELD SITES	RRCVCP	0	0	0.5000
VOLUNTARY CLEANUP PROGRAM SITES	VCP	2	0	0.5000
STATE SUPERFUND SITES	SF	0	0	1.0000
SUB-TOTAL		15	0	

Additional Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
GROUNDWATER CONTAMINATION CASES	GWCC	0	0	TP/AP
HISTORIC GROUNDWATER CONTAMINATION CASES	HISTGWCC	0	0	TP/AP
LAND APPLICATION PERMITS	LANDAPP	0	0	TP/AP
MUNICIPAL SETTING DESIGNATIONS	MSD	0	0	TP/AP
NOTICE OF VIOLATIONS	NOV	0	0	TP/AP
SPILLS LISTING	SPILLS	0	0	TP/AP
TCEQ LIENS	LIENS	0	0	TP/AP
TIER I I CHEMICAL REPORTING PROGRAM FACILITIES	TIERII	3	0	TP/AP
DRY CLEANER REGISTRATION DATABASE	DCR	0	0	0.2500
INDUSTRIAL AND HAZARDOUS WASTE SITES	IHW	1	0	0.2500
PERMITTED INDUSTRIAL HAZARDOUS WASTE SITES	PIHW	0	0	0.2500
AFFECTED PROPERTY ASSESSMENT REPORTS	APAR	0	0	0.5000
DRY CLEANER REMEDIATION PROGRAM SITES	DCRPS	0	0	0.5000
INNOCENT OWNER / OPERATOR DATABASE	IQP	3	0	0.5000
RADIOACTIVE WASTE SITES	RWS	0	0	0.5000
RECYCLING FACILITIES	WMRF	0	0	0.5000
SALT CAVERNS FOR PETROLEUM STORAGE	STCV	0	0	0.5000

Database Summary

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
INDUSTRIAL AND HAZARDOUS WASTE CORRECTIVE ACTION SITES	IHWCA	4	0	1.0000
SUB-TOTAL		11	0	

Database Summary

TRIBAL LISTING

Standard Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
UNDERGROUND STORAGE TANKS ON TRIBAL LANDS	USTR06	0	0	0.2500
LEAKING UNDERGROUND STORAGE TANKS ON TRIBAL LANDS	LUSTR06	0	0	0.5000
OPEN DUMP INVENTORY ON TRIBAL LANDS	ODINDIAN	0	0	0.5000
SUB-TOTAL		0	0	

Additional Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
INDIAN RESERVATIONS	INDIANRES	0	0	1.0000
SUB-TOTAL		0	0	
TOTAL		34	0	

Database Radius Summary

FEDERAL LISTING

Standard environmental records are displayed in **bold**.

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
AIRSAFS	0.0200	0	NS	NS	NS	NS	NS	0
BRS	0.0200	0	NS	NS	NS	NS	NS	0
CDL	0.0200	0	NS	NS	NS	NS	NS	0
DOCKETS	0.0200	0	NS	NS	NS	NS	NS	0
EC	0.0200	0	NS	NS	NS	NS	NS	0
ECHOR06	0.0200	0	NS	NS	NS	NS	NS	0
ERNSTX	0.0200	0	NS	NS	NS	NS	NS	0
FRSTX	0.0200	0	NS	NS	NS	NS	NS	0
HMIRSR06	0.0200	0	NS	NS	NS	NS	NS	0
HWCD	0.0200	0	NS	NS	NS	NS	NS	0
ICIS	0.0200	0	NS	NS	NS	NS	NS	0
ICISNPDES	0.0200	0	NS	NS	NS	NS	NS	0
LUCIS	0.0200	0	NS	NS	NS	NS	NS	0
MLTS	0.0200	0	NS	NS	NS	NS	NS	0
NPDES06	0.0200	0	NS	NS	NS	NS	NS	0
PADS	0.0200	0	NS	NS	NS	NS	NS	0
PCSR06	0.0200	0	NS	NS	NS	NS	NS	0
RCRASC	0.0200	0	NS	NS	NS	NS	NS	0
SEMSLIENS	0.0200	0	NS	NS	NS	NS	NS	0
SFLIENS	0.0200	0	NS	NS	NS	NS	NS	0
SSEHRIPFAS	0.0200	0	NS	NS	NS	NS	NS	0
SSTS	0.0200	0	NS	NS	NS	NS	NS	0
TRI	0.0200	0	NS	NS	NS	NS	NS	0
TSCA	0.0200	0	NS	NS	NS	NS	NS	0
RCRAGR06	0.1250	0	1	NS	NS	NS	NS	1
RCRANGR06	0.1250	0	0	NS	NS	NS	NS	0
ALTFUELS	0.2500	0	0	0	NS	NS	NS	0
FEMAUST	0.2500	0	0	0	NS	NS	NS	0
HISTPST	0.2500	0	0	0	NS	NS	NS	0
ICISCLEANERS	0.2500	0	0	0	NS	NS	NS	0
MRDS	0.2500	0	0	0	NS	NS	NS	0
MSHA	0.2500	0	0	0	NS	NS	NS	0
BF	0.5000	0	0	0	0	NS	NS	0
DNPL	0.5000	0	0	0	0	NS	NS	0
NLRRCRAT	0.5000	0	0	0	0	NS	NS	0

Database Radius Summary

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
ODI	0.5000	0	0	0	0	NS	NS	0
RCRAT	0.5000	0	0	0	1	NS	NS	1
SEMS	0.5000	0	0	0	0	NS	NS	0
SEMSARCH	0.5000	0	0	0	2	NS	NS	2
SMCRA	0.5000	0	0	0	0	NS	NS	0
USUMTRCA	0.5000	0	0	0	0	NS	NS	0
DOD	1.0000	0	0	0	0	0	NS	0
FUDS	1.0000	0	0	0	0	0	NS	0
FUSRAP	1.0000	0	0	0	0	0	NS	0
NLRRCRAC	1.0000	0	0	0	0	0	NS	0
NMS	1.0000	0	0	0	0	0	NS	0
NPL	1.0000	0	0	0	0	0	NS	0
PNPL	1.0000	0	0	0	0	0	NS	0
RCRAC	1.0000	0	0	0	2	1	NS	3
RCRASUBC	1.0000	0	0	0	1	0	NS	1
RODS	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		0	1	0	6	1	0	8

Database Radius Summary

STATE (TX) LISTING

Standard environmental records are displayed in **bold**.

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
GWCC	0.0200	0	NS	NS	NS	NS	NS	0
HISTGWCC	0.0200	0	NS	NS	NS	NS	NS	0
LANDAPP	0.0200	0	NS	NS	NS	NS	NS	0
LIENS	0.0200	0	NS	NS	NS	NS	NS	0
MSD	0.0200	0	NS	NS	NS	NS	NS	0
NOV	0.0200	0	NS	NS	NS	NS	NS	0
SIEC01	0.0200	0	NS	NS	NS	NS	NS	0
SPILLS	0.0200	0	NS	NS	NS	NS	NS	0
TIERII	0.0200	3	NS	NS	NS	NS	NS	3
DCR	0.2500	0	0	0	NS	NS	NS	0
IHW	0.2500	0	1	0	NS	NS	NS	1
PIHW	0.2500	0	0	0	NS	NS	NS	0
PST	0.2500	0	3	3	NS	NS	NS	6
APAR	0.5000	0	0	0	0	NS	NS	0
BSA	0.5000	0	0	0	0	NS	NS	0
CALF	0.5000	0	0	0	0	NS	NS	0
DCRPS	0.5000	0	0	0	0	NS	NS	0
IOP	0.5000	0	0	2	1	NS	NS	3
LPST	0.5000	0	2	2	1	NS	NS	5
MSWLF	0.5000	0	0	0	2	NS	NS	2
OCP	0.5000	0	0	0	0	NS	NS	0
RRCVCP	0.5000	0	0	0	0	NS	NS	0
RWS	0.5000	0	0	0	0	NS	NS	0
STCV	0.5000	0	0	0	0	NS	NS	0
VCP	0.5000	0	0	0	2	NS	NS	2
WMRF	0.5000	0	0	0	0	NS	NS	0
WSTMGMT	0.5000	0	0	0	0	NS	NS	0
IHWCA	1.0000	0	0	0	3	1	NS	4
SF	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		3	6	7	9	1	0	26

Database Radius Summary

TRIBAL LISTING

Standard environmental records are displayed in **bold**.

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
USTR06	0.2500	0	0	0	NS	NS	NS	0
LUSTR06	0.5000	0	0	0	0	NS	NS	0
ODINDIAN	0.5000	0	0	0	0	NS	NS	0
INDIANRES	1.0000	0	0	0	0	0	NS	0

SUB-TOTAL		0	0	0	0	0	0	0
-----------	--	---	---	---	---	---	---	---


TOTAL		3	7	7	15	2	0	34
-------	--	---	---	---	----	---	---	----

NOTES:

NS = NOT SEARCHED

TP/AP = TARGET PROPERTY/ADJACENT PROPERTY

Radius Map 1

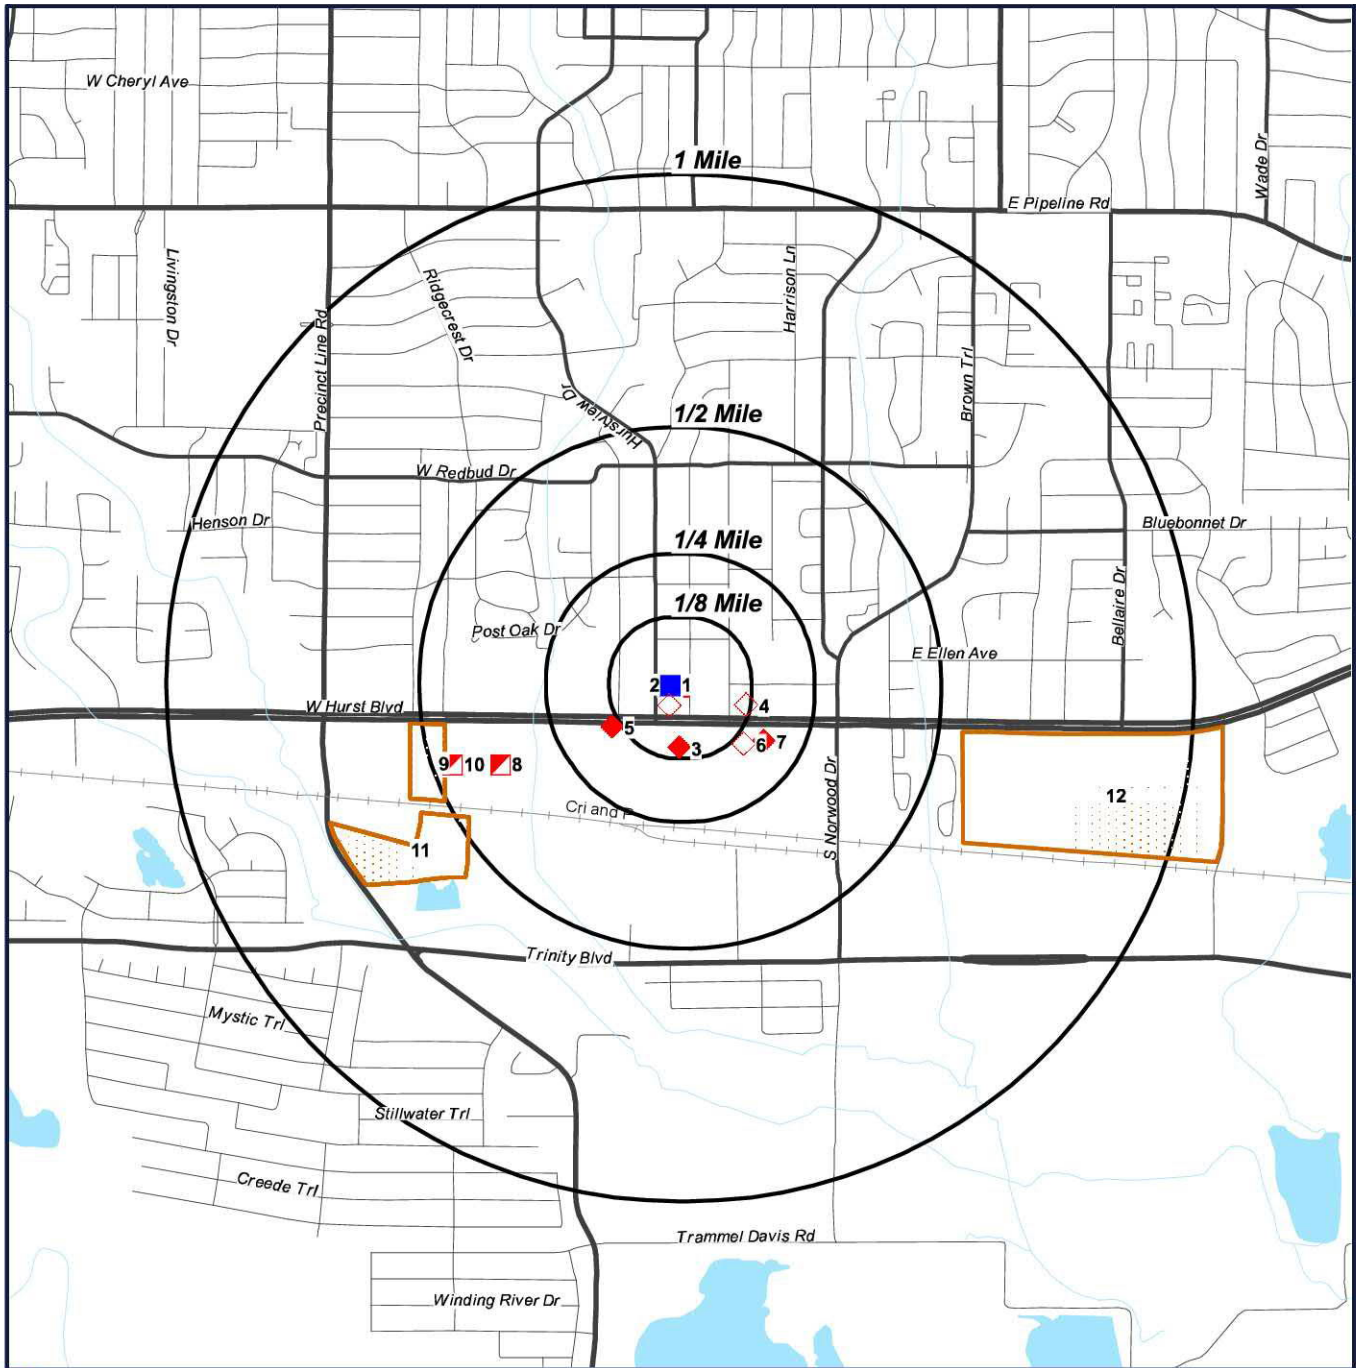

- Target Property (TP)
- TIERII
- PST
- LPST
- RCRAC
- VCP
- RCRAC
- SEMSARCH
- IHWCA


- MSWLF
- IOP
- IHWCA
- LPST

Hurst Industrial Site
111 and 113 Souder Dr
Hurst, Texas
76053



0' 1000' 2000' 3000'
 SCALE: 1" = 2000'

Radius Map 2

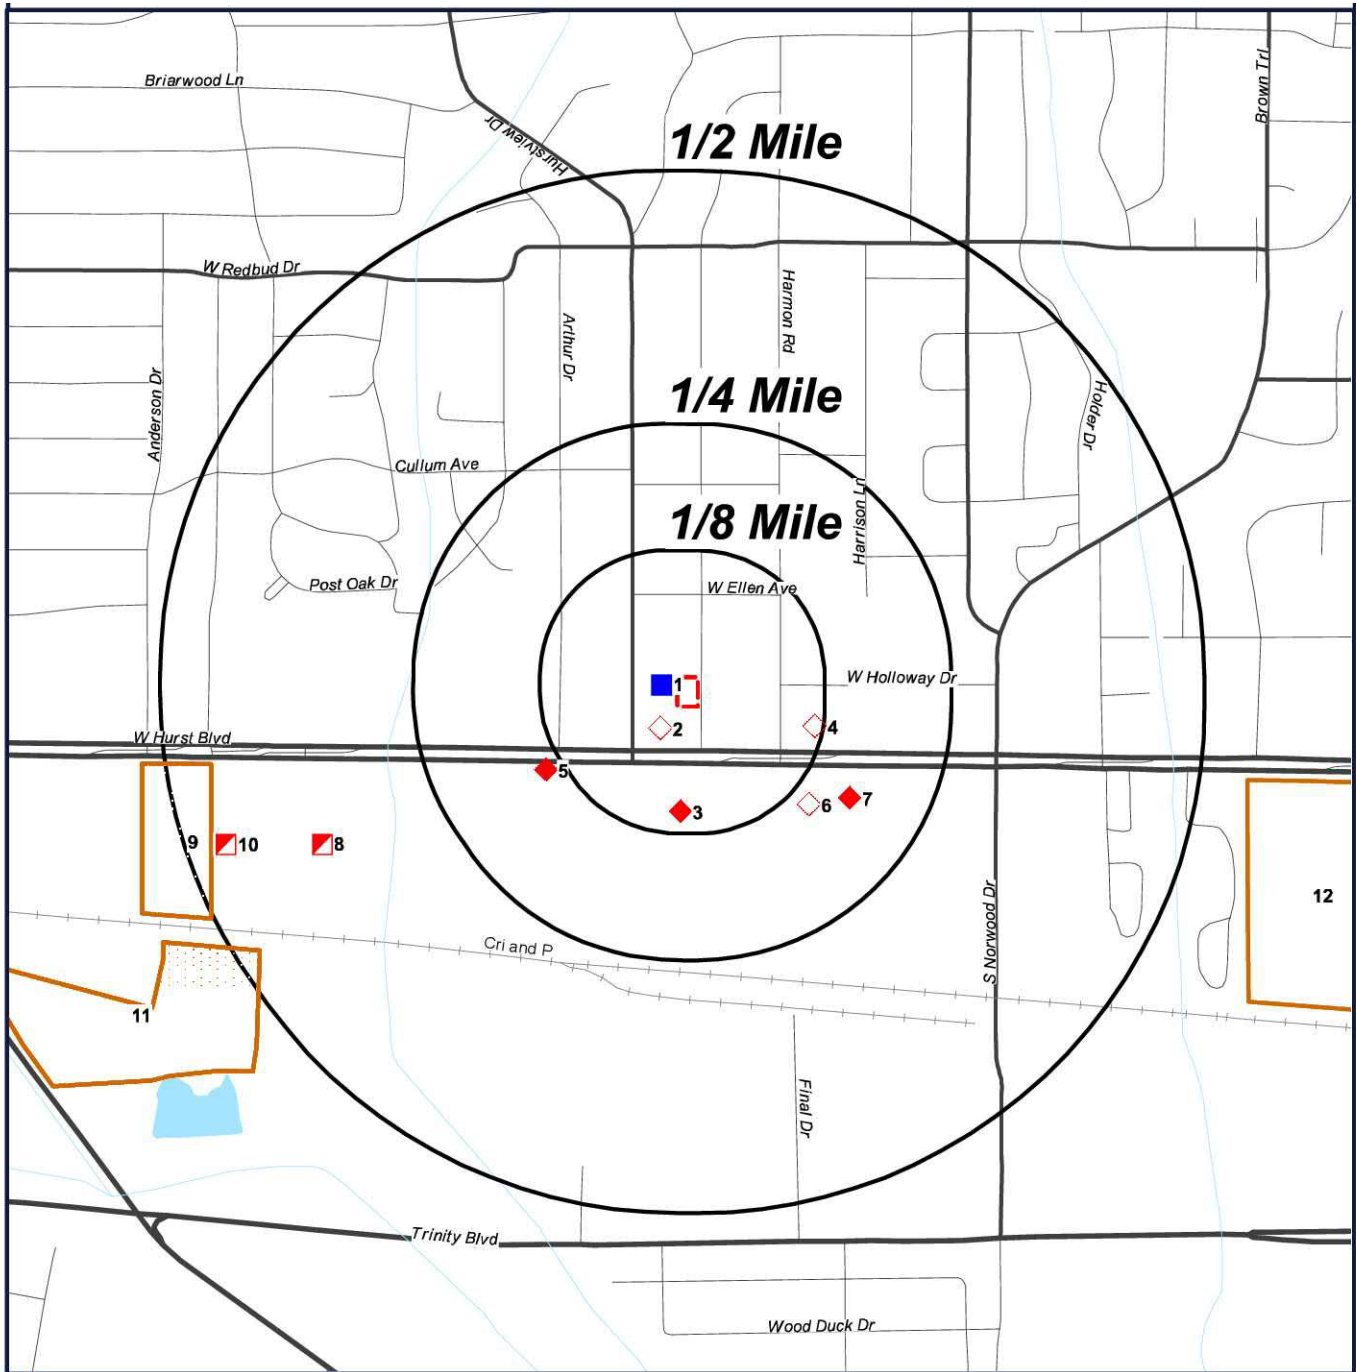

- 1 Target Property (TP)
- 1 TIERII
- 1 PST
- ◆ LPST
- 1 RCRAC
- 1 VCP
- 1 RCRAC
- 1 SEMSARCH
- 1 IHWCA


- 1 MSWLF
- 1 IOP
- 1 IHWCA
- 1 LPST

Hurst Industrial Site
111 and 113 Souder Dr
Hurst, Texas
76053



0' 500' 1000' 1500'
 SCALE: 1" = 1000'

Ortho Map

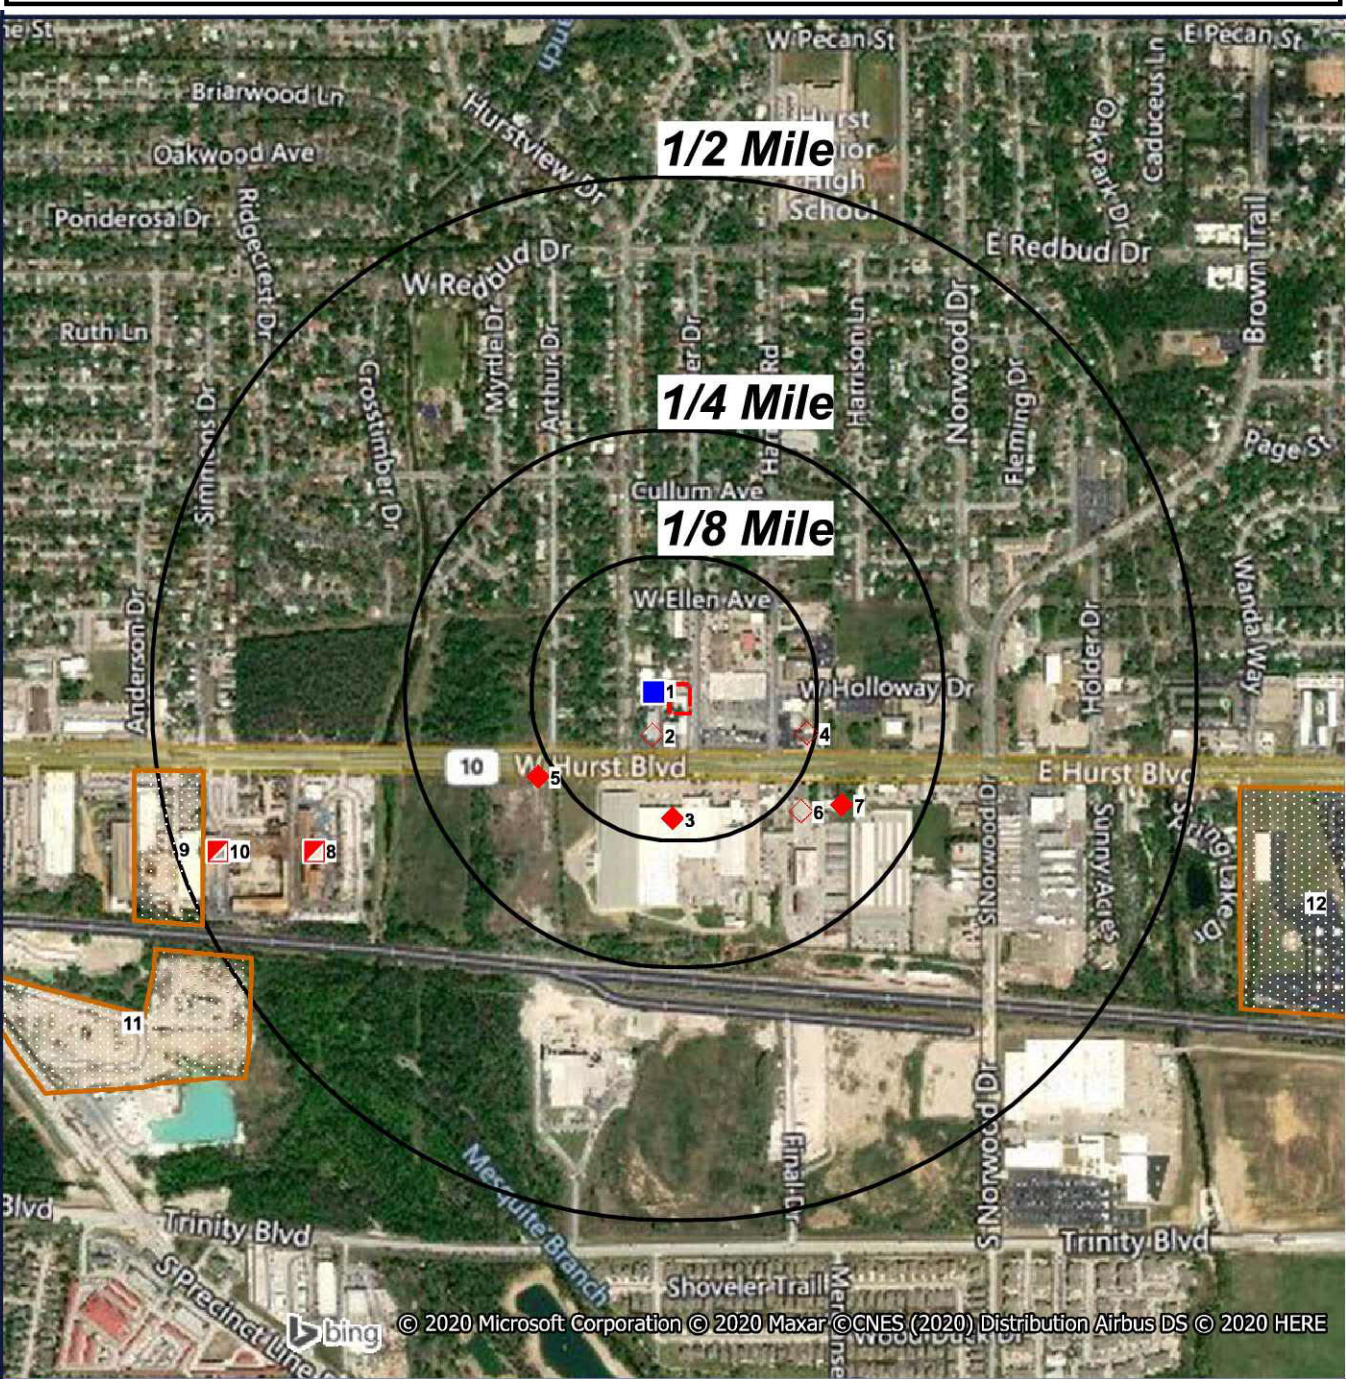


- | Target Property (TP) | | |
|---|----------|---|
|  | TIERII |  MSWLF |
|  | PST |  IOP |
|  | LPST |  IHWCA |
|  | RCRAC |  LPST |
|  | VCP | |
|  | RCRAC | |
|  | SEMSARCH | |
|  | IHWCA | |

**Quadrangle(s): Hurst
Hurst Industrial Site
111 and 113 Souder Dr
Hurst, Texas
76053**



Topographic Map

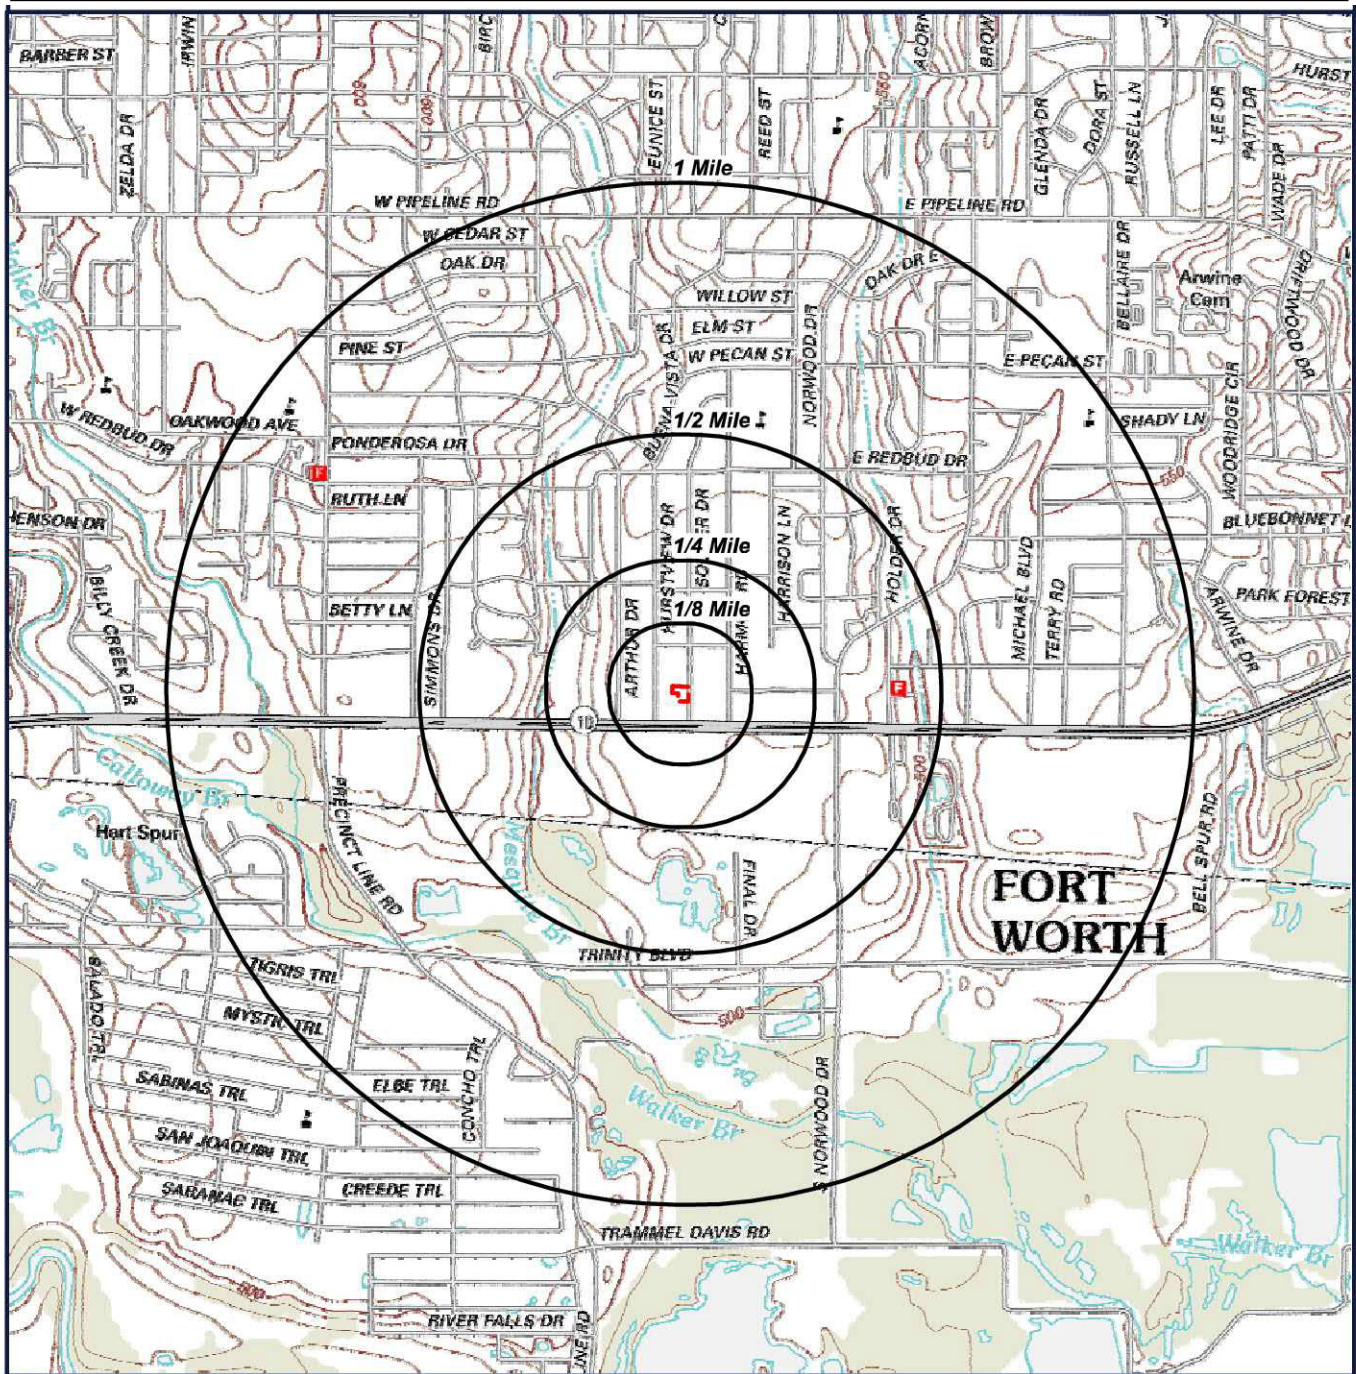

 Target Property (TP)

Quadrangle(s): Hurst
Source: USGS,
11/26/2012
Hurst Industrial Site
111 and 113 Souder Dr
Hurst, Texas
76053



0' 1000' 2000' 3000'
 SCALE: 1" = 2000'

Located Sites Summary

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
1	TIERII	4XVZ7N002QH 6	Equal (532 ft.)	0.005 mi. W (26 ft.)	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053	21
1	TIERII	5UL7U3021P8E	Equal (532 ft.)	0.005 mi. W (26 ft.)	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053	22
1	TIERII	6J6JQL007XZE	Equal (532 ft.)	0.005 mi. W (26 ft.)	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053	23
2	PST	5034	Equal (532 ft.)	0.027 mi. SW (143 ft.)	CODY A C & HEATING	348 W HURST BLVD, HURST, TX 76053	24
3	IHW	30557	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053	26
3	LPST	104779	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY MOORE PAINT CO	301 W HURST BLVD, HURST, TX 76053	42
3	LPST	114472	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY MOORE PAINT CO	301 W HURST BLVD, HURST, TX 76053	52
3	PST	9628	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053	62
3	RCRAGR06	TXD051376143	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053	72
4	PST	41980	Lower (530 ft.)	0.117 mi. E (618 ft.)	HURST IMPORT CAR REPAIR	224 W HURST BLVD, HURST, TX 76053	76
5	LPST	098920	Lower (524 ft.)	0.142 mi. WSW (750 ft.)	BUILDERS CONCRETE PRODUCTS	501 W HURST BLVD, HURST, TX 76053	78
5	PST	57103	Lower (524 ft.)	0.142 mi. WSW (750 ft.)	BUILDERS CONCRETE PRODUCTS	501 W HURST BLVD, HURST, TX 76053	81
6	IOP	0605	Lower (528 ft.)	0.146 mi. SE (771 ft.)	TEXAS STAR SIGNS	229 W HURST BLVD, HURST, TX 76053	84
6	PST	12698	Lower (528 ft.)	0.146 mi. SE (771 ft.)	ASSOCIATED BATTERY SUPPLY	229 W HURST BLVD, HURST, TX 76053	85
7	IOP	1030	Lower (528 ft.)	0.175 mi. ESE (924 ft.)	205 WEST HURST BLVD	205 W HURST BLVD, HURST, TX 76053	88
7	LPST	105404	Lower (528 ft.)	0.175 mi. ESE (924 ft.)	TRINITY INDUSTRIES	205 W HURST BLVD, HURST, TX 76053	89
7	PST	16556	Lower (528 ft.)	0.175 mi. ESE (924 ft.)	TRINITY FOREST INDUSTRIES	205 W HURST BLVD, HURST, TX 76053	93
8	IHWCA	30016	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	NORTH AMERICAN GALVANIZING	625 W HURST BLVD, HURST, TX 76053	98
8	RCRAC	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053	99
8	RCRASUBC	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053	105
8	RCRAT	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053	111

Located Sites Summary

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
8	SEMSARCH	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	BOYLES GALVANIZING CO	625 W HURST BLVD, HURST, TX 76053	117
9	RCRAC	TXD008017824	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE INC	711 W HURST BLVD, HURST, TX 76053	118
9	SEMSARCH	TXD008017824	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE METAL FINISHING	711 WEST HURST STREET, HURST, TX 76053	121
9	VCP	0471	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE, INC.	711 W HURST BLVD, HURST, TX 76053	122
9	VCP	0823	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE MANUFACTURING FACILITY	711 W HURST BLVD, HURST, TX 76053	124
10	IHWCA	34659	Lower (529 ft.)	0.460 mi. WSW (2429 ft.)	US GALVANIZING PLANT 1579	645 W HURST BLVD, HURST, TX 76053	127
11	IHWCA	82306	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	KELLOGG BROWN ROOT	3120 S PRECINCT LINE RD, HURST, TX 76053	128
11	IOP	0320	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	KELLOGG BROWN & ROOT FACILITY	3120 S PRECINCT LINE RD, HURST, TX 76053	129
11	LPST	109730	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	BROWN ROOT HEAVY CIVIL YARD	3120 S PRECINCT LINE RD, HURST, TX 76053	130
11	MSWLF	100016	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	WALKER BRANCH RECYCLING INC	3120 S PRECINCT LINE RD, HURST, TX 76053	136
11	MSWLF	100097	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	PRECINCT LINE ROAD RECYCLING FACILITY	MAPSCO 52Z 3120 PRECINCT LINE RD, HURST, TX	137
12	IHWCA	30406	Lower (522 ft.)	0.547 mi. E (2888 ft.)	BELL HELICOPTER PLANT 1	3255 BELL HELICOPTER BLVD, FORT WORTH, TX 76118	138
12	RCRAC	TXD980626006	Lower (522 ft.)	0.547 mi. E (2888 ft.)	BELL PLANT 1	600 E HURST BLVD, HURST, TX 76053	139

Site Summary By Database

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address
3	IHW	30557	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053
8	IHWCA	30016	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	NORTH AMERICAN GALVANIZING	625 W HURST BLVD, HURST, TX 76053
10	IHWCA	34659	Lower (529 ft.)	0.460 mi. WSW (2429 ft.)	US GALVANIZING PLANT 1579	645 W HURST BLVD, HURST, TX 76053
11	IHWCA	82306	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	KELLOGG BROWN ROOT	3120 S PRECINCT LINE RD, HURST, TX 76053
12	IHWCA	30406	Lower (522 ft.)	0.547 mi. E (2888 ft.)	BELL HELICOPTER PLANT 1	3255 BELL HELICOPTER BLVD, FORT WORTH, TX 76118
6	IOP	0605	Lower (528 ft.)	0.146 mi. SE (771 ft.)	TEXAS STAR SIGNS	229 W HURST BLVD, HURST, TX 76053
7	IOP	1030	Lower (528 ft.)	0.175 mi. ESE (924 ft.)	205 WEST HURST BLVD	205 W HURST BLVD, HURST, TX 76053
11	IOP	0320	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	KELLOGG BROWN & ROOT FACILITY	3120 S PRECINCT LINE RD, HURST, TX 76053
3	LPST	104779	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY MOORE PAINT CO	301 W HURST BLVD, HURST, TX 76053
3	LPST	114472	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY MOORE PAINT CO	301 W HURST BLVD, HURST, TX 76053
5	LPST	098920	Lower (524 ft.)	0.142 mi. WSW (750 ft.)	BUILDERS CONCRETE PRODUCTS	501 W HURST BLVD, HURST, TX 76053
7	LPST	105404	Lower (528 ft.)	0.175 mi. ESE (924 ft.)	TRINITY INDUSTRIES	205 W HURST BLVD, HURST, TX 76053
11	LPST	109730	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	BROWN ROOT HEAVY CIVIL YARD	3120 S PRECINCT LINE RD, HURST, TX 76053
11	MSWLF	100016	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	WALKER BRANCH RECYCLING INC	3120 S PRECINCT LINE RD, HURST, TX 76053
11	MSWLF	100097	Lower (505 ft.)	0.476 mi. WSW (2513 ft.)	PRECINCT LINE ROAD RECYCLING FACILITY	MAPSCO 52Z 3120 PRECINCT LINE RD, HURST, TX
2	PST	5034	Equal (532 ft.)	0.027 mi. SW (143 ft.)	CODY A C & HEATING	348 W HURST BLVD, HURST, TX 76053
3	PST	9628	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053
4	PST	41980	Lower (530 ft.)	0.117 mi. E (618 ft.)	HURST IMPORT CAR REPAIR	224 W HURST BLVD, HURST, TX 76053
5	PST	57103	Lower (524 ft.)	0.142 mi. WSW (750 ft.)	BUILDERS CONCRETE PRODUCTS	501 W HURST BLVD, HURST, TX 76053
6	PST	12698	Lower (528 ft.)	0.146 mi. SE (771 ft.)	ASSOCIATED BATTERY SUPPLY	229 W HURST BLVD, HURST, TX 76053

Site Summary By Database

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address
7	PST	16556	Lower (528 ft.)	0.175 mi. ESE (924 ft.)	TRINITY FOREST INDUSTRIES	205 W HURST BLVD, HURST, TX 76053
8	RCRAC	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053
9	RCRAC	TXD008017824	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE INC	711 W HURST BLVD, HURST, TX 76053
12	RCRAC	TXD980626006	Lower (522 ft.)	0.547 mi. E (2888 ft.)	BELL PLANT 1	600 E HURST BLVD, HURST, TX 76053
3	RCRAGR06	TXD051376143	Lower (531 ft.)	0.104 mi. S (549 ft.)	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053
8	RCRASUBC	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053
8	RCRAT	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053
8	SEMSARCH	TXD005966452	Lower (517 ft.)	0.371 mi. WSW (1959 ft.)	BOYLES GALVANIZING CO	625 W HURST BLVD, HURST, TX 76053
9	SEMSARCH	TXD008017824	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE METAL FINISHING	711 WEST HURST STREET, HURST, TX 76053
1	TIERII	4XVZ7N002QH 6	Equal (532 ft.)	0.005 mi. W (26 ft.)	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053
1	TIERII	5UL7U3021P8E	Equal (532 ft.)	0.005 mi. W (26 ft.)	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053
1	TIERII	6J6JQL007XZE	Equal (532 ft.)	0.005 mi. W (26 ft.)	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053
9	VCP	0471	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE, INC.	711 W HURST BLVD, HURST, TX 76053
9	VCP	0823	Lower (529 ft.)	0.455 mi. W (2402 ft.)	ANADITE MANUFACTURING FACILITY	711 W HURST BLVD, HURST, TX 76053

Elevation Summary

Elevations are collected from the USGS 3D Elevation Program 1/3 arc-second (approximately 10 meters) layer hosted at the NGTOC. .

Target Property Elevation: 532 ft.

NOTE: Standard environmental records are displayed in **bold**.

EQUAL/HIGHER ELEVATION

Map ID#	Database Name	Elevation	Site Name	Address	Page #
1	TIERII	532 ft.	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053	21
1	TIERII	532 ft.	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053	22
1	TIERII	532 ft.	CITY OF HURST PUMP STATION #1	116 HURSTVIEW DRIVE, HURST, TX 76053	23
2	PST	532 ft.	CODY A C & HEATING	348 W HURST BLVD, HURST, TX 76053	24

LOWER ELEVATION

Map ID#	Database Name	Elevation	Site Name	Address	Page #
3	IHW	531 ft.	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053	26
3	LPST	531 ft.	KELLY MOORE PAINT CO	301 W HURST BLVD, HURST, TX 76053	42
3	LPST	531 ft.	KELLY MOORE PAINT CO	301 W HURST BLVD, HURST, TX 76053	52
3	PST	531 ft.	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053	62
3	RCRAGR06	531 ft.	KELLY-MOORE PAINT	301 W HURST BLVD, HURST, TX 76053	72
4	PST	530 ft.	HURST IMPORT CAR REPAIR	224 W HURST BLVD, HURST, TX 76053	76
5	LPST	524 ft.	BUILDERS CONCRETE PRODUCTS	501 W HURST BLVD, HURST, TX 76053	78
5	PST	524 ft.	BUILDERS CONCRETE PRODUCTS	501 W HURST BLVD, HURST, TX 76053	81
6	IOP	528 ft.	TEXAS STAR SIGNS	229 W HURST BLVD, HURST, TX 76053	84
6	PST	528 ft.	ASSOCIATED BATTERY SUPPLY	229 W HURST BLVD, HURST, TX 76053	85
7	IOP	528 ft.	205 WEST HURST BLVD	205 W HURST BLVD, HURST, TX 76053	88
7	LPST	528 ft.	TRINITY INDUSTRIES	205 W HURST BLVD, HURST, TX 76053	89
7	PST	528 ft.	TRINITY FOREST INDUSTRIES	205 W HURST BLVD, HURST, TX 76053	93
8	IHWCA	517 ft.	NORTH AMERICAN GALVANIZING	625 W HURST BLVD, HURST, TX 76053	98
8	RCRAC	517 ft.	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053	99
8	RCRASUBC	517 ft.	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053	105
8	RCRAT	517 ft.	AZZ GALVANIZING HURST	625 W HURST BLVD, HURST, TX 76053	111
8	SEMSARCH	517 ft.	BOYLES GALVANIZING CO	625 W HURST BLVD, HURST, TX 76053	117
9	RCRAC	529 ft.	ANADITE INC	711 W HURST BLVD, HURST, TX 76053	118
9	SEMSARCH	529 ft.	ANADITE METAL FINISHING	711 WEST HURST STREET, HURST, TX 76053	121
9	VCP	529 ft.	ANADITE, INC.	711 W HURST BLVD, HURST, TX 76053	122
9	VCP	529 ft.	ANADITE MANUFACTURING FACILITY	711 W HURST BLVD, HURST, TX 76053	124
10	IHWCA	529 ft.	US GALVANIZING PLANT 1579	645 W HURST BLVD, HURST, TX 76053	127
11	IHWCA	505 ft.	KELLOGG BROWN ROOT	3120 S PRECINCT LINE RD, HURST, TX 76053	128
11	IOP	505 ft.	KELLOGG BROWN & ROOT FACILITY	3120 S PRECINCT LINE RD, HURST, TX 76053	129

Elevation Summary

Map ID#	Database Name	Elevation	Site Name	Address	Page #
11	LPST	505 ft.	BROWN ROOT HEAVY CIVIL YARD	3120 S PRECINCT LINE RD, HURST, TX 76053	130
11	MSWLF	505 ft.	WALKER BRANCH RECYCLING INC	3120 S PRECINCT LINE RD, HURST, TX 76053	136
11	MSWLF	505 ft.	PRECINCT LINE ROAD RECYCLING FACILITY	MAPSCO 52Z 3120 PRECINCT LINE RD, HURST, TX	137
12	IHWCA	522 ft.	BELL HELICOPTER PLANT 1	3255 BELL HELICOPTER BLVD, FORT WORTH, TX 76118	138
12	RCRAC	522 ft.	BELL PLANT 1	600 E HURST BLVD, HURST, TX 76053	139

Tier II Chemical Reporting Program Facilities (TIERII)

[MAP ID# 1](#)

Distance from Property: 0.005 mi. (26 ft.) W
Elevation: 532 ft. (Equal to TP)

SITE INFORMATION

UNIQUE ID: 4XVZ7N002QH6

SITE ID: FATR20064XVZ7N002QH6

NAME: CITY OF HURST PUMP STATION #1

ADDRESS: 116 HURSTVIEW DRIVE
HURST, TX 76053

SIGNED DATE: 6/22/2007

VALIDATION REPORT: THIS FACILITY PASSED ALL VALIDATION CHECKS.

MAILING ADDRESS: 2001 PRECINCT LINE ROAD
HURST, TX 76054

SITE DETAILS

SITE TYPE: WATER SUPPLY

CHEMICAL LOCATION:

CHEMICAL STORAGE BUILDING

CHEMICAL AMOUNT: 300 POUNDS

CHEMICAL LOCATION:

INSIDE CHEMICAL STORAGE BUILDING

CHEMICAL AMOUNT: 300 POUNDS

CHEMICAL NAME: CHLORINE

MAXIMUM AMOUNT: 300 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: AMMONIA

MAXIMUM AMOUNT: 300 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: NOT REPORTED SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

[Back to Report Summary](#)

Tier I I Chemical Reporting Program Facilities (TIERII)

[MAP ID# 1](#)

Distance from Property: 0.005 mi. (26 ft.) W
Elevation: 532 ft. (Equal to TP)

SITE INFORMATION

UNIQUE ID: 5UL7U3021P8E

SITE ID: FATR20075UL7U3021P8E

NAME: CITY OF HURST PUMP STATION #1

ADDRESS: 116 HURSTVIEW DRIVE
HURST, TX 76053

SIGNED DATE: 5/30/2008

VALIDATION REPORT: THIS FACILITY PASSED ALL VALIDATION CHECKS.

MAILING ADDRESS: 2001 PRECINCT LINE ROAD
HURST, TX 76054

SITE DETAILS

CHEMICAL LOCATION:

NO LONGER HAVE CHLORINE AT THIS LOCATION

CHEMICAL AMOUNT: 0 POUNDS

CHEMICAL LOCATION:

NO LONGER HAVE AMMONIA AT THIS LOCATION

CHEMICAL AMOUNT: 0 POUNDS

CHEMICAL NAME: AMMONIA

MAXIMUM AMOUNT: 0 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: CHLORINE

MAXIMUM AMOUNT: 0 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

MIXTURE CHEMICAL: NOT REPORTED

[Back to Report Summary](#)

Tier II Chemical Reporting Program Facilities (TIERII)

MAP ID# 1

Distance from Property: 0.005 mi. (26 ft.) W
Elevation: 532 ft. (Equal to TP)

SITE INFORMATION

UNIQUE ID: 6J6JQL007XZE

SITE ID: FATR20096J6JQL007XZE

NAME: CITY OF HURST PUMP STATION #1

ADDRESS: 116 HURSTVIEW DRIVE

HURST, TX 76053

SIGNED DATE: 3/3/2010

VALIDATION REPORT: THIS FACILITY PASSED ALL VALIDATION CHECKS.

MAILING ADDRESS: 2001 PRECINCT LINE ROAD

HURST, TX 76054

SITE DETAILS

SITE TYPE: WATER SUPPLY EXCEPT IRRIGATION

SITE TYPE: WATER SUPPLY EXCEPT IRRIGATION

CHEMICAL LOCATION:

NO LONGER HAVE CHLORINE AT THIS LOCATION

CHEMICAL AMOUNT: 0 POUNDS

CHEMICAL LOCATION:

NO LONGER HAVE AMMONIA AT THIS SITE.

CHEMICAL AMOUNT: 0 POUNDS

CHEMICAL LOCATION:

NO LONGER HAVE CHLORINE AT THIS LOCATION

CHEMICAL AMOUNT: 0 POUNDS

CHEMICAL LOCATION:

NO LONGER HAVE AMMONIA AT THIS SITE.

CHEMICAL AMOUNT: 0 POUNDS

CHEMICAL NAME: AMMONIA

MAXIMUM AMOUNT: 0 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: CHLORINE

MAXIMUM AMOUNT: 0 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: AMMONIA

MAXIMUM AMOUNT: 0 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: CHLORINE

MAXIMUM AMOUNT: 0 POUNDS

FIRE: NOT REPORTED GAS: YES LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

MIXTURE CHEMICAL: NOT REPORTED

MIXTURE CHEMICAL: NOT REPORTED

[Back to Report Summary](#)

Petroleum Storage Tanks (PST)

MAP ID# 2

Distance from Property: 0.027 mi. (143 ft.) SW
Elevation: 532 ft. (Equal to TP)

FACILITY INFORMATION

ID#: 5034
NAME: CODY A C & HEATING
ADDRESS: 348 W HURST BLVD
HURST, TX 76053
COUNTY: TARRANT
REGION: 4
TYPE: UNKNOWN
BEGIN DATE: 06/23/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO
NUMBER OF ACTIVE UNDERGROUND TANKS: 0
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED
ORGANIZATION: CODY A C & HEATING
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED
CITY NOT REPORTED
PHONE: (817) 2681661 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/23/1986
SIGNATURE NAME & TITLE: B BRAZIL, SIGNATURE TITLE NOT REPORTED
ENFORCEMENT ACTION DATE: NOT REPORTED

OWNER

OWNER NUMBER: CN600830830
NAME: CODY AIR CONDITIONING & HEATING INC
CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED
CITY NOT REPORTED
TYPE: ORGANIZATION
BEGIN DATE: 06/23/1986
CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED
PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR

NO OPERATOR INFORMATION REPORTED

SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

CONSTRUCTION NOTIFICATION

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

UNDERGROUND STORAGE TANK

TANK ID: 1
INSTALLATION DATE: 01/01/1983
NUMBER OF COMPARTMENTS: 1
REGISTRATION DATE: 05/08/1986

Petroleum Storage Tanks (PST)

TANK CAPACITY (GAL): **2000** EMPTY TANK: **NOT EMPTY**
STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/30/1993**
INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **17465**

TANK ID: **1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **2000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Industrial and Hazardous Waste Sites (IHW)

MAP ID# 3

Distance from Property: 0.104 mi. (549 ft.) S
Elevation: 531 ft. (Lower than TP)

FACILITY INFORMATION

SWR#: **30557** EPA ID: **TXD051376143**

TCEQ#: **8121**

NAME: **KELLY-MOORE PAINT**

ADDRESS: **301 W HURST BLVD**
HURST, TX 76053

CONTACT: **JERRY OFFORD**

PHONE: **817-2399016**

BUSINESS DESCRIPTION: **NOT REPORTED**

INDUSTRIAL WASTE PERMIT #: **NOT REPORTED**

MUNICIPAL WASTE PERMIT #: **NOT REPORTED**

SIC CODE: **NOT REPORTED**

WASTE GENERATOR: **YES**

WASTE RECEIVER: **NO**

WASTE TRANSPORTER: **NO**

TRANSFER FACILITY: **NO**

MAQUILADORA (MEXICAN FACILITY): **NO**

STATUS: **ACTIVE**

AMOUNT OF WASTE GENERATED: **CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR**

GENERATOR TYPE: **INDUSTRIAL**

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): **11/01/2019**

ACTIVITIES

ACTIVITY TYPE: **UNKNOWN**

ACTIVITY DESCRIPTION: **NOT REPORTED**

WASTE

WASTE ID: **10950**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10951**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10952**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

OWNER INFORMATION

NAME: **KELLY-MOORE PAINT COMPANY INC**

ADDRESS: **301 W HURST BLVD**
HURST, TX 76053

PHONE: **1-817-2683131**

Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10953**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10954**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10955**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10956**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **10957**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **64616**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **120244**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **WASTE PAINT RELATED MATERIAL / WASTE WAS GENERATED FROM PAINT MFG. PROCESS (OFF-**

WASTE ID: **128696**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **SAND TRAP FLUIDS FROM TRUCK WASH BAY**

WASTE ID: **137477**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

Industrial and Hazardous Waste Sites (IHW)

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **COLLECTOR DUST/CLEAN-OUT OF DUST COLLECTOR; 6/95**

WASTE ID: **147157**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NYLON FILTER BAGS WITH LATEX PAINT RESIDUE/ CHANGING OF FILTERS.; DUE TO CHANGE(**

WASTE ID: **147158**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **FILTERE BAGS FOR SOLVENT PAINT/ CHANGING OF FILTERS.; DUE TO CHANGE(S) IN THE PR**

WASTE ID: **147159**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **USED RAGS WITH TRACES OF SOLVENT/ CLEANUP; DUE TO CHANGE(S) IN THE PRODUCT PRODU**

WASTE ID: **147160**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **USED OIL/FROM CHANGING OIL IN EQUIPMENT.; DUE TO WASTE MINIMIZATION, INGREDIENT**

WASTE ID: **147161**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **WASTE WATER SLUDGE / FROM LATEX PAINT WASHINGS HAVING SOLIDS SETTLED OUT.**

WASTE ID: **147162**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **PLANT TRASH / OFFICE TRASH, FOOD WASTE, CARDBOARD, PACKING MATERIAL, WOOD AND PL**

WASTE ID: **147163**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **EMPTY CONTAINERS / FROM EMPTYING CONTAIENRS DURING MANUFACTURING PROCESS.**

WASTE ID: **147164**

Industrial and Hazardous Waste Sites (IHW)

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **USED OIL FILTERS / FROM SERVICING MACHINERY; DUE TO WASTE MINIMIZATION, INGREDIE**

WASTE ID: **147165**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **EMPTY CONTAINERS /FROM EMPTYING CONTAINERS DURING MANUFACTURING.**

WASTE ID: **147166**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **CLEANING SOLVENT/ FROM PARTS WASHER**

WASTE ID: **147167**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **LATEX PAINT WASHINGS / FROM WASHING OUT LATEX PAINT MANUFACTURING EQUIPMENT.**

WASTE ID: **147168**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **FUME SCRUBBER WATER / REMOVAL OF FOUL SMELLING PARTICLES FROM THE AIR, ENERATEDF**

WASTE ID: **151993**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **CAUSTIC WATER FROM FUME SCRUBBER/REMOVAL OF CAUSTIC PARTICLES FROM LATEX MANUFAC**

WASTE ID: **171742**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **PARTS WASHING SOLVENT / USED TO CLEAN GREASE AND OIL OFF PARTS.; DUE TO CHANGE(S**

WASTE ID: **194530**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **LEAD BASED PAINT ADDITIVE GENERATED FROM OUT OF DATE MATERIAL; ONE TIME SHIPMENT**

Industrial and Hazardous Waste Sites (IHW)

WASTE ID: **201097**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT OF DATE MATERIAL-LIQUID COLORANT PAINT ADDITIVE; ONE TIME SHIPMEN**

WASTE ID: **201098**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT OF DATE MATERIAL-SYNTHETIC PARRAFIN PAINT ADDITIVE; ONE TIMESHIPM**

WASTE ID: **201099**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT OF DATE MATERIAL-AQUEOUS PAINT ADDITIVES; ONE TIME SHIPMENT.**

WASTE ID: **201100**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT OF DATE MATERIAL-WATER BASE PAINT ADDITIVES; ONE TIME SHIPMENT.**

WASTE ID: **201101**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT OF DATE MATERIAL; ONE TIME SHIPMENT.**

WASTE ID: **205228**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **PLATE ACTIVATOR USED IN PLATE DEVELOPING IN PRINTING PROCESS; DUE TO CHANGE(S) I**

WASTE ID: **205229**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **USED PLATE STABILIZER WITH PLATE ACTIVATOR FROM PLATE DEVELOPING PROCESS IN PRI**

WASTE ID: **205230**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OLD RESINS USED IN THE MANUFACTURING PROCESS; ONE TIME**

Industrial and Hazardous Waste Sites (IHW)

SHIPMENT.

WASTE ID: **205231**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT DATED PAINT ADDITIVE. COPPER NITRATE SOLUTION; ONE TIME SHIPMENT.**

WASTE ID: **205232**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING FORMALDEHYDE THAT WAS ONCE USED TO KEEP MOLD FROM GROWING ON LATEX; O**

WASTE ID: **205233**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OLD SOLVENT PAINT ADDITIVES NO LONGER USED IN THE MANUFACTURING PROCE**

WASTE ID: **205234**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OBSOLETE RAW MATERIAL NO LONGER USED IN THE MANUFACTURING PROCESS. (S**

WASTE ID: **205235**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OUT OF DATE RAW MATERIALS USED IN THE MANUFACTURING OF WATER BASE PAI**

WASTE ID: **205625**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **WASTE OIL BASE PAINT THAT CAN NOT BE REWORKED OR RECYCLED; DUE TO CHANGE(S) IN T**

WASTE ID: **207466**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **LATEX PAINT MIXED WITH CLAY ABSORBENT.**

WASTE ID: **207467**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

Industrial and Hazardous Waste Sites (IHW)

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DRY WASH WATER SLUDGE FROM EQUIPMENT WASH OUT.**

WASTE ID: **207468**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NON-HAZARDOUS LATEX PAINT THAT DOES NOT MEET QC STANDARDS.**

WASTE ID: **207469**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OFF-SPEC LATEX PAINT SOLID IN CANS**

WASTE ID: **207470**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISPOSAL OF OUT OF DATE RAW MATERIAL SODIUM ACETATE AND WATER.; ONE TIME SHIPMEN**

WASTE ID: **207471**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISPOSAL OF OBSOLETE RAW MATERIAL AMMONIUM PERSULFATE; ONE TIME SHIPMENT.**

WASTE ID: **207472**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OBSOLETE MATERIAL HYDROCHLORIC ACID NO LONGER USED IN PROCESS.; ONE TIME SHIPMEN**

WASTE ID: **207473**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **SODIUM LAURYL SULFATE OUT OF DATE RAW MATERIAL; ONE TIME SHIPMENT.**

WASTE ID: **207756**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE RAW MATERIAL AMMONIUM CARBONATE; ONE TIME SHIPMENT.**

WASTE ID: **207757**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OFF-SPEC OIL BASE PAINT; HAZARDOUS WASTE CURRENTLY BEING MANAGED**

Industrial and Hazardous Waste Sites (IHW)

UNDER UNIVERSAL

WASTE ID: **207758**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RAW MATERIAL SODIUM BICARBONATE; ONE TIME SHIPMENT.**

WASTE ID: **207759**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE OIL BASE COLORANT; ONE TIME SHIPMENT.**

WASTE ID: **207760**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RAW MATERIAL NO LONGER USED IN PROCESS METHALLYL SULFONATE;
ONE TIME SHIPMEN**

WASTE ID: **207761**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD CHROME YELLOW PIGMENT NO LONGER USED IN PROCESS; ONE TIME
SHIPMENT.**

WASTE ID: **207762**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD BLACK PIGMENT; ONE TIME SHIPMENT.**

WASTE ID: **207763**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RAW MATERIAL ANSULLO 3X3; ONE TIME SHIPMENT.**

WASTE ID: **207764**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD WATER BASE COLORANT**

WASTE ID: **207765**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RAW MATERIAL KM12 SURFACTANT; ONE TIME SHIPMENT.**

WASTE ID: **207766**

WASTE CODE STATUS: **INACTIVE**

Industrial and Hazardous Waste Sites (IHW)

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RAW MATERIAL E-135; ONE TIME SHIPMENT.**

WASTE ID: **207767**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OBSOLETE RAW MATERIAL VICTAWET 12; ONE TIME SHIPMENT.**

WASTE ID: **207768**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATED CH-156 RAW MATERIAL; ONE TIME SHIPMENT.**

WASTE ID: **207769**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE RAW MATERIAL HYDROSULFITE AWC; ONE TIME SHIPMENT.**

WASTE ID: **208692**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE TINUVIN 328; ONE TIME SHIPMENT.**

WASTE ID: **208693**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE SYLOID 83; ONE TIME SHIPMENT.**

WASTE ID: **208694**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE MINI-FIBER; ONE TIME SHIPMENT.**

WASTE ID: **208695**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE DYMSOL MS-40; ONE TIME SHIPMENT.**

WASTE ID: **208696**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE BARYTES H7; ONE TIME SHIPMENT.**

WASTE ID: **208697**

WASTE CODE STATUS: **INACTIVE**

Industrial and Hazardous Waste Sites (IHW)

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE BURNT UMBER PIGMENT; ONE TIME SHIPMENT.**

WASTE ID: **208698**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DSX1550 OUT OF DATE MATERIAL; ONE TIME SHIPMENT.**

WASTE ID: **210675**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DISCARDING OBSOLETE MATERIAL NO LONGER USED IN PROCESS (PUMICE); ONE TIME SHIPME**

WASTE ID: **212616**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DICARDING OLD RAW MATERIAL PINE OIL.; ONE TIME SHIPMENT.**

WASTE ID: **212617**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **DICARDING OLD BLUE NON-HAZARDOUS PIGMENT; ONE TIME SHIPMENT.**

WASTE ID: **212618**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD GREEN PIGMENT USED IN MANUFACTURING PROCESS; ONE TIME SHIPMENT.**

WASTE ID: **215100**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **RAW MATERIAL NO LONGER USED IN PROCESS L-23; DUE TO CHANGE(S) IN THE PRODUCT PRO**

WASTE ID: **215101**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD MATERIAL THAT CAN NOT BE USED FOR PRODUCTION.; ONE TIME SHIPMENT.**

WASTE ID: **215102**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **MTERIAL NO LONGER USED IN PROCESS; DUE TO CHANGE(S) IN THE PRODUCT**

Industrial and Hazardous Waste Sites (IHW)

PRODUCED, THI

WASTE ID: **215103**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE MATERIAL RHODOLINE 681F CAN'T BE USED FOR PRODUCTION;
ONE TIME SHIPM**

WASTE ID: **215104**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE POLYPHOBE CAN NOT BE USED IN PROCESS.; ONE TIME SHIPMENT.**

WASTE ID: **219027**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **LATEX THAT CAN NOT BE USED IN MANUFACTURING PROCESS; ONE TIME
SHIPMENT.**

WASTE ID: **219028**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RED PIGMENT THAT CAN NOT BE USED IN PROCESS; ONE TIME SHIPMENT.**

WASTE ID: **219029**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD RAW MATERIAL NOT USED ZEOTHIX 95; ONE TIME SHIPMENT.**

WASTE ID: **219580**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **CORROSIVE LIQUID RAW MATERIAL UNUSABLE IN PROCESS; DUE TO CHANGE(S)
IN THE PRODU**

WASTE ID: **220566**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE RAW MATERIAL NO LONGER USED; ONE TIME SHIPMENT.**

WASTE ID: **223969**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE PLIOLITE POLYMER; ONE TIME SHIPMENT.**

WASTE ID: **223970**

Industrial and Hazardous Waste Sites (IHW)

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE CELLULOSE; ONE TIME SHIPMENT.**

WASTE ID: **223971**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE PLASTISIZER; ONE TIME SHIPMENT.**

WASTE ID: **223972**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE PPAIN ADDITIVE; ONE TIME SHIPMENT.**

WASTE ID: **224025**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD BARYTES RAW MATERIAL; ONE TIME SHIPMENT.**

WASTE ID: **229325**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE MATERIAL B97; ONE TIME SHIPMENT.**

WASTE ID: **231823**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **UNUSED BATTERY ACID; ONE TIME SHIPMENT.**

WASTE ID: **243989**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE ACRY SOL THICKENING AGENT; ONE TIME SHIPMENT.**

WASTE ID: **243990**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OLD DEFOAMER PAST EXPIRATION DATE; ONE TIME SHIPMENT.**

WASTE ID: **249274**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE MATERIAL; ONE TIME SHIPMENT.**

WASTE ID: **258047**

Industrial and Hazardous Waste Sites (IHW)

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **297456**

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **297457**

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **304961**

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **304962**

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **306521**

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **311873**

WASTE CODE STATUS: **NOT REPORTED**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **NOT REPORTED**

WASTE ID: **326381**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **OUT OF DATE DRIRITE NO LONGER USED; ONE TIME SHIPMENT.**

WASTE ID: **356896**

WASTE CODE STATUS: **INACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **GLUE USED TO APPLY LABELS TO CONTAINERS. MATERIAL IS OUT DATED OR EXPIRE.**

Industrial and Hazardous Waste Sites (IHW)

WASTE ID: **364712**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **EMPTY PLASTIC CONTAINERS THAT LAST CONTAINED NONHAZARDOUS MATERIAL THAT ARE NOT**

WASTE ID: **391472**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **LATEX SOLIDS FROM WASTE WATER.**

WASTE ID: **391473**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **NO**

GENERATOR'S DESCRIPTION OF WASTE: **ASBESTOS SOLIDS AND DEBRIS FROM DEMO OF UPPER OFFICE AREA.**

WASTE ID: **396393**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **OUTDATED / EXPIRE MATERIAL.**

WASTE ID: **396398**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **NON - HAZARDOUS EXPIRED MATERIAL**

WASTE ID: **409017**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **NON-HAZARDOUS EXPIRED MATERIAL**

WASTE ID: **413686**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **UNUSED, OUT OF DATE, OR UNWANTED MATERIAL**

WASTE ID: **413688**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **DOWICIL 75 PRESERVATIVE UNUSED, OUT OF DATE PRODUCT**

WASTE ID: **413689**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: **GLUE - THAT IS OUT UNUSED OR OUT DATED**

WASTE ID: **413702**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATED, UNUSED DEGREASER MATERIAL.**

WASTE ID: **413703**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **MERGAL K12N -PRESERVATION - OUT DATE OR UNUSED MATERIAL**

WASTE ID: **413704**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **BYK ADDITIVES - NON-HAZARDOUS OUT DATED OR UNUSED MATERIAL**

WASTE ID: **413705**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **EPOXY RESIN IN PAILS PACKED - OUT DATED OR UNUSED MATERIAL.**

WASTE ID: **413706**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **GLYCOL ETHER EB - OUT DATE OR UNUSED MATERIAL.**

WASTE ID: **413707**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **SURFACTANT - OUT DATED OR UNUSED MATERIAL.**

WASTE ID: **413735**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATED, UNUSED AMMONIUM HYDROXIDE MATERIAL**

WASTE ID: **413736**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATE OR UNUSED SODIUM HYPOCHLORITE**

WASTE ID: **413737**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATE OR UNUSED MIXTURE OF BLEACH WITH LATEX PAINT MATERIAL**

WASTE ID: **413738**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATE OR UNUSED HYDROCHLORIC ACID**

WASTE ID: **413786**

WASTE CODE STATUS: **ACTIVE**

WASTE IS RADIOACTIVE: **NO**

WASTE IS TREATED OFF SITE: **YES**

GENERATOR'S DESCRIPTION OF WASTE: **OUT DATE OR UNUSED KEROSENE WITH EPOXY RESIN MATERIAL**

[Back to Report Summary](#)

Leaking Petroleum Storage Tanks (LPST)

MAP ID# 3

Distance from Property: 0.104 mi. (549 ft.) S
Elevation: 531 ft. (Lower than TP)

FACILITY INFORMATION

GEOSEARCH ID: 104779
LPST ID: 104779
FACILITY ID: 9628
NAME: KELLY MOORE PAINT CO
ADDRESS: 301 W HURST BLVD
HURST, TX 76053

LEAKING TANK DETAILS

LPST ID: 104779
NAME: KELLY MOORE PAINT CO
FACILITY LOCATION: NOT REPORTED
PRIORITY CODE: 5 - MINOR SOIL CONTAMINATION - DOES NOT REQUIRE A RAP
CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED
CORRECTIVE ACTION START DATE: NOT REPORTED
REPORTED DATE: 01/27/1992
ENTERED DATE: 10/22/1992
CLOSURE DATE: 11/04/1992

PRP INFORMATION

NAME: NOT REPORTED
ADDRESS: ADDRESS NOT REPORTED
SAN CARLOS CA 94070
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: UT1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 10000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 10/28/1991
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:
STEEL
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

Leaking Petroleum Storage Tanks (LPST)

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28209**

TANK ID: **UT1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **DIESEL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT10**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **3000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28214**

TANK ID: **UT10**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **3000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

Leaking Petroleum Storage Tanks (LPST)

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT11**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **3000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28210**

TANK ID: **UT11**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **3000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT2**

NUMBER OF COMPARTMENTS: **1**

Leaking Petroleum Storage Tanks (LPST)

INSTALLATION DATE: **01/01/1970** REGISTRATION DATE: **05/08/1986**
TANK CAPACITY (GAL): **10000** EMPTY TANK: **NOT EMPTY**
STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/28/1991**
INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28208**

TANK ID: **UT2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **TEXANOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT3**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

Leaking Petroleum Storage Tanks (LPST)

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28211**

TANK ID: **UT3**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT5**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28213**

TANK ID: **UT5**

Leaking Petroleum Storage Tanks (LPST)

COMPARTMENT LETTER: **A**

SUBSTANCES: **NAPHTHA**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT6**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28212**

TANK ID: **UT6**

COMPARTMENT LETTER: **A**

SUBSTANCES: **ETHYLENE GLYCOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

Leaking Petroleum Storage Tanks (LPST)

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT7**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **8000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28217**

TANK ID: **UT7**

COMPARTMENT LETTER: **A**

SUBSTANCES: **VINYL ACETATE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT8**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **8000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

Leaking Petroleum Storage Tanks (LPST)

INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28216**

TANK ID: **UT8**

COMPARTMENT LETTER: **A**

SUBSTANCES: **VINYL ACETATE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT9**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

Leaking Petroleum Storage Tanks (LPST)

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28215**

TANK ID: **UT9**

COMPARTMENT LETTER: **A**

SUBSTANCES: **ETHYLENE GLYCOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: **191671** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **16** REGISTRATION DATE: **08/06/1999**

INSTALLATION DATE: **12/08/1998** STATUS BEGIN DATE: **12/08/1998**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **IN USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **201289** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **21** REGISTRATION DATE: **03/04/2003**

INSTALLATION DATE: **12/08/1998** STATUS BEGIN DATE: **12/08/1998**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **IN USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

Leaking Petroleum Storage Tanks (LPST)

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

[Back to Report Summary](#)

Leaking Petroleum Storage Tanks (LPST)

MAP ID# 3

Distance from Property: 0.104 mi. (549 ft.) S
Elevation: 531 ft. (Lower than TP)

FACILITY INFORMATION

GEOSEARCH ID: 114472
LPST ID: 114472
FACILITY ID: 9628
NAME: KELLY MOORE PAINT CO
ADDRESS: 301 W HURST BLVD
HURST, TX 76053

LEAKING TANK DETAILS

LPST ID: 114472
NAME: KELLY MOORE PAINT CO
FACILITY LOCATION: NOT REPORTED
PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED
CORRECTIVE ACTION STATUS CODE: 6P - FINAL PENDING WELL PLUG
CORRECTIVE ACTION START DATE: NOT REPORTED
REPORTED DATE: 12/28/1998
ENTERED DATE: 02/23/1999
CLOSURE DATE: 07/26/1999

PRP INFORMATION

NAME: NOT REPORTED
ADDRESS: ADDRESS NOT REPORTED
HURST TX 76053
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: UT1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 10000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 10/28/1991
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:
STEEL
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

Leaking Petroleum Storage Tanks (LPST)

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28209**

TANK ID: **UT1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **DIESEL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT10**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **3000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28214**

TANK ID: **UT10**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **3000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

Leaking Petroleum Storage Tanks (LPST)

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT11**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **3000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28210**

TANK ID: **UT11**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **3000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT2**

NUMBER OF COMPARTMENTS: **1**

Leaking Petroleum Storage Tanks (LPST)

INSTALLATION DATE: **01/01/1970** REGISTRATION DATE: **05/08/1986**
TANK CAPACITY (GAL): **10000** EMPTY TANK: **NOT EMPTY**
STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/28/1991**
INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28208**

TANK ID: **UT2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **TEXANOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT3**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

Leaking Petroleum Storage Tanks (LPST)

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28211**

TANK ID: **UT3**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT5**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28213**

TANK ID: **UT5**

Leaking Petroleum Storage Tanks (LPST)

COMPARTMENT LETTER: **A**

SUBSTANCES: **NAPHTHA**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT6**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28212**

TANK ID: **UT6**

COMPARTMENT LETTER: **A**

SUBSTANCES: **ETHYLENE GLYCOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

Leaking Petroleum Storage Tanks (LPST)

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT7**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **8000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28217**

TANK ID: **UT7**

COMPARTMENT LETTER: **A**

SUBSTANCES: **VINYL ACETATE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT8**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **8000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

Leaking Petroleum Storage Tanks (LPST)

INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28216**

TANK ID: **UT8**

COMPARTMENT LETTER: **A**

SUBSTANCES: **VINYL ACETATE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT9**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

Leaking Petroleum Storage Tanks (LPST)

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28215**

TANK ID: **UT9**

COMPARTMENT LETTER: **A**

SUBSTANCES: **ETHYLENE GLYCOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: **191671** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **16** REGISTRATION DATE: **08/06/1999**

INSTALLATION DATE: **12/08/1998** STATUS BEGIN DATE: **12/08/1998**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **IN USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **201289** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **21** REGISTRATION DATE: **03/04/2003**

INSTALLATION DATE: **12/08/1998** STATUS BEGIN DATE: **12/08/1998**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **IN USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

Leaking Petroleum Storage Tanks (LPST)

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

[Back to Report Summary](#)

Petroleum Storage Tanks (PST)

MAP ID# 3

Distance from Property: 0.104 mi. (549 ft.) S
Elevation: 531 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 9628
NAME: KELLY-MOORE PAINT
ADDRESS: 301 W HURST BLVD
HURST, TX 76053
COUNTY: TARRANT
REGION: 4
TYPE: FLEET REFUELING
BEGIN DATE: 07/17/1986
STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO
NUMBER OF ACTIVE UNDERGROUND TANKS: 0
NUMBER OF ACTIVE ABOVEGROUND TANKS: 2

CONTACT INFORMATION

NAME: DAVID KAYS
TITLE: NOT REPORTED
ORGANIZATION: KELLY-MOORE PAINT COMPANY
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED
CITY NOT REPORTED
PHONE: (817) 2683131 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/09/1986
SIGNATURE NAME & TITLE: SVEND STUBB, VP
ENFORCEMENT ACTION DATE: NOT REPORTED

OWNER

OWNER NUMBER: CN600130082
NAME: KELLY-MOORE PAINT COMPANY INC
CONTACT ADDRESS: 301 W HURST BLVD
HURST TX 76053
TYPE: CORPORATION/COMPANY
BEGIN DATE: 07/17/1986
CONTACT ROLE: OWNCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: KELLYMOORE PAINT COMPANY INC
PHONE: (817) 2683131 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR

OPERATOR NUMBER: CN600130082
NAME: KELLY-MOORE PAINT COMPANY INC
CONTACT ADDRESS: 301 W HURST BLVD
HURST TX 76053
TYPE: CORPORATION/COMPANY
BEGIN DATE: 07/17/1986
CONTACT ROLE: OPRCON
CONTACT NAME: CALVIN CHUN

Petroleum Storage Tanks (PST)

CONTACT TITLE: **PLANT MANAGER**
ORGANIZATION: **KELLY-MOORE PAINT COMPANY INC**
PHONE: **(817) 2683131 249**
FAX: **NOT REPORTED**
EMAIL: **DKAYS@KELLYMOORE.COM**

SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

CONSTRUCTION NOTIFICATION

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

UNDERGROUND STORAGE TANK

TANK ID: UT1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 10000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 10/28/1991
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:
STEEL
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28209**
TANK ID: **UT1**
COMPARTMENT LETTER: **A**
SUBSTANCES: **DIESEL**
OTHER SUBSTANCES: **NOT REPORTED**
CAPACITY (GAL): **10000**
COMPARTMENT RELEASE DETECTION: **NOT REPORTED**
SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**
CORROSION PROTECTION: **NOT REPORTED**
EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED
PIPING RELEASE DETECTION:
NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

Petroleum Storage Tanks (PST)

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: UT10	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 3000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 12/15/1998
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28214**

TANK ID: **UT10**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **3000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: UT11	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 3000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 12/15/1998
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

Petroleum Storage Tanks (PST)

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28210**

TANK ID: **UT11**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **3000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT2**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

Petroleum Storage Tanks (PST)

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28208**

TANK ID: **UT2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **TEXANOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT3**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28211**

TANK ID: **UT3**

COMPARTMENT LETTER: **A**

SUBSTANCES: **MINERAL SPIRITS**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

Petroleum Storage Tanks (PST)

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT5**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **10/28/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28213**

TANK ID: **UT5**

COMPARTMENT LETTER: **A**

SUBSTANCES: **NAPHTHA**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

Petroleum Storage Tanks (PST)

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: UT6	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 10000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 10/28/1991
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:
NOT REPORTED

EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28212**

TANK ID: **UT6**

COMPARTMENT LETTER: **A**

SUBSTANCES: **ETHYLENE GLYCOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: UT7	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 8000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 12/15/1998
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

Petroleum Storage Tanks (PST)

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28217**

TANK ID: **UT7**

COMPARTMENT LETTER: **A**

SUBSTANCES: **VINYL ACETATE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT8**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1981**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **8000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

Petroleum Storage Tanks (PST)

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28216**

TANK ID: **UT8**

COMPARTMENT LETTER: **A**

SUBSTANCES: **VINYL ACETATE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **UT9**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1970**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/15/1998**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **28215**

TANK ID: **UT9**

COMPARTMENT LETTER: **A**

SUBSTANCES: **ETHYLENE GLYCOL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

Petroleum Storage Tanks (PST)

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: **191671** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **16** REGISTRATION DATE: **08/06/1999**

INSTALLATION DATE: **12/08/1998** STATUS BEGIN DATE: **12/08/1998**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **IN USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **201289** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **21** REGISTRATION DATE: **03/04/2003**

INSTALLATION DATE: **12/08/1998** STATUS BEGIN DATE: **12/08/1998**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **IN USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

[Back to Report Summary](#)

Resource Conservation & Recovery Act - Generator (RCRAGR06)

MAP ID# 3

Distance from Property: 0.104 mi. (549 ft.) S
Elevation: 531 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD051376143

NAME: KELLY-MOORE PAINT

ADDRESS: 301 W HURST BLVD

HURST, TX 76053-7705

CONTACT NAME: JERRY OFFORD

CONTACT ADDRESS: 301 W HURST BLVD
HURST TX 76053-7705

CONTACT PHONE: 817-239-9016

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/05/2020

OWNER TYPE: PRIVATE

OWNER NAME: KELLYMOORE PAINT COMPANY INC

OPERATOR TYPE: PRIVATE

OPERATOR NAME: KELLYMOORE PAINT COMPANY INC

CERTIFICATION

CERTIFICATION NAME:	CERTIFICATION TITLE:	CERTIFICATION SIGNED DATE:
CALVIN D CHUN	REGULATORY COOR	01/25/1992
DOUGLAS W MERRILL	V.P. MANUFACTUR	01/31/1994
DAVID KAYS	AUTHORIZED AGNT	01/25/1998
DAVID KAYS	AUTHORIZED COMP	01/25/2000
DAVID KAYS	UNKNOWN	04/12/2005
DAVID KAYS	AUTHORIZEDAGENT	03/01/2002
DAVID KAYS	UNKNOWN	09/14/2005
DAVID KAYS	AUTHORIZEDAGENT	03/01/2004
DAVID KAYS	UNKNOWN	11/29/2005
DAVID KAYS	UNKNOWN	04/12/2006
DAVID KAYS	REGULATORY COOR	12/19/2006
DAVID KAYS	REGULATORY COOR	02/13/2007
DAVID KAYS	REGULATORY COOR	04/24/2007
DAVID KAYS	REGULATORY COOR	12/04/2007
DAVID KAYS	REGULATORY COOR	02/24/2009
DAVID KAYS	REGULATORY COOR	04/20/2010
DAVID KAYS	REGULATORY COOR	04/27/2010
DAVID KAYS	REGULATORY COORDINATOR	12/14/2010
DAVID KAYS	ENV MGR	03/06/2012
DAVID KAYS	REGULATORY COORDINATOR	10/17/2013
DAVID KAYS	REGULATORY COORDINATOR	08/18/2014
DAVID KAYS	REGULATORY COORDINATOR	11/30/2017
JERRY OFFORD	EHS COORDINATOR	02/25/2019
JERRY OFFORD	EHS COORDINATOR	03/12/2019
JERRY OFFORD	EHS COORDINATOR	02/10/2020
JERRY OFFORD	EHS COORDINATOR	03/05/2020

INDUSTRY CLASSIFICATION (NAICS)

32551 - PAINT AND COATING MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: VSG LAST UPDATED DATE: 03/25/2020

Resource Conservation & Recovery Act - Generator (RCRAGR06)

SUBJECT TO CORRECTIVE ACTION UNIVERSE: **NO**

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: **NO**

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: **NO**

NON TDSFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: **NO**

CORRECTIVE ACTION WORKLOAD UNIVERSE: **NO**

IMPORTER: **NO**

UNDERGROUND INJECTION: **NO**

MIXED WASTE GENERATOR: **NOT REPORTED**

UNIVERSAL WASTE DESTINATION FACILITY: **NO**

RECYCLER: **NO**

TRANSFER FACILITY: **NO**

TRANSPORTER: **NO**

USED OIL FUEL BURNER: **NO**

ONSITE BURNER EXEMPTION: **NO**

USED OIL PROCESSOR: **NO**

FURNACE EXEMPTION: **NO**

USED OIL FUEL MARKETER TO BURNER: **NO**

USED OIL REFINER: **NO**

SPECIFICATION USED OIL MARKETER: **NO**

USED OIL TRANSFER FACILITY: **NO**

USED OIL TRANSPORTER: **NO**

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS

02/08/2008	FCI FOCUSED COMPLIANCE INSPECTION
02/09/1996	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
02/09/1996	FCI FOCUSED COMPLIANCE INSPECTION
02/12/1998	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
03/26/2016	NRR NON-FINANCIAL RECORD REVIEW
04/08/1996	NRR NON-FINANCIAL RECORD REVIEW
04/29/1996	NRR NON-FINANCIAL RECORD REVIEW
05/21/2004	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/21/2004	FCI FOCUSED COMPLIANCE INSPECTION
06/05/1991	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/25/1998	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
08/05/1999	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
09/22/1983	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
09/22/2015	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/18/1984	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

VIOLATIONS

02/09/1996	262.A GENERATORS - GENERAL
02/09/1996	XXS STATE STATUTE OR REGULATION
02/12/1998	262.A GENERATORS - GENERAL
03/26/2016	270.A PERMITS - GENERAL INFORMATION
05/21/2004	262.D GENERATORS - RECORDS/REPORTING
05/21/2004	268.A LDR - GENERAL
05/21/2004	XXS STATE STATUTE OR REGULATION
06/25/1998	262.A GENERATORS - GENERAL
06/25/1998	XXS STATE STATUTE OR REGULATION
06/26/1998	XXS STATE STATUTE OR REGULATION
09/22/1983	262.A GENERATORS - GENERAL
09/22/2015	XXS STATE STATUTE OR REGULATION
10/18/1984	262.A GENERATORS - GENERAL

ENFORCEMENTS

Resource Conservation & Recovery Act - Generator (RCRAGR06)

02/09/1996	110	VERBAL INFORMAL
02/09/1996	120	WRITTEN INFORMAL
04/28/2016	140	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
05/05/2016	141	REFERRAL TO ESC ENFORCEMENT SCREEN COMM.
05/21/2004	110	VERBAL INFORMAL
06/25/1998	110	VERBAL INFORMAL
08/11/2016	210	INITIAL 3008(A) COMPLIANCE
09/28/1999	210	INITIAL 3008(A) COMPLIANCE
10/29/2015	120	WRITTEN INFORMAL
11/14/1984	120	WRITTEN INFORMAL
12/01/1983	120	WRITTEN INFORMAL
12/13/2016	310	FINAL 3008(A) COMPLIANCE ORDER

HAZARDOUS WASTE

D001	IGNITABLE WASTE
D002	CORROSIVE WASTE
D005	BARIUM
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D009	MERCURY
D018	BENZENE
D039	TETRACHLOROETHYLENE
F003	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F005	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
U122	FORMALDEHYDE
U147	2,5-FURANDIONE
U147	MALEIC ANHYDRIDE

UNIVERSAL WASTE

WASTE TYPE:	ACCUMULATED WASTE ON-SITE:	GENERATED WASTE ON-SITE:	SOURCE TYPE:
BATTERIES	NO	NO	ANNUAL/BIENNIAL REPORT
BATTERIES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
LAMPS	NO	NO	ANNUAL/BIENNIAL REPORT
LAMPS	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
PESTICIDES	NO	NO	ANNUAL/BIENNIAL REPORT
PESTICIDES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT

Resource Conservation & Recovery Act - Generator (RCRAGR06)

MERCURY CONTAINING NO NO ANNUAL/BIENNIAL REPORT
EQUIPMENT

MERCURY CONTAINING UNKNOWN UNKNOWN ANNUAL/BIENNIAL REPORT
EQUIPMENT

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

[Back to Report Summary](#)

Petroleum Storage Tanks (PST)

MAP ID# 4

Distance from Property: 0.117 mi. (618 ft.) E
Elevation: 530 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 41980
NAME: HURST IMPORT CAR REPAIR
ADDRESS: 224 W HURST BLVD
HURST, TX 76053
COUNTY: TARRANT
REGION: 4
TYPE: NOT REPORTED
BEGIN DATE: 01/27/1987
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO
NUMBER OF ACTIVE UNDERGROUND TANKS: 0
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED
ORGANIZATION: HURST IMPORT CAR REPAIR
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED
CITY NOT REPORTED
PHONE: (817) 2820652 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/25/1986
SIGNATURE NAME & TITLE: YANYONG SRINANT, OWNER
ENFORCEMENT ACTION DATE: NOT REPORTED

OWNER

OWNER NUMBER: CN601196017
NAME: SRINANT
CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED
CITY NOT REPORTED

TYPE: INDIVIDUAL
BEGIN DATE: 01/27/1987
CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED
PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR

NO OPERATOR INFORMATION REPORTED

SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

CONSTRUCTION NOTIFICATION

NOTIFICATION CONSTRUCTION ID: 8570
APPLICATION RECEIVED DATE: 05/04/2000
SCHEDULE CONSTRUCTION DATE: 06/03/2000
GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

Petroleum Storage Tanks (PST)

NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: 1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1984	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 200	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 05/02/2000
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: YES	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: YES	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 104709

TANK ID: 1

COMPARTMENT LETTER: A

SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 200

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Leaking Petroleum Storage Tanks (LPST)

MAP ID# 5

Distance from Property: 0.142 mi. (750 ft.) WSW
Elevation: 524 ft. (Lower than TP)

FACILITY INFORMATION

GEOSEARCH ID: 098920
LPST ID: 098920
FACILITY ID: 57103
NAME: BUILDERS CONCRETE PRODUCTS
ADDRESS: 501 W HURST BLVD
HURST, TX 76053

LEAKING TANK DETAILS

LPST ID: 098920
NAME: BUILDERS CONCRETE PRODUCTS
FACILITY LOCATION: NOT REPORTED
PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS
CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED
CORRECTIVE ACTION START DATE: NOT REPORTED
REPORTED DATE: 05/10/1991
ENTERED DATE: 05/13/1991
CLOSURE DATE: 07/14/2004

PRP INFORMATION

NAME: NOT REPORTED
ADDRESS: ADDRESS NOT REPORTED
KAUFMAN TX 75142
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: 1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1959	REGISTRATION DATE: 12/19/1990
TANK CAPACITY (GAL): NOT REPORTED	EMPTY TANK: EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 04/25/1991
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: YES	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: YES	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:
STEEL
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

Leaking Petroleum Storage Tanks (LPST)

COMPARTMENT DETAILS

UST COMPARTMENT ID: **128769**

TANK ID: **1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **0**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **2**

INSTALLATION DATE: **01/01/1959**

TANK CAPACITY (GAL): **NOT REPORTED**

STATUS: **REMOVED FROM GROUND**

INTERNAL PROTECTION DATE: **NOT REPORTED**

TANK DESIGN SINGLE WALL: **YES**

PIPE DESIGN SINGLE WALL: **YES**

NUMBER OF COMPARTMENTS: **1**

REGISTRATION DATE: **12/19/1990**

EMPTY TANK: **EMPTY**

STATUS BEGIN DATE: **04/25/1991**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **128768**

TANK ID: **2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **DIESEL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **0**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

Leaking Petroleum Storage Tanks (LPST)

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Petroleum Storage Tanks (PST)

MAP ID# 5

Distance from Property: 0.142 mi. (750 ft.) WSW
Elevation: 524 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 57103
NAME: BUILDERS CONCRETE PRODUCTS
ADDRESS: 501 W HURST BLVD
HURST, TX 76053
COUNTY: TARRANT
REGION: 4
TYPE: NOT REPORTED
BEGIN DATE: 12/19/1990
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO
NUMBER OF ACTIVE UNDERGROUND TANKS: 0
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

CONTACT INFORMATION

NAME: LEE SMITH
TITLE: PRESIDENT BCP
ORGANIZATION: BUILDERS CONCRETE PRODUCTS
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED
CITY NOT REPORTED
PHONE: (214) 2867700 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 12/19/1990
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/13/1990
SIGNATURE NAME & TITLE: LEE SMITH, PRESIDENT BCP
ENFORCEMENT ACTION DATE: NOT REPORTED

OWNER

OWNER NUMBER: CN601411812
NAME: BUILDERS CONCRETE INC
CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED
CITY NOT REPORTED
TYPE: CORPORATION/COMPANY
BEGIN DATE: 12/19/1990
CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED
PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR

NO OPERATOR INFORMATION REPORTED

SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

CONSTRUCTION NOTIFICATION

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

UNDERGROUND STORAGE TANK

TANK ID: 1
INSTALLATION DATE: 01/01/1959
NUMBER OF COMPARTMENTS: 1
REGISTRATION DATE: 12/19/1990

Petroleum Storage Tanks (PST)

TANK CAPACITY (GAL): **NOT REPORTED**

EMPTY TANK: **EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **04/25/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **YES**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **YES**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **128769**

TANK ID: **1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **0**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **2**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1959**

REGISTRATION DATE: **12/19/1990**

TANK CAPACITY (GAL): **NOT REPORTED**

EMPTY TANK: **EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **04/25/1991**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **YES**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **YES**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

Petroleum Storage Tanks (PST)

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **128768**

TANK ID: **2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **DIESEL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **0**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Innocent Owner / Operator Database (IOP)

[MAP ID# 6](#)

Distance from Property: 0.146 mi. (771 ft.) SE
Elevation: 528 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 0605

DATE IOP RECIEVED: 2/22/2007

CERTIFICATE ISSUED: 11/27/2007

NAME: TEXAS STAR SIGNS

ADDRESS: 229 W HURST BLVD
HURST, TX 76053

CONTAMINANTS: CHLORINATED SOLVENTS

MEDIA AFFECTED: GROUNDWATER

PHASE: COMPLETED

PROPERTY USE: SIGN MANUFACTURING

ACRES: 1.84

RN NUMBER: RN101545903

PROGRAM ID:

CURRENT FACILITY TYPE: PROPERTY COMMERCIAL

SITE ADDRESS DESCRIPTION: BLOCK 1, LOT 1 ASSOCIATED INDUSTRIAL & LOT C1A AND C1B KELLY SUBDIVISION

NEAR CITY NAME: HURST

ADMINISTRATIVE STATUS: INACTIVE

APPLICATION RECEIVED DATE: 02/21/2007

IOC DATE: 11/27/2007

TCEQ REGION NAME: REGION 04 - DFW METROPLEX

GROUNDWATER COCS IN CERTIFICATE: NOT REPORTED

SEDIMENT COCS IN CERTIFICATE: NOT REPORTED

SOIL COCS IN CERTIFICATE: NOT REPORTED

OTHER CONTACTS (CONSULTANT/ATTORNEY)

ORGANIZATION: W&M ENVIRONMENTAL, INC.

TEAL CHIABOTTI ENVIRONMENTAL SCIENTIST
112 NW 24TH STREET, SUITE 403
FORT WORTH TX 76164

PHONE: 817-378-0012 FAX: 817-378-9107

APPLICANT INFORMATION

ORGANIZATION: TEXAS STAR SIGNS

TEAL CHIABOTTI, PRESIDENT

ADDRESS: P.O. BOX 211404
BEDFORD, TX, 76095

INTEREST IN SITE: OWNER

PHONE: (817) 233-2005 FAX: NOT REPORTED

[Back to Report Summary](#)

Petroleum Storage Tanks (PST)

MAP ID# 6

Distance from Property: 0.146 mi. (771 ft.) SE
Elevation: 528 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 12698
NAME: ASSOCIATED BATTERY SUPPLY
ADDRESS: 229 W HURST BLVD
HURST, TX 76053
COUNTY: TARRANT
REGION: 4
TYPE: RETAIL
BEGIN DATE: 08/04/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO
NUMBER OF ACTIVE UNDERGROUND TANKS: 0
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

CONTACT INFORMATION

NAME: DOUG LLOYD
TITLE: NOT REPORTED
ORGANIZATION: ASSOCIATED BATTERY SUPPLY
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED
CITY NOT REPORTED
PHONE: (817) 2859440 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/26/1986
SIGNATURE NAME & TITLE: D LLOYD, PRES
ENFORCEMENT ACTION DATE: NOT REPORTED

OWNER

OWNER NUMBER: CN600814305
NAME: ASSOCIATED BATTERY SUPPLY
CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED
CITY NOT REPORTED
TYPE: ORGANIZATION
BEGIN DATE: 08/04/1986
CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED
PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR

NO OPERATOR INFORMATION REPORTED

SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

CONSTRUCTION NOTIFICATION

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

UNDERGROUND STORAGE TANK

TANK ID: 1
INSTALLATION DATE: 01/01/1981
NUMBER OF COMPARTMENTS: 1
REGISTRATION DATE: 05/08/1986

Petroleum Storage Tanks (PST)

TANK CAPACITY (GAL): 8000
STATUS: **REMOVED FROM GROUND**
INTERNAL PROTECTION DATE: **NOT REPORTED**
TANK DESIGN SINGLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO**
EMPTY TANK: **NOT EMPTY**
STATUS BEGIN DATE: **12/03/1998**
REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:
STEEL
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **42009**
TANK ID: **1**
COMPARTMENT LETTER: **A**
SUBSTANCES: **DIESEL**
OTHER SUBSTANCES: **NOT REPORTED**
CAPACITY (GAL): **8000**
COMPARTMENT RELEASE DETECTION: **NOT REPORTED**
SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**
CORROSION PROTECTION: **NOT REPORTED**
EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED
PIPING RELEASE DETECTION:
NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **2**
INSTALLATION DATE: **01/01/1981**
TANK CAPACITY (GAL): **8000**
STATUS: **REMOVED FROM GROUND**
INTERNAL PROTECTION DATE: **NOT REPORTED**
TANK DESIGN SINGLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO**
NUMBER OF COMPARTMENTS: **1**
REGISTRATION DATE: **05/08/1986**
EMPTY TANK: **NOT EMPTY**
STATUS BEGIN DATE: **12/03/1998**
REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:
STEEL

Petroleum Storage Tanks (PST)

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **42008**

TANK ID: **2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **8000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Innocent Owner / Operator Database (IOP)

[MAP ID# 7](#)

Distance from Property: 0.175 mi. (924 ft.) ESE
Elevation: 528 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 1030
DATE IOP RECIEVED: 8/5/2016
CERTIFICATE ISSUED: 9/8/2017
NAME: 205 WEST HURST BLVD
ADDRESS: 205 W HURST BLVD
HURST, TX 76053
CONTAMINANTS: VOCs
MEDIA AFFECTED: GROUNDWATER
PHASE: COMPLETED
PROPERTY USE: COMMERCIAL/INDUSTRIAL
ACRES: 5.6425
RN NUMBER: RN100806926
PROGRAM ID:
CURRENT FACILITY TYPE: PROPERTY COMMERCIAL
SITE ADDRESS DESCRIPTION: 205 W HURST BLVD
NEAR CITY NAME: HURST
ADMINISTRATIVE STATUS: INACTIVE
APPLICATION RECEIVED DATE: 08/04/2016
IOC DATE: 09/21/2017; 09/08/2017
TCEQ REGION NAME: REGION 04 - DFW METROPLEX
GROUNDWATER COCS IN CERTIFICATE: TETRACHLOROETHYLENE
SEDIMENT COCS IN CERTIFICATE: NOT REPORTED
SOIL COCS IN CERTIFICATE: NOT REPORTED

OTHER CONTACTS (CONSULTANT/ATTORNEY)

ORGANIZATION: BROWNING ENVIRONMENTAL
SHANE JOHNSTON MANAGING PARTNER
5021 PINELLAS AVE
FORT WORTH TX 76244
PHONE: 817-694-4861 FAX: NOT REPORTED

APPLICANT INFORMATION

ORGANIZATION: BUILDERS EQUIPMENT & TOOL CO
SHANE JOHNSTON, PRESIDENT &
ADDRESS: 1617 ENID ST
HOUSTON, TX, 77009
INTEREST IN SITE: CURRENT OPERATOR
PHONE: (713) 343-1801 FAX: NOT REPORTED

[Back to Report Summary](#)

Leaking Petroleum Storage Tanks (LPST)

[MAP ID# 7](#)

Distance from Property: 0.175 mi. (924 ft.) ESE
Elevation: 528 ft. (Lower than TP)

FACILITY INFORMATION

GEOSEARCH ID: 105404
LPST ID: 105404
FACILITY ID: 16556
NAME: TRINITY INDUSTRIES
ADDRESS: 205 W HURST BLVD
HURST, TX 76053

LEAKING TANK DETAILS

LPST ID: 105404
NAME: TRINITY INDUSTRIES
FACILITY LOCATION: NOT REPORTED
PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS
CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED
CORRECTIVE ACTION START DATE: NOT REPORTED
REPORTED DATE: 04/02/2015
ENTERED DATE: 06/12/2015
CLOSURE DATE: 02/19/2018

PRP INFORMATION

NAME: NOT REPORTED
ADDRESS: ADDRESS NOT REPORTED
HURST TX 76053
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: 1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 2000	EMPTY TANK: EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 12/10/1992
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:
NOT REPORTED
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

Leaking Petroleum Storage Tanks (LPST)

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46774**

TANK ID: **1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **DIESEL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **2000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **2**

INSTALLATION DATE: **01/01/1971**

TANK CAPACITY (GAL): **2000**

STATUS: **REMOVED FROM GROUND**

INTERNAL PROTECTION DATE: **NOT REPORTED**

TANK DESIGN SINGLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

NUMBER OF COMPARTMENTS: **1**

REGISTRATION DATE: **05/08/1986**

EMPTY TANK: **EMPTY**

STATUS BEGIN DATE: **12/10/1992**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46777**

TANK ID: **2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **2000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

Leaking Petroleum Storage Tanks (LPST)

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **3**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **01/01/1971**

REGISTRATION DATE: **05/08/1986**

TANK CAPACITY (GAL): **1000**

EMPTY TANK: **EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **12/10/1992**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **NO**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46776**

TANK ID: **3**

COMPARTMENT LETTER: **A**

SUBSTANCES: **EMPTY**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **1000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **4**

NUMBER OF COMPARTMENTS: **1**

Leaking Petroleum Storage Tanks (LPST)

INSTALLATION DATE: **01/01/1971** REGISTRATION DATE: **05/08/1986**
TANK CAPACITY (GAL): **1000** EMPTY TANK: **EMPTY**
STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/10/1992**
INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46775**

TANK ID: **4**

COMPARTMENT LETTER: **A**

SUBSTANCES: **EMPTY**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **1000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Petroleum Storage Tanks (PST)

[MAP ID# 7](#)

Distance from Property: 0.175 mi. (924 ft.) ESE
Elevation: 528 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 16556
NAME: TRINITY FOREST INDUSTRIES
ADDRESS: 205 W HURST BLVD
HURST, TX 76053
COUNTY: TARRANT
REGION: 4
TYPE: INDUST/MFG/CHEM PLANT
BEGIN DATE: 08/21/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO
NUMBER OF ACTIVE UNDERGROUND TANKS: 0
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

CONTACT INFORMATION

NAME: R ANDERSON
TITLE: YARD FOREMAN
ORGANIZATION: TRINITY FOREST INDUSTRIES
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED
CITY NOT REPORTED
PHONE: (817) 2682441 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/22/1986
SIGNATURE NAME & TITLE: R ANDERSON, YARD FOREMAN
ENFORCEMENT ACTION DATE: NOT REPORTED

OWNER

OWNER NUMBER: CN600491328
NAME: CAL-WESTERN FOREST PRODUCTS INC
CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED
CITY NOT REPORTED
TYPE: CORPORATION/COMPANY
BEGIN DATE: 08/21/1986
CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED
PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR

NO OPERATOR INFORMATION REPORTED

SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

CONSTRUCTION NOTIFICATION

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

UNDERGROUND STORAGE TANK

TANK ID: 1
INSTALLATION DATE: 01/01/1971
NUMBER OF COMPARTMENTS: 1
REGISTRATION DATE: 05/08/1986

Petroleum Storage Tanks (PST)

TANK CAPACITY (GAL): **2000** EMPTY TANK: **EMPTY**
STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/10/1992**
INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:
NOT REPORTED
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46774**
TANK ID: **1**
COMPARTMENT LETTER: **A**
SUBSTANCES: **DIESEL**
OTHER SUBSTANCES: **NOT REPORTED**
CAPACITY (GAL): **2000**
COMPARTMENT RELEASE DETECTION: **NOT REPORTED**
SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**
CORROSION PROTECTION: **NOT REPORTED**
EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED
PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **2** NUMBER OF COMPARTMENTS: **1**
INSTALLATION DATE: **01/01/1971** REGISTRATION DATE: **05/08/1986**
TANK CAPACITY (GAL): **2000** EMPTY TANK: **EMPTY**
STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/10/1992**
INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED**
TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **NO**
PIPE DESIGN SINGLE WALL: **NO** PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:
NOT REPORTED

Petroleum Storage Tanks (PST)

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46777**

TANK ID: **2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **2000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **3**

INSTALLATION DATE: **01/01/1971**

TANK CAPACITY (GAL): **1000**

STATUS: **REMOVED FROM GROUND**

INTERNAL PROTECTION DATE: **NOT REPORTED**

TANK DESIGN SINGLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **NO**

NUMBER OF COMPARTMENTS: **1**

REGISTRATION DATE: **05/08/1986**

EMPTY TANK: **EMPTY**

STATUS BEGIN DATE: **12/10/1992**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46776**

Petroleum Storage Tanks (PST)

TANK ID: **3**
COMPARTMENT LETTER: **A**
SUBSTANCES: **EMPTY**
OTHER SUBSTANCES: **NOT REPORTED**
CAPACITY (GAL): **1000**
COMPARTMENT RELEASE DETECTION: **NOT REPORTED**
SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**
CORROSION PROTECTION: **NOT REPORTED**
EXTERNAL CONTAINMENT: **NOT REPORTED**
CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: 4	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971	REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 1000	EMPTY TANK: EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 12/10/1992
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: NO	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**
CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **46775**
TANK ID: **4**
COMPARTMENT LETTER: **A**
SUBSTANCES: **EMPTY**
OTHER SUBSTANCES: **NOT REPORTED**
CAPACITY (GAL): **1000**
COMPARTMENT RELEASE DETECTION: **NOT REPORTED**
SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **NOT REPORTED**

Petroleum Storage Tanks (PST)

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

[Back to Report Summary](#)

Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

[MAP ID# 8](#)

Distance from Property: 0.371 mi. (1,959 ft.) WSW
Elevation: 517 ft. (Lower than TP)

PROGRAM ID: 30016
RN NUMBER: RN100645753
NAME: NORTH AMERICAN GALVANIZING
ADDRESS: 625 W HURST BLVD
HURST, TX 76053
STATUS: INACTIVE
STATUS DATE: 2/23/2016
PHASE: COMPLETED WORKLOAD
LOCATION DESCRIPTION: 625 W HURST BLVD HURST TX
PHASE STATUS DATE: 2/23/2016
SOIL CHEMICAL OF CONCERN CLASS: NOT REPORTED
SOIL REMEDIATION: NOT REPORTED
GROUNDWATER CHEMICAL OF CONCERN CLASS: NOT REPORTED
GROUNDWATER REMEDIATION: NOT REPORTED

[Back to Report Summary](#)

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

MAP ID# 8

Distance from Property: 0.371 mi. (1,959 ft.) WSW
Elevation: 517 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD005966452

NAME: AZZ GALVANIZING HURST

ADDRESS: 625 W HURST BLVD
HURST, TX 76053-7603

CONTACT NAME: JOSH HONZA

CONTACT ADDRESS: 645 W HURST BLVD
HURST TX 76053-7603

CONTACT PHONE: 817-268-2414

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/18/2019

OWNER TYPE: PRIVATE

OWNER NAME: AZZ INCORPORATED

OPERATOR TYPE: PRIVATE

OPERATOR NAME: AZZ INCORPORATED

CERTIFICATION

CERTIFICATION NAME:	CERTIFICATION TITLE:	CERTIFICATION SIGNED DATE:
SEAN ELGAN	AUTHORIZED COMPANY AGENT	03/01/2010
GORDON BRIGGS	AUTHORIZED COMPANY AGENT	03/01/2012
TIM PENDLEY	GENERAL MANAGER	09/22/1992
GORDON BRIGGS	AUTHORIZED COMPANY AGENT	03/01/2014
TIM E PENDLEY	GENERAL MANAGER	01/24/1994
JOSH WILLIAMS	AUTHORIZED COMPANY AGENT	03/01/2016
JOSH HONZA	AUTHORIZED COMPANY AGENT	03/01/2018
GORDON BRIGGS	UNKNOWN	03/29/2005
RICK WOOD	AUTHORIZED AGNT	01/25/1998
GORDON BRIGGS	AUTHORIZED COMP	01/25/2000
GORDON BRIGGS	UNKNOWN	11/29/2005
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2002
GORDON BRIGGS	UNKNOWN	02/08/2006
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2004
GORDON BRIGGS	UNKNOWN	06/02/2006
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2006
SEAN ELGAN	AUTHORIZEDAGENT	03/01/2008
SEAN ELGAN	SR PROCESS ENGI	03/08/2007
SEAN ELGAN	SR PROCESS ENGI	03/22/2007
SEAN HALSTEAD	SR PROCESS ENGI	08/12/2008
SEAN HALSTEAD	SR PROCESS ENGI	09/16/2008
SEAN HALSTEAD	SR PROCESS ENGI	11/18/2008
SEAN HALSTEAD	SR PROCESS ENGI	06/09/2009
SEAN ELGAN	PLANT MANAGER	03/16/2010
GORDON BRIGGS	ENV MGR	11/04/2011
GORDON BRIGGS	PLANT MANAGER	11/29/2012
GORDON BRIGGS	PLANT MANAGER	05/29/2014
GORDON BRIGGS	PLANT MANAGER	10/09/2014
JIM MASON	VICE PRESIDENT	04/29/2008
DAVID WEST	CONTACT	05/13/2014

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

DAVID WEST	CONTACT	05/18/2015
JOSH WILLIAMS	PLANT MANAGER	07/05/2017
JOSH HONZA	PLANT MANAGER	11/27/2017
JOSH HONZA	PLANT MANAGER	05/22/2018
JOSH HONZA	PLANT MANAGER	03/18/2019

INDUSTRY CLASSIFICATION (NAICS)

332812 - METAL COATING, ENGRAVING (EXCEPT JEWELRY AND SILVERWARE), AND ALLIED SERVICES TO MANUFACTURERS

33991 - JEWELRY AND SILVERWARE MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: **LARGE QUANTITY GENERATOR** LAST UPDATED DATE: **04/02/2019**
SUBJECT TO CORRECTIVE ACTION UNIVERSE: **YES**
TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: **NO**
TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: **YES**
NON TDSFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: **NO**
CORRECTIVE ACTION WORKLOAD UNIVERSE: **NO**
IMPORTER: **NO** UNDERGROUND INJECTION: **NO**
MIXED WASTE GENERATOR: **NO** UNIVERSAL WASTE DESTINATION FACILITY: **NO**
RECYCLER: **NO** TRANSFER FACILITY: **NO**
TRANSPORTER: **NO** USED OIL FUEL BURNER: **NO**
ONSITE BURNER EXEMPTION: **NO** USED OIL PROCESSOR: **NO**
FURNACE EXEMPTION: **NO** USED OIL FUEL MARKETER TO BURNER: **NO**
USED OIL REFINER: **NO** SPECIFICATION USED OIL MARKETER: **NO**
USED OIL TRANSFER FACILITY: **NO** USED OIL TRANSPORTER: **NO**

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS

01/12/2016	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
01/26/1988	FCI FOCUSED COMPLIANCE INSPECTION
02/08/2008	FCI FOCUSED COMPLIANCE INSPECTION
02/09/1989	FCI FOCUSED COMPLIANCE INSPECTION
03/06/1985	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
03/23/1990	FCI FOCUSED COMPLIANCE INSPECTION
04/06/2016	NRR NON-FINANCIAL RECORD REVIEW
04/23/1992	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
04/24/1991	NRR NON-FINANCIAL RECORD REVIEW
05/05/2005	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/06/1994	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/12/2016	NRR NON-FINANCIAL RECORD REVIEW
05/15/1990	NRR NON-FINANCIAL RECORD REVIEW
06/01/1989	NRR NON-FINANCIAL RECORD REVIEW
06/18/1999	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/24/2003	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
07/13/1994	NRR NON-FINANCIAL RECORD REVIEW
08/13/1999	NRR NON-FINANCIAL RECORD REVIEW

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

08/24/1999	NRR NON-FINANCIAL RECORD REVIEW
10/17/2007	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/23/1998	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/26/1983	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/14/1985	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/23/2004	NRR NON-FINANCIAL RECORD REVIEW
12/04/2003	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
12/20/1994	NRR NON-FINANCIAL RECORD REVIEW

VIOLATIONS

01/12/2016	265.G TSD IS-CLOSURE/POST-CLOSURE
01/12/2016	268.A LDR - GENERAL
01/12/2016	XXS STATE STATUTE OR REGULATION
04/24/1991	XXS STATE STATUTE OR REGULATION
05/05/2005	262.A GENERATORS - GENERAL
05/05/2005	262.C GENERATORS - PRE-TRANSPORT
05/05/2005	265.D TSD IS-CONTINGENCY PLAN AND EMERGENCY PROCEDURES
05/05/2005	279.C USED OIL - GENERATORS
05/05/2005	XXS STATE STATUTE OR REGULATION
05/06/1994	262.A GENERATORS - GENERAL
05/06/1994	XXS STATE STATUTE OR REGULATION
05/15/1990	XXS STATE STATUTE OR REGULATION
06/01/1989	268.A LDR - GENERAL
06/18/1999	262.A GENERATORS - GENERAL
06/18/1999	XXS STATE STATUTE OR REGULATION
06/24/2003	262.A GENERATORS - GENERAL
06/24/2003	262.B GENERATORS - MANIFEST
06/24/2003	268.A LDR - GENERAL
06/24/2003	XXS STATE STATUTE OR REGULATION
08/13/1999	262.A GENERATORS - GENERAL
08/24/1999	262.A GENERATORS - GENERAL
08/24/1999	XXS STATE STATUTE OR REGULATION
10/23/1998	262.A GENERATORS - GENERAL
10/23/1998	XXS STATE STATUTE OR REGULATION
10/26/1983	264.A TSD - GENERAL
10/26/1983	264.G TSD - CLOSURE/POST-CLOSURE
10/26/1983	264.H TSD - FINANCIAL REQUIREMENTS
10/26/1983	265.F TSD IS-GROUND-WATER MONITORING
11/14/1985	XXS STATE STATUTE OR REGULATION

ENFORCEMENTS

03/06/1985	110 VERBAL INFORMAL
03/11/2016	110 VERBAL INFORMAL
03/11/2016	120 WRITTEN INFORMAL
04/02/1986	210 INITIAL 3008(A) COMPLIANCE
04/25/1991	110 VERBAL INFORMAL

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

05/05/2005	110	VERBAL INFORMAL
05/24/1994	120	WRITTEN INFORMAL
06/14/1990	110	VERBAL INFORMAL
06/18/1999	110	VERBAL INFORMAL
06/19/1989	120	WRITTEN INFORMAL
06/24/2003	110	VERBAL INFORMAL
07/19/1999	120	WRITTEN INFORMAL
08/13/1999	110	VERBAL INFORMAL
08/24/1999	110	VERBAL INFORMAL
08/29/2003	120	WRITTEN INFORMAL
09/23/1986	310	FINAL 3008(A) COMPLIANCE ORDER
11/16/1998	110	VERBAL INFORMAL
11/16/1998	120	WRITTEN INFORMAL

HAZARDOUS WASTE

D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
K062	SPENT PICKLE LIQUOR FROM STEEL FINISHING OPERATIONS OF PLANTS THAT PRODUCE IRON OR STEEL.

UNIVERSAL WASTE

WASTE TYPE:	ACCUMULATED WASTE ON-SITE:	GENERATED WASTE ON-SITE:	SOURCE TYPE:
BATTERIES	NO	NO	ANNUAL/BIENNIAL REPORT
BATTERIES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
LAMPS	NO	NO	ANNUAL/BIENNIAL REPORT
LAMPS	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
PESTICIDES	NO	NO	ANNUAL/BIENNIAL REPORT
PESTICIDES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	NO	NO	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT

CORRECTIVE ACTION AREA (RELEASE)

AREA NAME:	AIR:	GROUNDWATER:	SOIL:	SURFACE WASTE:
ENTIRE FACILITY	----	----	----	----

CORRECTIVE ACTION EVENT

CA EVENT CODE: CA800YE

EVENT DESCRIPTION: READY FOR ANTICIPATED USE DETERMINATION - READY FOR ANTICIPATED USE

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

ACTUAL DATE OF EVENT: 02/25/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA999
EVENT DESCRIPTION: CA PROCESS IS TERMINATED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 02/25/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA400
EVENT DESCRIPTION: REMEDY DECISION
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA550RC
EVENT DESCRIPTION: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA725YE
EVENT DESCRIPTION: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA750YE
EVENT DESCRIPTION: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA075ME

EVENT DESCRIPTION: CA PRIORITIZATION-MEDIUM CA PRIORITY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 02/24/1992

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA070NO

EVENT DESCRIPTION: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NOT NECESSARY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 04/15/1990

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA050

EVENT DESCRIPTION: RFA COMPLETED

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 04/05/1990

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

[Back to Report Summary](#)

Resource Conservation & Recovery Act - Subject to Corrective Action Facilities (RCRASUBC)

MAP ID# 8

Distance from Property: 0.371 mi. (1,959 ft.) WSW
Elevation: 517 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD005966452

NAME: AZZ GALVANIZING HURST

ADDRESS: 625 W HURST BLVD
HURST, TX 76053-7603

CONTACT NAME: JOSH HONZA

CONTACT ADDRESS: 645 W HURST BLVD
HURST TX 76053-7603

CONTACT PHONE: 817-268-2414

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/18/2019

OWNER TYPE: PRIVATE

OWNER NAME: AZZ INCORPORATED

OPERATOR TYPE: PRIVATE

OPERATOR NAME: AZZ INCORPORATED

CERTIFICATION

CERTIFICATION NAME:	CERTIFICATION TITLE:	CERTIFICATION SIGNED DATE:
SEAN ELGAN	AUTHORIZED COMPANY AGENT	03/01/2010
GORDON BRIGGS	AUTHORIZED COMPANY AGENT	03/01/2012
TIM PENDLEY	GENERAL MANAGER	09/22/1992
GORDON BRIGGS	AUTHORIZED COMPANY AGENT	03/01/2014
TIM E PENDLEY	GENERAL MANAGER	01/24/1994
JOSH WILLIAMS	AUTHORIZED COMPANY AGENT	03/01/2016
JOSH HONZA	AUTHORIZED COMPANY AGENT	03/01/2018
GORDON BRIGGS	UNKNOWN	03/29/2005
RICK WOOD	AUTHORIZED AGNT	01/25/1998
GORDON BRIGGS	AUTHORIZED COMP	01/25/2000
GORDON BRIGGS	UNKNOWN	11/29/2005
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2002
GORDON BRIGGS	UNKNOWN	02/08/2006
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2004
GORDON BRIGGS	UNKNOWN	06/02/2006
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2006
SEAN ELGAN	AUTHORIZEDAGENT	03/01/2008
SEAN ELGAN	SR PROCESS ENGI	03/08/2007
SEAN ELGAN	SR PROCESS ENGI	03/22/2007
SEAN HALSTEAD	SR PROCESS ENGI	08/12/2008
SEAN HALSTEAD	SR PROCESS ENGI	09/16/2008
SEAN HALSTEAD	SR PROCESS ENGI	11/18/2008
SEAN HALSTEAD	SR PROCESS ENGI	06/09/2009
SEAN ELGAN	PLANT MANAGER	03/16/2010
GORDON BRIGGS	ENV MGR	11/04/2011
GORDON BRIGGS	PLANT MANAGER	11/29/2012
GORDON BRIGGS	PLANT MANAGER	05/29/2014
GORDON BRIGGS	PLANT MANAGER	10/09/2014
JIM MASON	VICE PRESIDENT	04/29/2008
DAVID WEST	CONTACT	05/13/2014

Resource Conservation & Recovery Act - Subject to Corrective Action Facilities (RCRASUBC)

DAVID WEST	CONTACT	05/18/2015
JOSH WILLIAMS	PLANT MANAGER	07/05/2017
JOSH HONZA	PLANT MANAGER	11/27/2017
JOSH HONZA	PLANT MANAGER	05/22/2018
JOSH HONZA	PLANT MANAGER	03/18/2019

INDUSTRY CLASSIFICATION (NAICS)

332812 - METAL COATING, ENGRAVING (EXCEPT JEWELRY AND SILVERWARE), AND ALLIED SERVICES TO MANUFACTURERS

33991 - JEWELRY AND SILVERWARE MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: **LARGE QUANTITY GENERATOR** LAST UPDATED DATE: **04/02/2019**
 SUBJECT TO CORRECTIVE ACTION UNIVERSE: **YES**
 TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: **NO**
 TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: **YES**
 NON TDSFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: **NO**
 CORRECTIVE ACTION WORKLOAD UNIVERSE: **NO**

IMPORTER: NO	UNDERGROUND INJECTION: NO
MIXED WASTE GENERATOR: NO	UNIVERSAL WASTE DESTINATION FACILITY: NO
RECYCLER: NO	TRANSFER FACILITY: NO
TRANSPORTER: NO	USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO	USED OIL PROCESSOR: NO
FURNACE EXEMPTION: NO	USED OIL FUEL MARKETER TO BURNER: NO
USED OIL REFINER: NO	SPECIFICATION USED OIL MARKETER: NO
USED OIL TRANSFER FACILITY: NO	USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS

01/12/2016	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
01/26/1988	FCI FOCUSED COMPLIANCE INSPECTION
02/08/2008	FCI FOCUSED COMPLIANCE INSPECTION
02/09/1989	FCI FOCUSED COMPLIANCE INSPECTION
03/06/1985	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
03/23/1990	FCI FOCUSED COMPLIANCE INSPECTION
04/06/2016	NRR NON-FINANCIAL RECORD REVIEW
04/23/1992	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
04/24/1991	NRR NON-FINANCIAL RECORD REVIEW
05/05/2005	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/06/1994	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/12/2016	NRR NON-FINANCIAL RECORD REVIEW
05/15/1990	NRR NON-FINANCIAL RECORD REVIEW
06/01/1989	NRR NON-FINANCIAL RECORD REVIEW
06/18/1999	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/24/2003	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
07/13/1994	NRR NON-FINANCIAL RECORD REVIEW
08/13/1999	NRR NON-FINANCIAL RECORD REVIEW

Resource Conservation & Recovery Act - Subject to Corrective Action Facilities (RCRASUBC)

08/24/1999	NRR NON-FINANCIAL RECORD REVIEW
10/17/2007	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/23/1998	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/26/1983	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/14/1985	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/23/2004	NRR NON-FINANCIAL RECORD REVIEW
12/04/2003	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
12/20/1994	NRR NON-FINANCIAL RECORD REVIEW

VIOLATIONS

01/12/2016	265.G TSD IS-CLOSURE/POST-CLOSURE
01/12/2016	268.A LDR - GENERAL
01/12/2016	XXS STATE STATUTE OR REGULATION
04/24/1991	XXS STATE STATUTE OR REGULATION
05/05/2005	262.A GENERATORS - GENERAL
05/05/2005	262.C GENERATORS - PRE-TRANSPORT
05/05/2005	265.D TSD IS-CONTINGENCY PLAN AND EMERGENCY PROCEDURES
05/05/2005	279.C USED OIL - GENERATORS
05/05/2005	XXS STATE STATUTE OR REGULATION
05/06/1994	262.A GENERATORS - GENERAL
05/06/1994	XXS STATE STATUTE OR REGULATION
05/15/1990	XXS STATE STATUTE OR REGULATION
06/01/1989	268.A LDR - GENERAL
06/18/1999	262.A GENERATORS - GENERAL
06/18/1999	XXS STATE STATUTE OR REGULATION
06/24/2003	262.A GENERATORS - GENERAL
06/24/2003	262.B GENERATORS - MANIFEST
06/24/2003	268.A LDR - GENERAL
06/24/2003	XXS STATE STATUTE OR REGULATION
08/13/1999	262.A GENERATORS - GENERAL
08/24/1999	262.A GENERATORS - GENERAL
08/24/1999	XXS STATE STATUTE OR REGULATION
10/23/1998	262.A GENERATORS - GENERAL
10/23/1998	XXS STATE STATUTE OR REGULATION
10/26/1983	264.A TSD - GENERAL
10/26/1983	264.G TSD - CLOSURE/POST-CLOSURE
10/26/1983	264.H TSD - FINANCIAL REQUIREMENTS
10/26/1983	265.F TSD IS-GROUND-WATER MONITORING
11/14/1985	XXS STATE STATUTE OR REGULATION

ENFORCEMENTS

03/06/1985	110 VERBAL INFORMAL
03/11/2016	110 VERBAL INFORMAL
03/11/2016	120 WRITTEN INFORMAL
04/02/1986	210 INITIAL 3008(A) COMPLIANCE
04/25/1991	110 VERBAL INFORMAL

Resource Conservation & Recovery Act - Subject to Corrective Action Facilities (RCRASUBC)

05/05/2005	110	VERBAL INFORMAL
05/24/1994	120	WRITTEN INFORMAL
06/14/1990	110	VERBAL INFORMAL
06/18/1999	110	VERBAL INFORMAL
06/19/1989	120	WRITTEN INFORMAL
06/24/2003	110	VERBAL INFORMAL
07/19/1999	120	WRITTEN INFORMAL
08/13/1999	110	VERBAL INFORMAL
08/24/1999	110	VERBAL INFORMAL
08/29/2003	120	WRITTEN INFORMAL
09/23/1986	310	FINAL 3008(A) COMPLIANCE ORDER
11/16/1998	110	VERBAL INFORMAL
11/16/1998	120	WRITTEN INFORMAL

HAZARDOUS WASTE

D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
K062	SPENT PICKLE LIQUOR FROM STEEL FINISHING OPERATIONS OF PLANTS THAT PRODUCE IRON OR STEEL.

UNIVERSAL WASTE

WASTE TYPE:	ACCUMULATED WASTE ON-SITE:	GENERATED WASTE ON-SITE:	SOURCE TYPE:
BATTERIES	NO	NO	ANNUAL/BIENNIAL REPORT
BATTERIES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
LAMPS	NO	NO	ANNUAL/BIENNIAL REPORT
LAMPS	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
PESTICIDES	NO	NO	ANNUAL/BIENNIAL REPORT
PESTICIDES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	NO	NO	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT

CORRECTIVE ACTION AREA (RELEASE)

AREA NAME:	AIR:	GROUNDWATER:	SOIL:	SURFACE WASTE:
ENTIRE FACILITY	----	----	----	----

CORRECTIVE ACTION EVENT

CA EVENT CODE: CA800YE

EVENT DESCRIPTION: READY FOR ANTICIPATED USE DETERMINATION - READY FOR ANTICIPATED USE

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

Resource Conservation & Recovery Act - Subject to Corrective Action Facilities (RCRASUBC)

ACTUAL DATE OF EVENT: 02/25/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA999
EVENT DESCRIPTION: CA PROCESS IS TERMINATED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 02/25/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA400
EVENT DESCRIPTION: REMEDY DECISION
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA550RC
EVENT DESCRIPTION: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA725YE
EVENT DESCRIPTION: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA750YE
EVENT DESCRIPTION: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

Resource Conservation & Recovery Act - Subject to Corrective Action Facilities (RCRASUBC)

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA075ME

EVENT DESCRIPTION: CA PRIORITIZATION-MEDIUM CA PRIORITY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 02/24/1992

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA070NO

EVENT DESCRIPTION: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NOT NECESSARY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 04/15/1990

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA050

EVENT DESCRIPTION: RFA COMPLETED

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 04/05/1990

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

[Back to Report Summary](#)

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities (RCRAT)

MAP ID# 8

Distance from Property: 0.371 mi. (1,959 ft.) WSW
Elevation: 517 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD005966452

NAME: AZZ GALVANIZING HURST

ADDRESS: 625 W HURST BLVD
HURST, TX 76053-7603

CONTACT NAME: JOSH HONZA

CONTACT ADDRESS: 645 W HURST BLVD
HURST TX 76053-7603

CONTACT PHONE: 817-268-2414

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/18/2019

OWNER TYPE: PRIVATE

OWNER NAME: AZZ INCORPORATED

OPERATOR TYPE: PRIVATE

OPERATOR NAME: AZZ INCORPORATED

CERTIFICATION

CERTIFICATION NAME:	CERTIFICATION TITLE:	CERTIFICATION SIGNED DATE:
SEAN ELGAN	AUTHORIZED COMPANY AGENT	03/01/2010
GORDON BRIGGS	AUTHORIZED COMPANY AGENT	03/01/2012
TIM PENDLEY	GENERAL MANAGER	09/22/1992
GORDON BRIGGS	AUTHORIZED COMPANY AGENT	03/01/2014
TIM E PENDLEY	GENERAL MANAGER	01/24/1994
JOSH WILLIAMS	AUTHORIZED COMPANY AGENT	03/01/2016
JOSH HONZA	AUTHORIZED COMPANY AGENT	03/01/2018
GORDON BRIGGS	UNKNOWN	03/29/2005
RICK WOOD	AUTHORIZED AGNT	01/25/1998
GORDON BRIGGS	AUTHORIZED COMP	01/25/2000
GORDON BRIGGS	UNKNOWN	11/29/2005
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2002
GORDON BRIGGS	UNKNOWN	02/08/2006
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2004
GORDON BRIGGS	UNKNOWN	06/02/2006
GORDON BRIGGS	AUTHORIZEDAGENT	03/01/2006
SEAN ELGAN	AUTHORIZEDAGENT	03/01/2008
SEAN ELGAN	SR PROCESS ENGI	03/08/2007
SEAN ELGAN	SR PROCESS ENGI	03/22/2007
SEAN HALSTEAD	SR PROCESS ENGI	08/12/2008
SEAN HALSTEAD	SR PROCESS ENGI	09/16/2008
SEAN HALSTEAD	SR PROCESS ENGI	11/18/2008
SEAN HALSTEAD	SR PROCESS ENGI	06/09/2009
SEAN ELGAN	PLANT MANAGER	03/16/2010
GORDON BRIGGS	ENV MGR	11/04/2011
GORDON BRIGGS	PLANT MANAGER	11/29/2012
GORDON BRIGGS	PLANT MANAGER	05/29/2014
GORDON BRIGGS	PLANT MANAGER	10/09/2014
JIM MASON	VICE PRESIDENT	04/29/2008
DAVID WEST	CONTACT	05/13/2014

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities (RCRAT)

DAVID WEST	CONTACT	05/18/2015
JOSH WILLIAMS	PLANT MANAGER	07/05/2017
JOSH HONZA	PLANT MANAGER	11/27/2017
JOSH HONZA	PLANT MANAGER	05/22/2018
JOSH HONZA	PLANT MANAGER	03/18/2019

INDUSTRY CLASSIFICATION (NAICS)

332812 - METAL COATING, ENGRAVING (EXCEPT JEWELRY AND SILVERWARE), AND ALLIED SERVICES TO MANUFACTURERS

33991 - JEWELRY AND SILVERWARE MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: **LARGE QUANTITY GENERATOR** LAST UPDATED DATE: **04/02/2019**

SUBJECT TO CORRECTIVE ACTION UNIVERSE: **YES**

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: **NO**

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: **YES**

NON TDSFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: **NO**

CORRECTIVE ACTION WORKLOAD UNIVERSE: **NO**

IMPORTER: **NO**

UNDERGROUND INJECTION: **NO**

MIXED WASTE GENERATOR: **NO**

UNIVERSAL WASTE DESTINATION FACILITY: **NO**

RECYCLER: **NO**

TRANSFER FACILITY: **NO**

TRANSPORTER: **NO**

USED OIL FUEL BURNER: **NO**

ONSITE BURNER EXEMPTION: **NO**

USED OIL PROCESSOR: **NO**

FURNACE EXEMPTION: **NO**

USED OIL FUEL MARKETER TO BURNER: **NO**

USED OIL REFINER: **NO**

SPECIFICATION USED OIL MARKETER: **NO**

USED OIL TRANSFER FACILITY: **NO**

USED OIL TRANSPORTER: **NO**

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS

01/12/2016	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
01/26/1988	FCI FOCUSED COMPLIANCE INSPECTION
02/08/2008	FCI FOCUSED COMPLIANCE INSPECTION
02/09/1989	FCI FOCUSED COMPLIANCE INSPECTION
03/06/1985	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
03/23/1990	FCI FOCUSED COMPLIANCE INSPECTION
04/06/2016	NRR NON-FINANCIAL RECORD REVIEW
04/23/1992	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
04/24/1991	NRR NON-FINANCIAL RECORD REVIEW
05/05/2005	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/06/1994	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/12/2016	NRR NON-FINANCIAL RECORD REVIEW
05/15/1990	NRR NON-FINANCIAL RECORD REVIEW
06/01/1989	NRR NON-FINANCIAL RECORD REVIEW
06/18/1999	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/24/2003	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
07/13/1994	NRR NON-FINANCIAL RECORD REVIEW
08/13/1999	NRR NON-FINANCIAL RECORD REVIEW

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities (RCRAT)

08/24/1999	NRR NON-FINANCIAL RECORD REVIEW
10/17/2007	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/23/1998	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
10/26/1983	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/14/1985	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/23/2004	NRR NON-FINANCIAL RECORD REVIEW
12/04/2003	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
12/20/1994	NRR NON-FINANCIAL RECORD REVIEW

VIOLATIONS

01/12/2016	265.G TSD IS-CLOSURE/POST-CLOSURE
01/12/2016	268.A LDR - GENERAL
01/12/2016	XXS STATE STATUTE OR REGULATION
04/24/1991	XXS STATE STATUTE OR REGULATION
05/05/2005	262.A GENERATORS - GENERAL
05/05/2005	262.C GENERATORS - PRE-TRANSPORT
05/05/2005	265.D TSD IS-CONTINGENCY PLAN AND EMERGENCY PROCEDURES
05/05/2005	279.C USED OIL - GENERATORS
05/05/2005	XXS STATE STATUTE OR REGULATION
05/06/1994	262.A GENERATORS - GENERAL
05/06/1994	XXS STATE STATUTE OR REGULATION
05/15/1990	XXS STATE STATUTE OR REGULATION
06/01/1989	268.A LDR - GENERAL
06/18/1999	262.A GENERATORS - GENERAL
06/18/1999	XXS STATE STATUTE OR REGULATION
06/24/2003	262.A GENERATORS - GENERAL
06/24/2003	262.B GENERATORS - MANIFEST
06/24/2003	268.A LDR - GENERAL
06/24/2003	XXS STATE STATUTE OR REGULATION
08/13/1999	262.A GENERATORS - GENERAL
08/24/1999	262.A GENERATORS - GENERAL
08/24/1999	XXS STATE STATUTE OR REGULATION
10/23/1998	262.A GENERATORS - GENERAL
10/23/1998	XXS STATE STATUTE OR REGULATION
10/26/1983	264.A TSD - GENERAL
10/26/1983	264.G TSD - CLOSURE/POST-CLOSURE
10/26/1983	264.H TSD - FINANCIAL REQUIREMENTS
10/26/1983	265.F TSD IS-GROUND-WATER MONITORING
11/14/1985	XXS STATE STATUTE OR REGULATION

ENFORCEMENTS

03/06/1985	110 VERBAL INFORMAL
03/11/2016	110 VERBAL INFORMAL
03/11/2016	120 WRITTEN INFORMAL
04/02/1986	210 INITIAL 3008(A) COMPLIANCE
04/25/1991	110 VERBAL INFORMAL

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities (RCRAT)

05/05/2005	110	VERBAL INFORMAL
05/24/1994	120	WRITTEN INFORMAL
06/14/1990	110	VERBAL INFORMAL
06/18/1999	110	VERBAL INFORMAL
06/19/1989	120	WRITTEN INFORMAL
06/24/2003	110	VERBAL INFORMAL
07/19/1999	120	WRITTEN INFORMAL
08/13/1999	110	VERBAL INFORMAL
08/24/1999	110	VERBAL INFORMAL
08/29/2003	120	WRITTEN INFORMAL
09/23/1986	310	FINAL 3008(A) COMPLIANCE ORDER
11/16/1998	110	VERBAL INFORMAL
11/16/1998	120	WRITTEN INFORMAL

HAZARDOUS WASTE

D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
K062	SPENT PICKLE LIQUOR FROM STEEL FINISHING OPERATIONS OF PLANTS THAT PRODUCE IRON OR STEEL.

UNIVERSAL WASTE

WASTE TYPE:	ACCUMULATED WASTE ON-SITE:	GENERATED WASTE ON-SITE:	SOURCE TYPE:
BATTERIES	NO	NO	ANNUAL/BIENNIAL REPORT
BATTERIES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
LAMPS	NO	NO	ANNUAL/BIENNIAL REPORT
LAMPS	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
PESTICIDES	NO	NO	ANNUAL/BIENNIAL REPORT
PESTICIDES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	NO	NO	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT

CORRECTIVE ACTION AREA (RELEASE)

AREA NAME:	AIR:	GROUNDWATER:	SOIL:	SURFACE WASTE:
ENTIRE FACILITY	----	----	----	----

CORRECTIVE ACTION EVENT

CA EVENT CODE: CA800YE

EVENT DESCRIPTION: READY FOR ANTICIPATED USE DETERMINATION - READY FOR ANTICIPATED USE

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities (RCRAT)

ACTUAL DATE OF EVENT: 02/25/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA999
EVENT DESCRIPTION: CA PROCESS IS TERMINATED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 02/25/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA400
EVENT DESCRIPTION: REMEDY DECISION
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA550RC
EVENT DESCRIPTION: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA725YE
EVENT DESCRIPTION: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA750YE
EVENT DESCRIPTION: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/08/2009
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities (RCRAT)

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA075ME

EVENT DESCRIPTION: CA PRIORITIZATION-MEDIUM CA PRIORITY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 02/24/1992

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA070NO

EVENT DESCRIPTION: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NOT NECESSARY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 04/15/1990

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA050

EVENT DESCRIPTION: RFA COMPLETED

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 04/05/1990

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

[Back to Report Summary](#)

Superfund Enterprise Management System Archived Site Inventory (SEMSARCH)

MAP ID# 8

Distance from Property: 0.371 mi. (1,959 ft.) WSW

Elevation: 517 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD005966452

SITE ID#: 0601629

NAME: BOYLES GALVANIZING CO

ADDRESS: 625 W HURST BLVD
HURST, TX 76053

COUNTY: TARRANT

FEDERAL FACILITY: NOT A FEDERAL FACILITY

NPL: NOT ON THE NPL

NON NPL STATUS: NFRAP-SITE DOES NOT QUALIFY FOR THE NPL BASED ON EXISTING INFORMATION

SUPERFUND SITE INFORMATION: [CLICK HERE](#)

Below information was gathered from the prior NFRAP update completed in 10/2013 update:

<u>ACTION</u>	<u>START DATE</u>	<u>COMPLETION DATE</u>	<u>RESPONSIBILITY</u>
SI - SITE INSPECTION	3/8/1994	7/13/1995	STATE (FUND)
PA - PRELIMINARY ASSESSMENT	3/1/1983	3/1/1983	EPA FUND
DS - DISCOVERY	NOT REPORTED	5/1/1982	EPA FUND
VS - ARCHIVE SITE	NOT REPORTED	7/13/1995	EPA IN-HOUSE

ACTION DESCRIPTIONS

SI - (SITE INSPECTION) - THE PROCESS OF COLLECTING SITE DATA AND SAMPLES TO CHARACTERIZE THE SEVERITY OF THE HAZARD FOR THE HAZARD RANKING SCORE AND/OR ENFORCEMENT SUPPORT.

PA - (PRELIMINARY ASSESSMENT) - COLLECTION OF DIVERSE EXISTING INFORMATION ABOUT THE SOURCE AND NATURE OF THE SITE HAZARD. IT IS EPA POLICY TO COMPLETE THE PRELIMINARY ASSESSMENT WITHIN ONE YEAR OF SITE DISCOVERY.

DS - (DISCOVERY) - THE PROCESS BY WHICH A POTENTIAL HAZARDOUS WASTE SITE IS BROUGHT TO THE ATTENTION OF THE EPA. THE PROCESS CAN OCCUR THROUGH THE USE OF SEVERAL MECHANISMS SUCH AS A PHONE CALL OR REFERRAL BY ANOTHER GOVERNMENT AGENCY.

VS - (ARCHIVE SITE) - THE DECISION IS MADE THAT NO FURTHER ACTIVITY IS PLANNED AT THE SITE.

[Back to Report Summary](#)

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

MAP ID# 9

Distance from Property: 0.455 mi. (2,402 ft.) W
Elevation: 529 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD008017824

NAME: ANADITE INC

ADDRESS: 711 W HURST BLVD
HURST, TX 76053

CONTACT NAME: BILL CURTIS

CONTACT ADDRESS: PO BOX 1608
HURST TX 76053

CONTACT PHONE: 817-282-9171

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

OWNER TYPE: PRIVATE

OWNER NAME: ANADITE INC

OPERATOR TYPE: PRIVATE

OPERATOR NAME: ANADITE INC

CERTIFICATION

CERTIFICATION NAME:

CERTIFICATION TITLE:

CERTIFICATION SIGNED DATE:

TRAVIS W SCHULTE

ENV ENGINEER

01/24/1994

INDUSTRY CLASSIFICATION (NAICS)

331316 - ALUMINUM EXTRUDED PRODUCT MANUFACTURING

332321 - METAL WINDOW AND DOOR MANUFACTURING

332999 - ALL OTHER MISCELLANEOUS FABRICATED METAL PRODUCT MANUFACTURING

33991 - JEWELRY AND SILVERWARE MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TDSFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO

UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO

UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO

TRANSFER FACILITY: NO

TRANSPORTER: NO

USED OIL FUEL BURNER: NO

ONSITE BURNER EXEMPTION: NO

USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO

USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS

03/03/1993 CDI CASE DEVELOPMENT INSPECTION

03/03/1993 FCI FOCUSED COMPLIANCE INSPECTION

03/18/1992 NRR NON-FINANCIAL RECORD REVIEW

04/01/1993 NRR NON-FINANCIAL RECORD REVIEW

04/11/1994 FCI FOCUSED COMPLIANCE INSPECTION

05/21/1985 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

05/22/1987	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/07/1995	CDI CASE DEVELOPMENT INSPECTION
06/07/1995	SNN NOT A SIGNIFICANT NON-COMPLIER
06/13/1988	NRR NON-FINANCIAL RECORD REVIEW
08/17/1994	NRR NON-FINANCIAL RECORD REVIEW
10/05/1987	CSE COMPLIANCE SCHEDULE EVALUATION
10/07/1992	NRR NON-FINANCIAL RECORD REVIEW
10/25/1988	FCI FOCUSED COMPLIANCE INSPECTION
10/28/1987	FCI FOCUSED COMPLIANCE INSPECTION
11/09/1992	FCI FOCUSED COMPLIANCE INSPECTION
11/09/1992	SNY SIGNIFICANT NON-COMPLIER

VIOLATIONS

03/03/1993	262.A GENERATORS - GENERAL
03/18/1992	XXS STATE STATUTE OR REGULATION
05/22/1987	262.A GENERATORS - GENERAL
10/07/1992	XXS STATE STATUTE OR REGULATION
10/28/1987	262.A GENERATORS - GENERAL
11/09/1992	262.A GENERATORS - GENERAL
11/09/1992	264.A TSD - GENERAL
11/09/1992	XXS STATE STATUTE OR REGULATION

ENFORCEMENTS

02/04/1993	141 NOT REPORTED
03/05/1993	120 WRITTEN INFORMAL
03/10/1988	120 WRITTEN INFORMAL
03/18/1992	110 VERBAL INFORMAL
05/13/1993	141 NOT REPORTED
06/10/1987	110 VERBAL INFORMAL
07/22/1993	210 INITIAL 3008(A) COMPLIANCE
07/27/1995	141 NOT REPORTED
10/07/1992	120 WRITTEN INFORMAL
10/20/1993	146 NOT REPORTED

HAZARDOUS WASTE

D001	IGNITABLE WASTE
D002	CORROSIVE WASTE
D006	CADMIUM
D007	CHROMIUM
D035	METHYL ETHYL KETONE
D039	TETRACHLOROETHYLENE
F001	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F019 WASTEWATER TREATMENT SLUDGES FROM THE CHEMICAL CONVERSION COATING OF ALUMINUM EXCEPT FROM ZIRCONIUM PHOSPHATING IN ALUMINUM CAN WASHING WHEN SUCH PHOSPHATING IS AN EXCLUSIVE CONVERSION COATING PROCESS.

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA (RELEASE)

AREA NAME:	AIR:	GROUNDWATER:	SOIL:	SURFACE WASTE:
ENTIRE FACILITY	----	----	----	----

CORRECTIVE ACTION EVENT

CA EVENT CODE: CA075ME
EVENT DESCRIPTION: CA PRIORITIZATION-MEDIUM CA PRIORITY
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: EPA
ACTUAL DATE OF EVENT: 06/28/1996
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

[Back to Report Summary](#)

Superfund Enterprise Management System Archived Site Inventory (SEMSARCH)

MAP ID# 9

Distance from Property: 0.455 mi. (2,402 ft.) W

Elevation: 529 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD008017824

SITE ID#: 0605085

NAME: ANADITE METAL FINISHING

ADDRESS: 711 WEST HURST STREET
HURST, TX 76053

COUNTY: TARRANT

FEDERAL FACILITY: NOT A FEDERAL FACILITY

NPL: NOT ON THE NPL

NON NPL STATUS: NFRAP-SITE DOES NOT QUALIFY FOR THE NPL BASED ON EXISTING INFORMATION

SUPERFUND SITE INFORMATION: [CLICK HERE](#)

[Back to Report Summary](#)

Voluntary Cleanup Program Sites (VCP)

MAP ID# 9

Distance from Property: 0.455 mi. (2,402 ft.) W
Elevation: 529 ft. (Lower than TP)

FACILITY INFORMATION

PROGRAM ID#: 0471

NAME: ANADITE, INC.

ADDRESS: 711 W HURST BLVD
HURST TX 76053

ADDRESS DESCRIPTION: 711 WEST HURST BOULEVARD

ASSOCIATED VCP ID(s): 823; 471

PCA NUMBER: 38381

PROJECT NUMBER: 313810

LEGAL ID: 1000382

REGULATED ENTITY REFERENCE NUMBER (RN): RN100637248

CURRENT FACILITY TYPE: MFG CHEMICAL

FORMER FACILITY TYPE: NOT REPORTED

PROJECT MANAGER: MERSMITH

PROJECT PHASE: WITHDRAWN

ADMINISTRATIVE STATUS: INACTIVE

CASHIER RECEIVED DATE: 02/19/1997

APPLICATION RECEIVED DATE: 02/19/1997

APPLICATION ACCEPTANCE DATE: 03/20/1997

VCP APPLICATION ACCEPTED: Y

AGREEMENT ACCEPTANCE DATE: NOT REPORTED

REGION NOTIFIED OF APPLICATION: 02/19/1997

TCEQ REGION NAME: REGION 04 - DFW METROPLEX

SWR NUMBER: NOT REPORTED

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: METALS

SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: METALS

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE_RES_CRITICAL_PCL: NOT REPORTED

ABOVE_RES_CRITICAL_PCL_OFFSITE: NOT REPORTED

LPST NO: NOT REPORTED

IOP ID: NOT REPORTED

EPA CERCLIS #: NOT REPORTED

EPA RCRIS #: NOT REPORTED

FILE MEDIA: PAPER

FILE LOCATION: 200-36/D (IN ANTHONY MCGLOWN'S OFFICE WITH VCP 823)

SITE SIZE: 4.3

Voluntary Cleanup Program Sites (VCP)

TYPE OF REMEDY: **NOT REPORTED**

AIR REMEDIATION METHOD: **NOT REPORTED**

GROUNDWATER REMEDIATION METHOD: **NOT REPORTED**

SOIL REMEDIATION METHOD: **NOT REPORTED**

SURFACE WATER REMEDIATION METHOD: **NOT REPORTED**

AIR INSTITUTIONAL/ENGINEERING CONTROLS: **NOT REPORTED**

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: **NOT REPORTED**

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: **NOT REPORTED**

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: **NOT REPORTED**

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: **NOT REPORTED**

CERTIFICATE OF COMPLETION DATE: **NOT REPORTED**

CONDITIONAL CERTIFICATE OF COMPLETION DATE: **NOT REPORTED**

APPLICABLE PROGRAM RULES: **NOT REPORTED**

APPLICABLE STANDARDS: **NOT REPORTED**

APPLICABLE TRRP TIER: **NOT REPORTED**

AFFILIATED CUSTOMER(S)

CN NUMBER: **CN601589336**

RN NUMBER: **RN100637248**

CUSTOMER NAME: **DELFASCO INC**

ROLE CD: **BILLCONT**

CONTACT NAME: **JUDWAY, JOHN**

CONTACT TITLE: **NOT REPORTED**

ORGANIZATION NAME: **DELFASCO FORGE DIVISION**

MAILING ADDRESS: **PO BOX 10527**

MAILING CITY NAME: **WILMINGTON**

MAILING STATE: **DE**

MAILING ZIPCODE: **19850**

CONTACT PHONE: **(302) 328-6675**

[Back to Report Summary](#)

Voluntary Cleanup Program Sites (VCP)

MAP ID# 9

Distance from Property: 0.455 mi. (2,402 ft.) W
Elevation: 529 ft. (Lower than TP)

FACILITY INFORMATION

PROGRAM ID#: 0823

NAME: ANADITE MANUFACTURING FACILITY

ADDRESS: 711 W HURST BLVD
HURST TX 76053

ADDRESS DESCRIPTION: 711 WEST HURST BOULEVARD

ASSOCIATED VCP ID(s): 471; 823

PCA NUMBER: 31733

PROJECT NUMBER: 317330

LEGAL ID: 1000734

REGULATED ENTITY REFERENCE NUMBER (RN): RN100637248

CURRENT FACILITY TYPE: MFG

FORMER FACILITY TYPE: MFG AIRCRAFT

PROJECT MANAGER: AHUGHES

PROJECT PHASE: CONDITIONAL

ADMINISTRATIVE STATUS: ACTIVE

CASHIER RECEIVED DATE: 08/20/1998

APPLICATION RECEIVED DATE: 08/24/1998

APPLICATION ACCEPTANCE DATE: 09/10/1998

VCP APPLICATION ACCEPTED: Y

AGREEMENT ACCEPTANCE DATE: NOT REPORTED

REGION NOTIFIED OF APPLICATION: 08/20/1998

TCEQ REGION NAME: REGION 04 - DFW METROPLEX

SWR NUMBER: NOT REPORTED

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: TPH; CHLORINATED SOLVENTS; VOCs; PCBS; METALS

SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: PCBS; CHLORINATED SOLVENTS; METALS

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE_RES_CRITICAL_PCL: YES

ABOVE_RES_CRITICAL_PCL_OFFSITE: NO

LPST NO: NOT REPORTED

IOP ID: NOT REPORTED

EPA CERCLIS #: TXD008017824

EPA RCRIS #: NOT REPORTED

FILE MEDIA: ELECTRONIC AND PAPER

FILE LOCATION: CFR/D289; 299N, RACK 3, BOXES 97, 98, 99, 100, 101; 299N, RACK 3, BOX 98; 299N, RACK 3, BOX 99; 299N, RACK 3, BOX 100; 299N, RACK 3, BOX 101

Voluntary Cleanup Program Sites (VCP)

SITE SIZE: **6.51**

TYPE OF REMEDY: **NOT REPORTED**

AIR REMEDIATION METHOD: **NA**

GROUNDWATER REMEDIATION METHOD: **NA**

SOIL REMEDIATION METHOD: **FUNCTIONAL CAP; EXCAVATION/REMOVAL; ENGINEERED CAP**

SURFACE WATER REMEDIATION METHOD: **NA**

AIR INSTITUTIONAL/ENGINEERING CONTROLS: **VAPOR CONCERNS**

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: **MSD**

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: **NA**

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: **WASTE CONTROL UNIT; PHYSICAL CONTROL**

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: **NA**

CERTIFICATE OF COMPLETION DATE: **NOT REPORTED**

CONDITIONAL CERTIFICATE OF COMPLETION DATE: **09/21/2017**

APPLICABLE PROGRAM RULES: **TRRP**

APPLICABLE STANDARDS: **B**

APPLICABLE TRRP TIER: **1**

AFFILIATED CUSTOMER(S)

CN NUMBER: **CN601541840**

RN NUMBER: **RN100637248**

CUSTOMER NAME: **ANADITE TEXAS RESTORATION TRUST**

ROLE CD: **APPLCONT**

CONTACT NAME: **BAKER, CHRIS**

CONTACT TITLE: **MANAGER**

ORGANIZATION NAME: **HWY 10 INDUSTRIAL LLC**

MAILING ADDRESS: **1612 SUMMIT AVE STE 100**

MAILING CITY NAME: **FORT WORTH**

MAILING STATE: **TX**

MAILING ZIPCODE: **76102**

CONTACT PHONE: **(817) 632-6306**

CN NUMBER: **CN605573278**

RN NUMBER: **RN100637248**

CUSTOMER NAME: **HWY 10 INDUSTRIAL LLC**

ROLE CD: **APPLCONT**

CONTACT NAME: **BAKER, CHRIS**

CONTACT TITLE: **MANAGER**

ORGANIZATION NAME: **HWY 10 INDUSTRIAL LLC**

MAILING ADDRESS: **1612 SUMMIT AVE STE 100**

MAILING CITY NAME: **FORT WORTH**

MAILING STATE: **TX**

MAILING ZIPCODE: **76102**

CONTACT PHONE: **(817) 632-6306**

Voluntary Cleanup Program Sites (VCP)

[Back to Report Summary](#)

Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

[MAP ID# 10](#)

Distance from Property: 0.460 mi. (2,429 ft.) WSW
Elevation: 529 ft. (Lower than TP)

PROGRAM ID: 34659
RN NUMBER: RN100645753
NAME: US GALVANIZING PLANT 1579
ADDRESS: 645 W HURST BLVD
HURST, TX 76053
STATUS: INACTIVE
STATUS DATE: 8/8/2018
PHASE: COMPLETED WORKLOAD
LOCATION DESCRIPTION: 645 W HURST BLVD HURST TX
PHASE STATUS DATE: 8/8/2018
SOIL CHEMICAL OF CONCERN CLASS: NOT REPORTED
SOIL REMEDIATION: NOT REPORTED
GROUNDWATER CHEMICAL OF CONCERN CLASS: NOT REPORTED
GROUNDWATER REMEDIATION: NOT REPORTED

[Back to Report Summary](#)

Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

[MAP ID# 11](#)

Distance from Property: 0.476 mi. (2,513 ft.) WSW
Elevation: 505 ft. (Lower than TP)

PROGRAM ID: 82306

RN NUMBER: RN100578202

NAME: KELLOGG BROWN ROOT

ADDRESS: 3120 S PRECINCT LINE RD
HURST, TX 76053

STATUS: INACTIVE

STATUS DATE: 5/2/2006

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: NOT REPORTED

PHASE STATUS DATE: 5/2/2006

SOIL CHEMICAL OF CONCERN CLASS: NOT REPORTED

SOIL REMEDIATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASS: NOT REPORTED

GROUNDWATER REMEDIATION: NOT REPORTED

[Back to Report Summary](#)

Innocent Owner / Operator Database (IOP)

MAP ID# 11

Distance from Property: 0.476 mi. (2,513 ft.) WSW
Elevation: 505 ft. (Lower than TP)

FACILITY INFORMATION

ID#: 0320
DATE IOP RECIEVED: 9/17/2002
CERTIFICATE ISSUED: NOT REPORTED
NAME: KELLOGG BROWN & ROOT FACILITY
ADDRESS: 3120 S PRECINCT LINE RD
HURST, TX 76053
CONTAMINANTS: VOCS, METALS, CHLORINATED SOLVENTS
MEDIA AFFECTED: GROUNDWATER
PHASE: WITHDRAWN
PROPERTY USE: HYDRATED LIME PROCESSING
ACRES: 25
RN NUMBER: RN100578202
PROGRAM ID:
CURRENT FACILITY TYPE: PROPERTY COMMERCIAL
SITE ADDRESS DESCRIPTION: 3120 S PRECINCT LINE RD HURST TX
NEAR CITY NAME: HURST
ADMINISTRATIVE STATUS: INACTIVE
APPLICATION RECEIVED DATE: NOT REPORTED
IOC DATE: NOT REPORTED
TCEQ REGION NAME: REGION 04 - DFW METROPLEX
GROUNDWATER COCS IN CERTIFICATE: NOT REPORTED
SEDIMENT COCS IN CERTIFICATE: NOT REPORTED
SOIL COCS IN CERTIFICATE: NOT REPORTED

OTHER CONTACTS (CONSULTANT/ATTORNEY)

ORGANIZATION: BROWN AND CALDWELL
RICHARD REXROAD PROJECT MANAGER
1415 LOUISIANA STREET, SUITE 2500
HOUSTON TX 77002
PHONE: 713-646-1129 FAX: 713-308-3886

APPLICANT INFORMATION

ORGANIZATION: KELLOGG-BROWN & ROOT
RICHARD REXROAD, SENIOR ENV
ADDRESS: 4100 CLINTON DRIVE, BLDG 3, RM 1106E
HOUSTON, TX, 77020-6299
INTEREST IN SITE: OWNER
PHONE: (713) 676-7577 FAX: 713-676-5684

[Back to Report Summary](#)

Leaking Petroleum Storage Tanks (LPST)

MAP ID# 11

Distance from Property: 0.476 mi. (2,513 ft.) WSW
Elevation: 505 ft. (Lower than TP)

FACILITY INFORMATION

GEOSEARCH ID: 109730
LPST ID: 109730
FACILITY ID: 62379
NAME: BROWN ROOT HEAVY CIVIL YARD
ADDRESS: 3120 S PRECINCT LINE RD
HURST, TX 76053

Additional TCEQ Documents: [Click Here](#)

LEAKING TANK DETAILS

LPST ID: 109730
NAME: BROWN ROOT HEAVY CIVIL YARD
FACILITY LOCATION: NOT REPORTED
PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS
CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED
CORRECTIVE ACTION START DATE: NOT REPORTED
REPORTED DATE: 07/17/1995
ENTERED DATE: 08/25/1995
CLOSURE DATE: 04/14/1998

PRP INFORMATION

NAME: NOT REPORTED
ADDRESS: ADDRESS NOT REPORTED
HOUSTON TX 77001
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: 1	NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1984	REGISTRATION DATE: 02/04/1992
TANK CAPACITY (GAL): 10000	EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND	STATUS BEGIN DATE: 06/01/1995
INTERNAL PROTECTION DATE: NOT REPORTED	REGULATORY STATUS: FULLY REGULATED
TANK DESIGN SINGLE WALL: YES	TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: YES	PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:
STEEL
CORROSION PROTECTION:
NOT REPORTED
EXTERNAL CONTAINMENT:
NOT REPORTED
TANK COMPLIANCE FLAG
CORROSION PROTECTION COMPLIANCE FLAG: NO

Leaking Petroleum Storage Tanks (LPST)

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **60569**

TANK ID: **1**

COMPARTMENT LETTER: **A**

SUBSTANCES: **DIESEL**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

TANK ID: **2**

NUMBER OF COMPARTMENTS: **1**

INSTALLATION DATE: **06/01/1984**

REGISTRATION DATE: **02/04/1992**

TANK CAPACITY (GAL): **10000**

EMPTY TANK: **NOT EMPTY**

STATUS: **REMOVED FROM GROUND**

STATUS BEGIN DATE: **06/01/1995**

INTERNAL PROTECTION DATE: **NOT REPORTED**

REGULATORY STATUS: **FULLY REGULATED**

TANK DESIGN SINGLE WALL: **YES**

TANK DESIGN DOUBLE WALL: **NO**

PIPE DESIGN SINGLE WALL: **YES**

PIPE DESIGN DOUBLE WALL: **NO**

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

COMPARTMENT DETAILS

UST COMPARTMENT ID: **60568**

TANK ID: **2**

COMPARTMENT LETTER: **A**

SUBSTANCES: **GASOLINE**

OTHER SUBSTANCES: **NOT REPORTED**

CAPACITY (GAL): **10000**

COMPARTMENT RELEASE DETECTION: **NOT REPORTED**

SPILL CONTAINMENT AND OVERFILL PREVENTION: **NOT REPORTED**

Leaking Petroleum Storage Tanks (LPST)

PIPING SYSTEMS

MATERIAL: **STEEL**

CORROSION PROTECTION: **NOT REPORTED**

EXTERNAL CONTAINMENT: **NOT REPORTED**

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**

CORROSION PROTECTION VARIANCE: **NO VARIANCE**

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: **165873** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **M1** REGISTRATION DATE: **02/04/1992**

INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**

TANK CAPACITY (GAL): **7200** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **165872** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **M2** REGISTRATION DATE: **02/04/1992**

INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

FIBERGLASS: **NO** CONCRETE: **NO**

ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**

CONTAINMENT LINER: **NO** NONE: **NO**

STAGE I VAPOR RECOVERY: **NOT REPORTED**

STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **165874** MULTIPLE COMPARTMENT FLAG: **NO**

TANK ID: **M3** REGISTRATION DATE: **02/04/1992**

INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**

TANK CAPACITY (GAL): **10000** REGULATORY STATUS: **FULLY REGULATED**

STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**

Leaking Petroleum Storage Tanks (LPST)

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO

CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: NOT REPORTED

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 165877 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: M4 REGISTRATION DATE: 02/04/1992

INSTALLATION DATE: 01/01/1993 STATUS BEGIN DATE: 03/02/1999

TANK CAPACITY (GAL): 18000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DISTILLATE FUEL OIL

MATERIAL OF CONSTRUCTION

STEEL: YES CORRUGATED METAL: NO

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES

CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: NOT REPORTED

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 165878 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: M5 REGISTRATION DATE: 02/04/1992

INSTALLATION DATE: 01/01/1993 STATUS BEGIN DATE: 03/02/1999

TANK CAPACITY (GAL): 10500 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: YES CORRUGATED METAL: NO

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES

CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: NOT REPORTED

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 165880 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: M6 REGISTRATION DATE: 02/04/1992

INSTALLATION DATE: 01/01/1993 STATUS BEGIN DATE: 03/02/1999

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: YES CORRUGATED METAL: NO

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES

Leaking Petroleum Storage Tanks (LPST)

CONTAINMENT LINER: **NO** NONE: **NO**
STAGE I VAPOR RECOVERY: **NOT REPORTED**
STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **165879** MULTIPLE COMPARTMENT FLAG: **NO**
TANK ID: **M7** REGISTRATION DATE: **02/04/1992**
INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**
TANK CAPACITY (GAL): **5000** REGULATORY STATUS: **FULLY REGULATED**
STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**
FIBERGLASS: **NO** CONCRETE: **NO**
ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**
CONTAINMENT LINER: **NO** NONE: **NO**
STAGE I VAPOR RECOVERY: **NOT REPORTED**
STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **165881** MULTIPLE COMPARTMENT FLAG: **NO**
TANK ID: **01** REGISTRATION DATE: **02/04/1992**
INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**
TANK CAPACITY (GAL): **10500** REGULATORY STATUS: **FULLY REGULATED**
STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**
FIBERGLASS: **NO** CONCRETE: **NO**
ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**
CONTAINMENT LINER: **NO** NONE: **NO**
STAGE I VAPOR RECOVERY: **NOT REPORTED**
STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **165876** MULTIPLE COMPARTMENT FLAG: **NO**
TANK ID: **02** REGISTRATION DATE: **02/04/1992**
INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**
TANK CAPACITY (GAL): **8000** REGULATORY STATUS: **FULLY REGULATED**
STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**
FIBERGLASS: **NO** CONCRETE: **NO**
ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**
CONTAINMENT LINER: **NO** NONE: **NO**
STAGE I VAPOR RECOVERY: **NOT REPORTED**
STAGE I INSTALLATION DATE: **NOT REPORTED**

AST ID #: **165875** MULTIPLE COMPARTMENT FLAG: **NO**

Leaking Petroleum Storage Tanks (LPST)

TANK ID: **03** REGISTRATION DATE: **02/04/1992**
INSTALLATION DATE: **01/01/1993** STATUS BEGIN DATE: **03/02/1999**
TANK CAPACITY (GAL): **17500** REGULATORY STATUS: **FULLY REGULATED**
STATUS: **OUT OF USE** SUBSTANCES: **DIESEL**

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO**
FIBERGLASS: **NO** CONCRETE: **NO**
ALUMINIUM: **NO**

CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**
CONTAINMENT LINER: **NO** NONE: **NO**
STAGE I VAPOR RECOVERY: **NOT REPORTED**
STAGE I INSTALLATION DATE: **NOT REPORTED**

[Back to Report Summary](#)

Municipal Solid Waste Landfill Sites (MSWLF)

MAP ID# 11

Distance from Property: 0.476 mi. (2,513 ft.) WSW
Elevation: 505 ft. (Lower than TP)

FACILITY INFORMATION

PERMIT#: 100016
NAME: WALKER BRANCH RECYCLING INC
ADDRESS: 3120 S PRECINCT LINE RD
HURST, TX 76053-7615
COUNTY: TARRANT

FACILITY DETAILS

FACILITY TYPE #: NOTICE OF INTENT TO OPERATE A RECYCLING FACILITY
LEGAL STATUS DATE: 02/09/2004
PHYSICAL FACILITY STATUS: NOT CONSTRUCTED
LEGAL STATUS: RETURNED
REFERENCE NUMBER(RN): RN100578202
REGION: REGION 04 - DFW METROPLEX

(This data was provided by the TCEQ prior to August 2013)

FACILITY TYPE: RESOURCE RECOVERY/RECYCLING FACILITY
FACILITY STATUS: INACTIVE
AREA SERVED: N/A
BUSINESS TYPE: BUSINESS
ESTIMATED CLOSURE: NOT REPORTED
POPULATION SERVED: NOT REPORTED
TONS (PER DAY) : N/A
YARDS (PER DAY) : N/A
ACRES : N/A

APPLICATION / PERMIT INFORMATION

APPLICATION TYPE	APPLICATION STARTED	APPLICATION ENDED	PERMIT STATUS	STATUS DATE
NEW APPLICATION	12/17/02	02/09/04	DENIED	02/09/04

[Back to Report Summary](#)

Municipal Solid Waste Landfill Sites (MSWLF)

MAP ID# 11

Distance from Property: 0.476 mi. (2,513 ft.) WSW
Elevation: 505 ft. (Lower than TP)

FACILITY INFORMATION

PERMIT#: 100097

NAME: PRECINCT LINE ROAD RECYCLING FACILITY

ADDRESS: MAPSCO 52Z 3120 PRECINCT LINE RD
HURST, TX

COUNTY: TARRANT

FACILITY DETAILS

FACILITY TYPE #: NOTICE OF INTENT TO OPERATE A RECYCLING FACILITY

LEGAL STATUS DATE: 06/14/2005

PHYSICAL FACILITY STATUS: NOT CONSTRUCTED

LEGAL STATUS: RETURNED

REFERENCE NUMBER(RN): RN104543038

REGION: REGION 04 - DFW METROPLEX

[Back to Report Summary](#)

Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

[MAP ID# 12](#)

Distance from Property: 0.547 mi. (2,888 ft.) E
Elevation: 522 ft. (Lower than TP)

PROGRAM ID: 30406

RN NUMBER: RN100222488

NAME: BELL HELICOPTER PLANT 1

ADDRESS: 3255 BELL HELICOPTER BLVD
FORT WORTH, TX 76118

STATUS: INACTIVE

STATUS DATE: 9/16/2019

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: PREV 600 E HURST BLVD

PHASE STATUS DATE: 9/16/2019

SOIL CHEMICAL OF CONCERN CLASS: NOT REPORTED

SOIL REMEDIATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASS: CHLORINATED SOLVENTS, METALS

GROUNDWATER REMEDIATION: NOT REPORTED

[Back to Report Summary](#)

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

MAP ID# 12

Distance from Property: 0.547 mi. (2,888 ft.) E
Elevation: 522 ft. (Lower than TP)

FACILITY INFORMATION

EPA ID#: TXD980626006

NAME: BELL PLANT 1

ADDRESS: 600 E HURST BLVD
HURST, TX 76053-8030

CONTACT NAME: GREGORY STIBOREK

CONTACT ADDRESS: PO BOX 482
FORT WORTH TX 76101-0482

CONTACT PHONE: 817-280-6024

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 04/28/2020

OWNER TYPE: PRIVATE

OWNER NAME: BELL HELICOPTER TEXTRON INC

OPERATOR TYPE: PRIVATE

OPERATOR NAME: BELL HELICOPTER TEXTRON INC

CERTIFICATION

CERTIFICATION NAME:	CERTIFICATION TITLE:	CERTIFICATION SIGNED DATE:
GREGORY STIBOREK	AUTHORIZED COMPANY AGENT	03/01/2010
GERRY WALSH	UNKNOWN	11/11/2005
DARYL CRANE	AUTHORIZED COMPANY AGENT	03/01/2012
ROBERT H YOUNG	MGR ENV MGMT	01/23/1992
DARYL CRANE	AUTHORIZED COMPANY AGENT	03/01/2014
DONALD L LEGG	MGR ENV COMPLIA	02/28/1994
DARYL CRANE	AUTHORIZED COMPANY AGENT	03/01/2016
GREGORY STIBOREK	AUTHORIZED COMPANY AGENT	03/01/2018
GERRY WALSH	UNKNOWN	11/29/2005
KEN CLARK	AUTHORIZED AGNT	01/25/1998
GERRY WALSH	UNKNOWN	01/03/2006
DEBRA RODRIQUEZ	AUTHORIZED COMP	01/25/2000
GERRY WALSH	UNKNOWN	02/10/2006
CHRIS WILLIAMS	AUTHORIZEDAGENT	03/01/2002
GREGORY STIBOREK	UNKNOWN	03/27/2006
GERRY WALSH	AUTHORIZEDAGENT	03/01/2004
GREGORY STIBOREK	UNKNOWN	07/28/2006
GREGORY STIBOREK	AUTHORIZEDAGENT	03/01/2006
GREGORY STIBOREK	AUTHORIZEDAGENT	03/01/2008
GREGORY STIBOREK	UNKNOWN	10/24/2006
GREGORY STIBOREK	UNKNOWN	01/18/2007
GREGORY STIBOREK	UNKNOWN	03/20/2007
GREGORY STIBOREK	UNKNOWN	04/03/2007
GREGORY STIBOREK	UNKNOWN	10/09/2007
JOE STIBOREK	UNKNOWN	09/02/2008
JOE STIBOREK	UNKNOWN	09/09/2008
JOE STIBOREK	UNKNOWN	10/14/2008
JOE STIBOREK	UNKNOWN	10/28/2008
JOE STIBOREK	UNKNOWN	03/10/2009
JOE STIBOREK	UNKNOWN	10/20/2009

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

JOE STIBOREK	UNKNOWN	02/23/2010
GREGORY STIBOREK	UNKNOWN	07/07/2010
GREGORY STIBOREK	UNKNOWN	08/31/2010
GREGORY STIBOREK	UNKNOWN	09/21/2010
GREGORY STIBOREK	SR. ENGINEER ENVIRONMENT	10/12/2010
GREGORY STIBOREK	SR. ENGINEER ENVIRONMENT	11/23/2010
GREGORY STIBOREK	SR. ENGINEER ENVIRONMENT	12/07/2010
DARYL CRANE	ENV MGR	03/23/2012
DARYL CRANE	ENV MGR	07/19/2012
DARYL CRANE	SR EHS SPECIALIST	12/10/2012
DARYL CRANE	SR EHS SPECIALIST	03/11/2013
DARYL CRANE	SR EHS SPECIALIST	05/23/2013
DARYL CRANE	SR EHS SPECIALIST	11/07/2013
DARYL CRANE	SR EHS SPECIALIST	02/28/2014
DARYL CRANE	SR EHS SPECIALIST	09/02/2014
DARYL CRANE	SR EHS SPECIALIST	12/19/2014
DARYL CRANE	SR EHS SPECIALIST	04/03/2015
DARYL CRANE	SR EHS SPECIALIST	04/24/2015
DARYL CRANE	SR EHS SPECIALIST	04/04/2016
DARYL CRANE	SR EHS SPECIALIST	05/16/2016
DARYL CRANE	SR EHS SPECIALIST	07/11/2016
DARYL CRANE	SR EHS SPECIALIST	08/17/2016
GREGORY STIBOREK	SR EHS SPECIALIST	04/23/2018
GREGORY STIBOREK	SR EHS SPECIALIST	07/02/2018
GREGORY STIBOREK	SR EHS SPECIALIST	07/08/2019
GREGORY STIBOREK	SR EHS SPECIALIST	08/05/2019
GREGORY STIBOREK	SR EHS SPECIALIST	01/30/2020
GREGORY STIBOREK	SR EHS SPECIALIST	02/25/2020
GREGORY STIBOREK	SR EHS SPECIALIST	03/12/2020
GREGORY STIBOREK	SR EHS SPECIALIST	04/28/2020

INDUSTRY CLASSIFICATION (NAICS)

336411 - AIRCRAFT MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: **LARGE QUANTITY GENERATOR** LAST UPDATED DATE: **05/11/2020**

SUBJECT TO CORRECTIVE ACTION UNIVERSE: **YES**

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: **NO**

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: **YES**

NON TDSFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: **NO**

CORRECTIVE ACTION WORKLOAD UNIVERSE: **YES**

IMPORTER: **NO** UNDERGROUND INJECTION: **NO**

MIXED WASTE GENERATOR: **NOT REPORTED** UNIVERSAL WASTE DESTINATION FACILITY: **NO**

RECYCLER: **NO** TRANSFER FACILITY: **NO**

TRANSPORTER: **NO** USED OIL FUEL BURNER: **NO**

ONSITE BURNER EXEMPTION: **NO** USED OIL PROCESSOR: **NO**

FURNACE EXEMPTION: **NO** USED OIL FUEL MARKETER TO BURNER: **NO**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

USED OIL REFINER: **NO**

SPECIFICATION USED OIL MARKETER: **NO**

USED OIL TRANSFER FACILITY: **NO**

USED OIL TRANSPORTER: **NO**

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS

01/22/1991	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
02/29/1988	CSE COMPLIANCE SCHEDULE EVALUATION
03/13/2012	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
03/18/1992	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
04/28/1989	FCI FOCUSED COMPLIANCE INSPECTION
04/30/1990	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
05/11/2000	SNN NOT A SIGNIFICANT NON-COMPLIER
06/18/1998	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/24/1997	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
06/29/1999	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
07/02/1990	NRR NON-FINANCIAL RECORD REVIEW
08/06/2012	NRR NON-FINANCIAL RECORD REVIEW
09/21/1988	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
09/26/1994	NRR NON-FINANCIAL RECORD REVIEW
11/04/1998	SNY SIGNIFICANT NON-COMPLIER
11/24/1987	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/30/2000	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
12/01/2003	NRR NON-FINANCIAL RECORD REVIEW
12/08/1988	CSE COMPLIANCE SCHEDULE EVALUATION
12/09/1993	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
12/20/1994	NRR NON-FINANCIAL RECORD REVIEW

VIOLATIONS

01/22/1991	XXS STATE STATUTE OR REGULATION
03/13/2012	262.C GENERATORS - PRE-TRANSPORT
03/13/2012	265.I TSD IS-CONTAINER USE AND MANAGEMENT
03/18/1992	262.A GENERATORS - GENERAL
04/30/1990	268.A LDR - GENERAL
04/30/1990	XXS STATE STATUTE OR REGULATION
06/24/1997	262.A GENERATORS - GENERAL
06/24/1997	XXS STATE STATUTE OR REGULATION
06/29/1999	262.A GENERATORS - GENERAL
06/29/1999	268.A LDR - GENERAL
09/21/1988	264.A TSD - GENERAL
09/21/1988	264.G TSD - CLOSURE/POST-CLOSURE
09/21/1988	XXS STATE STATUTE OR REGULATION
11/04/1998	XXS STATE STATUTE OR REGULATION
11/24/1987	264.A TSD - GENERAL
11/24/1987	XXS STATE STATUTE OR REGULATION
11/30/2000	262.A GENERATORS - GENERAL
12/09/1993	262.A GENERATORS - GENERAL
12/09/1993	264.A TSD - GENERAL

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

12/09/1993	264.G TSD - CLOSURE/POST-CLOSURE
12/09/1993	268.A LDR - GENERAL
12/09/1993	270.C PERMITS - CONDITIONS
12/09/1993	XXS STATE STATUTE OR REGULATION

ENFORCEMENTS

01/11/1988	120 WRITTEN INFORMAL
01/22/1991	110 VERBAL INFORMAL
03/13/2012	110 VERBAL INFORMAL
03/18/1992	110 VERBAL INFORMAL
05/22/1990	120 WRITTEN INFORMAL
06/25/1997	110 VERBAL INFORMAL
10/13/1988	120 WRITTEN INFORMAL
11/30/2000	110 VERBAL INFORMAL
12/09/1993	110 VERBAL INFORMAL
12/23/1993	120 WRITTEN INFORMAL

HAZARDOUS WASTE

D001	IGNITABLE WASTE
D002	CORROSIVE WASTE
D003	REACTIVE WASTE
D004	ARSENIC
D005	BARIUM
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D009	MERCURY
D011	SILVER
D018	BENZENE
D035	METHYL ETHYL KETONE
D039	TETRACHLOROETHYLENE
D040	TRICHLOROETHYLENE
F001	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE,TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F002	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE,TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,CHLORO BENZENE, 1,1,2-TRICHLORO-1,2,2- TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

F003	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F005	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F006	WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.
F019	WASTEWATER TREATMENT SLUDGES FROM THE CHEMICAL CONVERSION COATING OF ALUMINUM EXCEPT FROM ZIRCONIUM PHOSPHATING IN ALUMINUM CAN WASHING WHEN SUCH PHOSPHATING IS AN EXCLUSIVE CONVERSION COATING PROCESS.
U080	METHANE, DICHLORO-
U080	METHYLENE CHLORIDE
U134	HYDROFLUORIC ACID (C,T)
U134	HYDROGEN FLUORIDE (C,T)
U154	METHANOL (I)
U154	METHYL ALCOHOL (I)
U210	ETHENE, TETRACHLORO-
U226	ETHANE, 1,1,1-TRICHLORO-
U226	METHYL CHLOROFORM
U228	ETHENE, TRICHLORO-
U228	TRICHLOROETHYLENE
D001	IGNITABLE WASTE
D002	CORROSIVE WASTE
D003	REACTIVE WASTE
D004	ARSENIC
D005	BARIUM
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D009	MERCURY
D010	SELENIUM
D011	SILVER
D018	BENZENE
D035	METHYL ETHYL KETONE
D039	TETRACHLOROETHYLENE
D040	TRICHLOROETHYLENE
F001	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

F002	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F003	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F005	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F006	WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.
F007	SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.
F008	PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
F009	SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
F019	WASTEWATER TREATMENT SLUDGES FROM THE CHEMICAL CONVERSION COATING OF ALUMINUM EXCEPT FROM ZIRCONIUM PHOSPHATING IN ALUMINUM CAN WASHING WHEN SUCH PHOSPHATING IS AN EXCLUSIVE CONVERSION COATING PROCESS.
P105	SODIUM AZIDE
P106	SODIUM CYANIDE
P106	SODIUM CYANIDE NA(CN)
U044	CHLOROFORM
U044	METHANE, TRICHLORO-
U079	1,2-DICHLOROETHYLENE
U079	ETHENE, 1,2-DICHLORO-, (E)-
U080	METHANE, DICHLORO-
U080	METHYLENE CHLORIDE
U134	HYDROFLUORIC ACID (C,T)
U134	HYDROGEN FLUORIDE (C,T)
U144	ACETIC ACID, LEAD(2+) SALT
U144	LEAD ACETATE
U146	LEAD SUBACETATE
U146	LEAD, BIS(ACETATO-O)TETRAHYDROXYTRI-
U154	METHANOL (I)
U154	METHYL ALCOHOL (I)
U210	ETHENE, TETRACHLORO-
U226	ETHANE, 1,1,1-TRICHLORO-
U226	METHYL CHLOROFORM
U228	ETHENE, TRICHLORO-

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

U228 TRICHLOROETHYLENE

UNIVERSAL WASTE

WASTE TYPE:	ACCUMULATED WASTE ON-SITE:	GENERATED WASTE ON-SITE:	SOURCE TYPE:
BATTERIES	NO	NO	ANNUAL/BIENNIAL REPORT
BATTERIES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
LAMPS	NO	NO	ANNUAL/BIENNIAL REPORT
LAMPS	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
PESTICIDES	NO	NO	ANNUAL/BIENNIAL REPORT
PESTICIDES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	NO	NO	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT

CORRECTIVE ACTION AREA (RELEASE)

AREA NAME:	AIR:	GROUNDWATER:	SOIL:	SURFACE WASTE:
ENTIRE FACILITY	----	----	Y	----
BLDG 2 DEPT 65 ETCH LINE	----	----	Y	----
B-2 D66/47 NISWMU #2,3	Y	----	----	----
SALT POT PIT NISWMU #4	----	----	Y	----
GLEASON GEAR NISWMU #5	----	----	Y	----
BIG 3 AREA NISWMU #6	----	----	Y	----
HELIPORT LF	----	----	Y	----
AREAS ADDRESSED THROUGH 8/31/2002	----	----	----	----

CORRECTIVE ACTION EVENT

CA EVENT CODE: CA800YE
 EVENT DESCRIPTION: READY FOR ANTICIPATED USE DETERMINATION - READY FOR ANTICIPATED USE
 EVENT SEQUENCE NUMBER: 1
 EVENT RESPONSIBLE AGENCY: STATE
 ACTUAL DATE OF EVENT: 08/29/2019
 ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
 NEW SCHEDULE DATE OF EVENT: NOT REPORTED

 CA EVENT CODE: CA770GW
 EVENT DESCRIPTION: ENGINEERING CONTROLS ESTABLISHED-GROUNDWATER CONTROL
 EVENT SEQUENCE NUMBER: 2
 EVENT RESPONSIBLE AGENCY: STATE
 ACTUAL DATE OF EVENT: 04/11/2017
 ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
 NEW SCHEDULE DATE OF EVENT: NOT REPORTED

 CA EVENT CODE: CA400
 EVENT DESCRIPTION: REMEDY DECISION

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 08/14/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA550RC
EVENT DESCRIPTION: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 08/14/2015
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA200
EVENT DESCRIPTION: INVESTIGATION COMPLETE
EVENT SEQUENCE NUMBER: 4
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/26/2006
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA725YE
EVENT DESCRIPTION: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 02/28/2005
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA750YE
EVENT DESCRIPTION: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 02/28/2005
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA770GW
EVENT DESCRIPTION: ENGINEERING CONTROLS ESTABLISHED-GROUNDWATER CONTROL
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

ACTUAL DATE OF EVENT: 06/01/2004
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA200
EVENT DESCRIPTION: INVESTIGATION COMPLETE
EVENT SEQUENCE NUMBER: 3
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 10/12/2001
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA190
EVENT DESCRIPTION: INVESTIGATION REPORT RECEIVED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 06/14/2001
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA191
EVENT DESCRIPTION: RFI DRAFT REPORT COMMENTS
EVENT SEQUENCE NUMBER: 3
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 04/24/2001
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA191
EVENT DESCRIPTION: RFI DRAFT REPORT COMMENTS
EVENT SEQUENCE NUMBER: 2
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 03/02/2001
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED
NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA999
EVENT DESCRIPTION: CA PROCESS IS TERMINATED
EVENT SEQUENCE NUMBER: 1
EVENT RESPONSIBLE AGENCY: STATE
ACTUAL DATE OF EVENT: 09/20/2000
ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA550

EVENT DESCRIPTION: REMEDY CONSTRUCTION

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 06/21/2000

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA200

EVENT DESCRIPTION: INVESTIGATION COMPLETE

EVENT SEQUENCE NUMBER: 2

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 06/21/2000

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA532OR

EVENT DESCRIPTION: CMI REPORT

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 02/18/2000

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA190

EVENT DESCRIPTION: INVESTIGATION REPORT RECEIVED

EVENT SEQUENCE NUMBER: 7

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 02/18/2000

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA191

EVENT DESCRIPTION: RFI DRAFT REPORT COMMENTS

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 04/22/1999

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

CA EVENT CODE: **CA190**
EVENT DESCRIPTION: **INVESTIGATION REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **12/21/1998**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA725IN**
EVENT DESCRIPTION: **HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **09/01/1998**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA750IN**
EVENT DESCRIPTION: **RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **09/01/1998**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA375**
EVENT DESCRIPTION: **INTERIM DECISION FOR NO FURTHER ACTION**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **10/21/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA150**
EVENT DESCRIPTION: **INVESTIGATION WORKPLAN APPROVED**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **10/21/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA190**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

EVENT DESCRIPTION: **INVESTIGATION REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **6**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/23/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA650**
EVENT DESCRIPTION: **STABILIZATION CONSTRUCTION COMPLETED**
EVENT SEQUENCE NUMBER: **3**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **03/26/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA650**
EVENT DESCRIPTION: **STABILIZATION CONSTRUCTION COMPLETED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **03/07/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA650**
EVENT DESCRIPTION: **STABILIZATION CONSTRUCTION COMPLETED**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **03/07/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA200**
EVENT DESCRIPTION: **INVESTIGATION COMPLETE**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **03/04/1997**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA190**
EVENT DESCRIPTION: **INVESTIGATION REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **5**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/12/1996**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA195**
EVENT DESCRIPTION: **INVESTIGATION PROGRESS REPORTS RECEIVED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **12/22/1995**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA150**
EVENT DESCRIPTION: **INVESTIGATION WORKPLAN APPROVED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **11/16/1995**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA110**
EVENT DESCRIPTION: **INVESTIGATION WORKPLAN RECEIVED**
EVENT SEQUENCE NUMBER: **6**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **11/10/1995**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA110**
EVENT DESCRIPTION: **INVESTIGATION WORKPLAN RECEIVED**
EVENT SEQUENCE NUMBER: **5**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **08/24/1995**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA110**
EVENT DESCRIPTION: **INVESTIGATION WORKPLAN RECEIVED**
EVENT SEQUENCE NUMBER: **4**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **07/24/1995**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA110

EVENT DESCRIPTION: INVESTIGATION WORKPLAN RECEIVED

EVENT SEQUENCE NUMBER: 3

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 12/16/1994

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA600SR

EVENT DESCRIPTION: STABILIZATION/INTERIM MEASURES DECISION-PRIMARY MEAS IS SOURCE REMOVL &/OR TRT

EVENT SEQUENCE NUMBER: 3

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 11/04/1994

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA624OR

EVENT DESCRIPTION: STABILIZATION MEASURES REPORT RECEIVED

EVENT SEQUENCE NUMBER: 4

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 11/04/1994

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA225IN

EVENT DESCRIPTION: STABILIZATION MEASURES EVALUATION-FURTHER INVESTIGATION NECESSARY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 09/06/1994

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA110

EVENT DESCRIPTION: INVESTIGATION WORKPLAN RECEIVED

EVENT SEQUENCE NUMBER: 2

EVENT RESPONSIBLE AGENCY: STATE

ACTUAL DATE OF EVENT: 05/04/1994

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

CA EVENT CODE: **CA624RV**
EVENT DESCRIPTION: **STABILIZATION MEASURES REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **3**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **05/04/1994**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA190**
EVENT DESCRIPTION: **INVESTIGATION REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **4**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/11/1994**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA624OR**
EVENT DESCRIPTION: **STABILIZATION MEASURES REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/04/1994**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA050RF**
EVENT DESCRIPTION: **RFA COMPLETED-ASSESSMENT WAS A RFA**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/04/1994**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA070YE**
EVENT DESCRIPTION: **DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NECESSARY**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/04/1994**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA600SR**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

EVENT DESCRIPTION: **STABILIZATION/INTERIM MEASURES DECISION-PRIMARY MEAS IS SOURCE REMOVL &/OR TRT**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **04/04/1994**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA110**
EVENT DESCRIPTION: **INVESTIGATION WORKPLAN RECEIVED**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **11/23/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA370**
EVENT DESCRIPTION: **PETITION FOR NO FUR. ACTION RECEIPT DATE**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **11/23/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA050RF**
EVENT DESCRIPTION: **RFA COMPLETED-ASSESSMENT WAS A RFA**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **10/28/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA070YE**
EVENT DESCRIPTION: **DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NECESSARY**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **10/28/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA600SR**
EVENT DESCRIPTION: **STABILIZATION/INTERIM MEASURES DECISION-PRIMARY MEAS IS SOURCE REMOVL &/OR TRT**
EVENT SEQUENCE NUMBER: **1**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **10/28/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA624OR**
EVENT DESCRIPTION: **STABILIZATION MEASURES REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **10/28/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA225IN**
EVENT DESCRIPTION: **STABILIZATION MEASURES EVALUATION-FURTHER INVESTIGATION NECESSARY**
EVENT SEQUENCE NUMBER: **2**
EVENT RESPONSIBLE AGENCY: **EPA**
ACTUAL DATE OF EVENT: **10/14/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA100DC**
EVENT DESCRIPTION: **RFI IMPOSITION-FOCUSED DATA COLLECTION REQ STAB EVAL**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **08/25/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA190**
EVENT DESCRIPTION: **INVESTIGATION REPORT RECEIVED**
EVENT SEQUENCE NUMBER: **3**
EVENT RESPONSIBLE AGENCY: **STATE**
ACTUAL DATE OF EVENT: **03/09/1993**
ORIGINAL SCHEDULE DATE OF EVENT: **NOT REPORTED**
NEW SCHEDULE DATE OF EVENT: **NOT REPORTED**

CA EVENT CODE: **CA075HI**
EVENT DESCRIPTION: **CA PRIORITIZATION-HIGH CA PRIORITY**
EVENT SEQUENCE NUMBER: **1**
EVENT RESPONSIBLE AGENCY: **EPA**
ACTUAL DATE OF EVENT: **05/14/1992**

Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA225NR

EVENT DESCRIPTION: STABILIZATION MEASURES EVALUATION-FACILITY NOT AMENABLE TO STABILIZATION

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 04/21/1992

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

CA EVENT CODE: CA050RF

EVENT DESCRIPTION: RFA COMPLETED-ASSESSMENT WAS A RFA

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 03/20/1992

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED

NEW SCHEDULE DATE OF EVENT: NOT REPORTED

[Back to Report Summary](#)

Unlocated Sites Summary

This list contains sites that could not be mapped due to limited or incomplete address information.

No Records Found

Environmental Records Definitions - FEDERAL

AIRSAFS

Aerometric Information Retrieval System / Air Facility Subsystem

VERSION DATE: 10/20/14

The United States Environmental Protection Agency (EPA) modified the Aerometric Information Retrieval System (AIRS) to a database that exclusively tracks the compliance of stationary sources of air pollution with EPA regulations: the Air Facility Subsystem (AFS). Since this change in 2001, the management of the AIRS/AFS database was assigned to EPA's Office of Enforcement and Compliance Assurance. Enforcement and Compliance History Online (ECHO) Clean Air Act data from AFS are frozen and reflect data as of October 17, 2014, the EPA retired this system for Clean Air Act stationary sources.

BRS

Biennial Reporting System

VERSION DATE: 12/31/15

The United States Environmental Protection Agency (EPA), in cooperation with the States, biennially collects information regarding the generation, management, and final disposition of hazardous wastes regulated under the Resource Conservation and Recovery Act of 1976 (RCRA), as amended. The Biennial Report captures detailed data on the generation of hazardous waste from large quantity generators and data on waste management practices from treatment, storage and disposal facilities. Currently, the EPA states that data collected between 1991 and 1997 was originally a part of the defunct Biennial Reporting System and is now incorporated into the RCRAInfo data system.

CDL

Clandestine Drug Laboratory Locations

VERSION DATE: 02/25/20

The U.S. Department of Justice ("the Department") provides this information as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments. The Department does not establish, implement, enforce, or certify compliance with clean-up or remediation standards for contaminated sites; the public should contact a state or local health department or environmental protection agency for that information.

DOCKETS

EPA Docket Data

VERSION DATE: 12/22/05

The United States Environmental Protection Agency Docket data lists Civil Case Defendants, filing dates as far back as 1971, laws broken including section, violations that occurred, pollutants involved, penalties assessed and superfund awards by facility and location. Please refer to ICIS database as source of current data.

EC

Federal Engineering Institutional Control Sites

VERSION DATE: 05/22/20

Environmental Records Definitions - FEDERAL

This database includes site locations where Engineering and/or Institutional Controls have been identified as part of a selected remedy for the site as defined by United States Environmental Protection Agency official remedy decision documents. The data displays remedy component information for Superfund decision documents issued in fiscal years 1982-2017, and it includes final and deleted NPL sites as well as sites with a Superfund Alternative Approach (SAA) agreement in place. The only sites included that are not on the NPL, proposed for NPL, or removed from proposed NPL, are those with an SAA Agreement in place. A site listing does not indicate that the institutional and engineering controls are currently in place nor will be in place once the remedy is complete; it only indicates that the decision to include either of them in the remedy is documented as of the completed date of the document. Institutional controls are actions, such as legal controls, that help minimize the potential for human exposure to contamination by ensuring appropriate land or resource use. Engineering controls include caps, barriers, or other device engineering to prevent access, exposure, or continued migration of contamination.

ECHOR06 Enforcement and Compliance History Information

VERSION DATE: 05/30/20

The U.S. Environmental Protection Agency's Enforcement and Compliance History Online (ECHO) database, provides compliance and enforcement information for facilities nationwide. This database includes facilities regulated as Clean Air Act stationary sources, Clean Water Act direct dischargers, Resource Conservation and Recovery Act hazardous waste handlers, Safe Drinking Water Act public water systems along with other data, such as Toxics Release Inventory releases.

ERNSTX Emergency Response Notification System

VERSION DATE: 04/05/20

This National Response Center database contains data on reported releases of oil, chemical, radiological, biological, and/or etiological discharges into the environment anywhere in the United States and its territories. The data comes from spill reports made to the U.S. Environmental Protection Agency, U.S. Coast Guard, the National Response Center and/or the U.S. Department of Transportation.

FRSTX Facility Registry System

VERSION DATE: 04/05/20

The United States Environmental Protection Agency's Office of Environmental Information (OEI) developed the Facility Registry System (FRS) as the centrally managed database that identifies facilities, sites or places subject to environmental regulations or of environmental interest. The Facility Registry System replaced the Facility Index System or FINDS database.

HMIRSR06 Hazardous Materials Incident Reporting System

VERSION DATE: 05/20/20

The HMIRS database contains unintentional hazardous materials release information reported to the U.S.

Environmental Records Definitions - FEDERAL

Department of Transportation located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

HWCD Hazardous Waste Compliance Docket Facilities

VERSION DATE: 04/29/20

This list of the Federal Agency Hazardous Waste Compliance Docket Facilities is maintained by the United States Environmental Protection Agency (EPA). According to the EPA, Section 120(c) of CERCLA requires EPA to establish a listing, known as the Federal Facility Hazardous Waste Compliance Docket (Docket), of Federal facilities which are managing or have managed hazardous waste; or have had a release of hazardous waste. Thus, the Docket identifies all Federal facilities that must be evaluated to determine whether they pose a risk to human health and the environment and it makes this information available to the public. In order for the Docket to remain current and accurate it requires periodic updating.

ICIS Integrated Compliance Information System (formerly DOCKETS)

VERSION DATE: 03/28/20

ICIS is a case activity tracking and management system for civil, judicial, and administrative federal Environmental Protection Agency enforcement cases. ICIS contains information on federal administrative and federal judicial cases under the following environmental statutes: the Clean Air Act, the Clean Water Act, the Resource Conservation and Recovery Act, the Emergency Planning and Community Right-to-Know Act - Section 313, the Toxic Substances Control Act, the Federal Insecticide, Fungicide, and Rodenticide Act, the Comprehensive Environmental Response, Compensation, and Liability Act, the Safe Drinking Water Act, and the Marine Protection, Research, and Sanctuaries Act.

ICISNPDES Integrated Compliance Information System National Pollutant Discharge Elimination System

VERSION DATE: 04/26/20

Authorized by the Clean Water Act, the National Pollutant Discharge Elimination System (NPDES) permit program controls water pollution by regulating point sources that discharge pollutants into waters of the United States. This database is provided by the U.S. Environmental Protection Agency.

LUCIS Land Use Control Information System

VERSION DATE: 09/01/06

The LUCIS database is maintained by the U.S. Department of the Navy and contains information for former Base Realignment and Closure (BRAC) properties across the United States.

MLTS Material Licensing Tracking System

VERSION DATE: 06/29/17

MLTS is a list of approximately 8,100 sites which have or use radioactive materials subject to the United States

Environmental Records Definitions - FEDERAL

Nuclear Regulatory Commission (NRC) licensing requirements. Disclaimer: Due to agency regulations and policies, this database contains applicant/licensee location information which may or may not be related to the physical location per MLTS site.

NPDES06 National Pollutant Discharge Elimination System

VERSION DATE: 04/01/07

Authorized by the Clean Water Act, the National Pollutant Discharge Elimination System (NPDES) permit program controls water pollution by regulating point sources that discharge pollutants into waters of the United States. The NPDES database was collected from the U.S. Environmental Protection Agency (EPA) from December 2002 through April 2007. Refer to the ICIS and/or ICIS-NPDES database as source of current data. This database includes permitted facilities located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

PADS PCB Activity Database System

VERSION DATE: 10/09/19

PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of Polychlorinated Biphenyls (PCB) who are required to notify the U.S. Environmental Protection Agency of such activities.

PCSR06 Permit Compliance System

VERSION DATE: 08/01/12

The historic Permit Compliance System tracked enforcement status and permit compliance of facilities controlled by the National Pollutant Discharge Elimination System (NPDES) under the Clean Water Act. This database includes permitted facilities located in EPA Region 6 states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas. This system has since been modernized by United States Environmental Protection Agency and is now integrated into the Integrated Compliance Information System (ICIS). Please refer to the ICIS database as the current source for this data.

RCRASC RCRA Sites with Controls

VERSION DATE: 05/14/20

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities with institutional controls in place.

SEMSLIENS SEMS Lien on Property

VERSION DATE: 06/22/20

Environmental Records Definitions - FEDERAL

The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs. This is a listing of SEMS sites with a lien on the property.

SFLIENS CERCLIS Liens

VERSION DATE: 06/08/12

A Federal CERCLA ("Superfund") lien can exist by operation of law at any site or property at which United States Environmental Protection Agency has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties. This database contains those CERCLIS sites where the Lien on Property action is complete. Please refer to the SEMSLIENS database as source of current data.

SSEHRIPFAS SSEHRI PFAS Contamination Sites

VERSION DATE: 12/12/19

This PFAS Contamination Site Tracker database is compiled by the Social Science Environmental Health Research Institute (SSEHRI) at Northeastern University. According to the SSEHRI, the database records qualitative and quantitative data from each known site of PFAS contamination, including timeline of discovery, sources, levels, health impacts, community response, and government response. The goal of this database is to compile information and support public understanding of the rapidly unfolding issue of PFAS contamination. All data presented was extracted from government websites, news articles, or publicly available documents, and this is cited in the tracker. Disclaimer: The source conveys this database undergoes regular updates as new information becomes available, some sites may be missing and/or contain information that is incorrect or outdated, as well as their information represents all contamination sites SSEHRI is aware of, not all possible contamination sites. This data is not intended to be used for legal purposes. Limited location details are available with this data. Please access the following source link for the most current information:
<https://pfasproject.com/pfas-contamination-site-tracker/>

SSTS Section Seven Tracking System

VERSION DATE: 02/01/17

The United States Environmental Protection Agency tracks information on pesticide establishments through the Section Seven Tracking System (SSTS). SSTS records the registration of new establishments and records pesticide production at each establishment. The Federal Insecticide, Fungicide and Rodenticide Act (FIFRA) requires that production of pesticides or devices be conducted in a registered pesticide-producing or device-producing establishment. "Production" includes formulation, packaging, repackaging, and relabeling. For this database, the Product Information is only available for establishments up through 2014 or prior years, product

Environmental Records Definitions - FEDERAL

details are no longer released by the EPA within the current SSTS non-Confidential Business Information data.

TRI Toxics Release Inventory

VERSION DATE: 12/31/18

The Toxics Release Inventory, provided by the United States Environmental Protection Agency, includes data on toxic chemical releases and waste management activities from certain industries as well as federal and tribal facilities. This inventory contains information about the types and amounts of toxic chemicals that are released each year to the air, water, and land as well as information on the quantities of toxic chemicals sent to other facilities for further waste management.

TSCA Toxic Substance Control Act Inventory

VERSION DATE: 12/31/16

The Toxic Substances Control Act (TSCA) was enacted in 1976 to ensure that chemicals manufactured, imported, processed, or distributed in commerce, or used or disposed of in the United States do not pose any unreasonable risks to human health or the environment. TSCA section 8(b) provides the United States Environmental Protection Agency (EPA) authority to "compile, keep current, and publish a list of each chemical substance that is manufactured or processed in the United States." This TSCA Chemical Substance Inventory contains non-confidential information on the production amount of toxic chemicals from each manufacturer and importer site. The EPA has collected Chemical Data Reporting (CDR) data since in 1986 (as Inventory Update Reporting). Collections occur approximately every four years and reporting requirements changed from collection to collection.

RCRAGR06 Resource Conservation & Recovery Act - Generator

VERSION DATE: 06/15/20

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities currently generating hazardous waste. EPA region 6 includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

RCRANGR06 Resource Conservation & Recovery Act - Non-Generator

VERSION DATE: 06/15/20

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers

Environmental Records Definitions - FEDERAL

to facilities classified as non-generators. Non-Generators do not presently generate hazardous waste. EPA Region 6 includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ALTFUELS Alternative Fueling Stations

VERSION DATE: 04/30/20

Nationwide list of alternative fueling stations made available by the U.S. Department of Energy's Office of Energy Efficiency & Renewable Energy. Includes Bio-diesel stations, Ethanol (E85) stations, Liquefied Petroleum Gas (Propane) stations, Ethanol (E85) stations, Natural Gas stations, Hydrogen stations, and Electric Vehicle Supply Equipment (EVSE).

FEMAUST FEMA Owned Storage Tanks

VERSION DATE: 12/01/16

This is a listing of FEMA owned underground and aboveground storage tank sites. For security reasons, address information is not released to the public according to the U.S. Department of Homeland Security.

HISTPST Historical Gas Stations

VERSION DATE: NR

This historic directory of service stations is provided by the Cities Service Company. The directory includes Cities Service filling stations that were located throughout the United States in 1930.

ICISCLEANERS Integrated Compliance Information System Drycleaners

VERSION DATE: 03/28/20

This is a listing of drycleaner facilities from the Integrated Compliance Information System (ICIS). The U.S. Environmental Protection Agency (EPA) tracks facilities that possess NAIC and SIC codes that classify businesses as drycleaner establishments. The following Primary SIC Codes are included in this data: 7211, 7212, 7213, 7215, 7216, 7217, 7218, and/or 7219; the following Primary NAICS Codes are included in this data: 812320, 812331, and/or 812332.

MRDS Mineral Resource Data System

VERSION DATE: 03/15/16

MRDS (Mineral Resource Data System) is a collection of reports describing metallic and nonmetallic mineral resources throughout the world. Included are deposit name, location, commodity, deposit description, geologic characteristics, production, reserves, resources, and references. This database contains the records previously provided in the Mineral Resource Data System (MRDS) of USGS and the Mineral Availability System/Mineral Industry Locator System (MAS/MILS) originated in the U.S. Bureau of Mines, which is now part of USGS. The USGS has ceased systematic updates of the MRDS database with their focus more recently on deposits of critical minerals while providing a well-documented baseline of historical mine locations from USGS topographic

Environmental Records Definitions - FEDERAL

maps. A few updates last occurred 2015 and early 2016 for select mine site area/s.

MSHA Mine Safety and Health Administration Master Index File

VERSION DATE: 09/20/19

The Mine dataset lists all Coal and Metal/Non-Metal mines under MSHA's jurisdiction since 1/1/1970. It includes such information as the current status of each mine (Active, Abandoned, NonProducing, etc.), the current owner and operating company, commodity codes and physical attributes of the mine. Mine ID is the unique key for this data. This information is provided by the United States Department of Labor - Mine Safety and Health Administration (MSHA).

BF Brownfields Management System

VERSION DATE: 07/08/20

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. The United States Environmental Protection Agency maintains this database to track activities in the various brown field grant programs including grantee assessment, site cleanup and site redevelopment. This database included tribal brownfield sites.

DNPL Delisted National Priorities List

VERSION DATE: 06/22/20

This database includes sites from the United States Environmental Protection Agency's Final National Priorities List (NPL) where remedies have proven to be satisfactory or sites where the original analyses were inaccurate, and the site is no longer appropriate for inclusion on the NPL, and final publication in the Federal Register has occurred.

NLRRCRAT No Longer Regulated RCRA Non-CORRACTS TSD Facilities

VERSION DATE: 06/15/20

This database includes RCRA Non-Corrective Action TSD facilities that are no longer regulated by the United States Environmental Protection Agency or do not meet other RCRA reporting requirements. This listing includes facilities that formerly treated, stored or disposed of hazardous waste.

ODI Open Dump Inventory

VERSION DATE: 06/01/85

The open dump inventory was published by the United States Environmental Protection Agency. An "open dump" is defined as a facility or site where solid waste is disposed of which is not a sanitary landfill which meets the criteria promulgated under section 4004 of the Solid Waste Disposal Act (42 U.S.C. 6944) and which is not a

Environmental Records Definitions - FEDERAL

facility for disposal of hazardous waste. This inventory has not been updated since June 1985.

RCRAT Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities

VERSION DATE: 06/15/20

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities recognized as hazardous waste treatment, storage, and disposal sites (TSD).

SEMS Superfund Enterprise Management System

VERSION DATE: 06/22/20

The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs.

SEMSARCH Superfund Enterprise Management System Archived Site Inventory

VERSION DATE: 04/23/20

The U.S. Environmental Protection Agency's (EPA) Superfund Enterprise Management System Archived Site Inventory (List 8R Archived) replaced the CERCLIS NFRAP reporting system in 2015. This listing reflects sites at which the EPA has determined that assessment has been completed and no further remedial action is planned under the Superfund program.

SMCRA Surface Mining Control and Reclamation Act Sites

VERSION DATE: 06/24/20

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by the Office of Surface Mining Reclamation and Enforcement (OSMRE) to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

USUMTRCA Uranium Mill Tailings Radiation Control Act Sites

VERSION DATE: 03/04/17

Environmental Records Definitions - FEDERAL

The Legacy Management Office of the Department of Energy (DOE) manages radioactive and chemical waste, environmental contamination, and hazardous material at over 100 sites across the U.S. The L.M. Office manages this database of sites registered under the Uranium Mill Tailings Control Act (UMTRCA).

DOD Department of Defense Sites

VERSION DATE: 12/01/14

This information originates from the National Atlas of the United States Federal Lands data, which includes lands owned or administered by the Federal government. Army DOD, Army Corps of Engineers DOD, Air Force DOD, Navy DOD and Marine DOD areas of 640 acres or more are included.

FUDS Formerly Used Defense Sites

VERSION DATE: 12/31/18

The Formerly Used Defense Sites (FUDS) inventory includes properties previously owned by or leased to the United States and under Secretary of Defense Jurisdiction, as well as Munitions Response Areas (MRAs). The remediation of these properties is the responsibility of the Department of Defense. This data is provided by the U.S. Army Corps of Engineers (USACE), the boundaries/polygon data are based on preliminary findings and not all properties currently have polygon data available. **DISCLAIMER:** This data represents the results of data collection/processing for a specific USACE activity and is in no way to be considered comprehensive or to be used in any legal or official capacity as presented on this site. While the USACE has made a reasonable effort to insure the accuracy of the maps and associated data, it should be explicitly noted that USACE makes no warranty, representation or guaranty, either expressed or implied, as to the content, sequence, accuracy, timeliness or completeness of any of the data provided herein. For additional information on Formerly Used Defense Sites please contact the USACE Public Affairs Office at (202) 528-4285.

FUSRAP Formerly Utilized Sites Remedial Action Program

VERSION DATE: 03/04/17

The U.S. Department of Energy (DOE) established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from the Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations. The DOE Office of Legacy Management (LM) established long-term surveillance and maintenance (LTS&M) requirements for remediated FUSRAP sites. DOE evaluates the final site conditions of a remediated site on the basis of risk for different future uses. DOE then confirms that LTS&M requirements will maintain protectiveness.

NLRRCRAC No Longer Regulated RCRA Corrective Action Facilities

VERSION DATE: 06/15/20

This database includes RCRA Corrective Action facilities that are no longer regulated by the United States Environmental Protection Agency or do not meet other RCRA reporting requirements.

Environmental Records Definitions - FEDERAL

NMS Former Military Nike Missile Sites

VERSION DATE: 12/01/84

This information was taken from report DRXTH-AS-IA-83A016 (Historical Overview of the Nike Missile System, 12/1984) which was performed by Environmental Science and Engineering, Inc. for the U.S. Army Toxic and Hazardous Materials Agency Assessment Division. The Nike system was deployed between 1954 and the mid-1970's. Among the substances used or stored on Nike sites were liquid missile fuel (JP-4); starter fluids (UDKH, aniline, and furfuryl alcohol); oxidizer (IRFNA); hydrocarbons (motor oil, hydraulic fluid, diesel fuel, gasoline, heating oil); solvents (carbon tetrachloride, trichloroethylene, trichloroethane, stoddard solvent); and battery electrolyte. The quantities of material a disposed of and procedures for disposal are not documented in published reports. Virtually all information concerning the potential for contamination at Nike sites is confined to personnel who were assigned to Nike sites. During deactivation most hardware was shipped to depot-level supply points. There were reportedly instances where excess materials were disposed of on or near the site itself at closure. There was reportedly no routine site decontamination.

NPL National Priorities List

VERSION DATE: 06/22/20

This database includes United States Environmental Protection Agency (EPA) National Priorities List sites that fall under the EPA's Superfund program, established to fund the cleanup of the most serious uncontrolled or abandoned hazardous waste sites identified for possible long-term remedial action.

PNPL Proposed National Priorities List

VERSION DATE: 06/22/20

This database contains sites proposed to be included on the National Priorities List (NPL) in the Federal Register. The United States Environmental Protection Agency investigates these sites to determine if they may present long-term threats to public health or the environment.

RCRAC Resource Conservation & Recovery Act - Corrective Action Facilities

VERSION DATE: 06/15/20

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities with corrective action activity.

RCRASUBC Resource Conservation & Recovery Act - Subject to Corrective Action Facilities

VERSION DATE: 06/15/20

Environmental Records Definitions - FEDERAL

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities subject to corrective actions.

RODS

Record of Decision System

VERSION DATE: 06/22/20

These decision documents maintained by the United States Environmental Protection Agency describe the chosen remedy for NPL (Superfund) site remediation. They also include site history, site description, site characteristics, community participation, enforcement activities, past and present activities, contaminated media, the contaminants present, and scope and role of response action.

Environmental Records Definitions - STATE (TX)

GWCC Groundwater Contamination Cases

VERSION DATE: 12/31/18

This is a Joint Groundwater Monitoring and Contamination Report provided by the Texas Commission on Environmental Quality (TCEQ) with the Railroad Commission of Texas (RRC). The annual report describes the status of groundwater monitoring activities conducted or required by each agency at regulated facilities or associated with regulated activities. The report provides a general overview of groundwater monitoring by participating members on a program by program basis. Groundwater contamination is broadly defined in the report as any detrimental alteration of the naturally occurring quality of groundwater.

HISTGWCC Historic Groundwater Contamination Cases

VERSION DATE: 12/31/17

This is a Joint Groundwater Monitoring and Contamination Report provided by the Texas Commission on Environmental Quality (TCEQ) that includes historic groundwater contamination cases reported since 1994. These cases have been closed by a program area or agency, such as the TCEQ, the Railroad Commission of Texas, and/or the Texas Alliance of Groundwater Districts. According to the TCEQ report, although enforcement actions may be closed on these cases, the Activity Status Code descriptions allow that groundwater contamination may still be present at the site and may therefore be of interest to regulatory agencies and the general public.

LANDAPP Land Application Permits

VERSION DATE: 06/18/20

Texas Land Application Permits are a requirement from the Texas Commission on Environmental Quality for any domestic facility that disposes of treated effluent by land application such as surface irrigation, evaporation, drainfields or subsurface land application.

LIENS TCEQ Liens

VERSION DATE: 05/05/20

Liens filed upon State and/or Federal Superfund Sites by the Texas Commission on Environmental Quality.

MSD Municipal Setting Designations

VERSION DATE: 02/03/20

The Texas Commission on Environmental Quality (TCEQ) defines an MSD as an official state designation given to property within a municipality or its extraterritorial jurisdiction that certifies that designated groundwater at the property is not used as potable water, and is prohibited from future use as potable water because that groundwater is contaminated in excess of the applicable potable-water protective concentration level. The prohibition must be in the form of a city ordinance, or a restrictive covenant that is enforceable by the city and filed in the property records. The MSD property can be a single property, multi-property, or a portion of property.

Environmental Records Definitions - STATE (TX)

TCEQ Disclaimer: This data is for informational purposes and may not have been prepared for or be suitable for legal, engineering, or surveying purposes. It does not represent an on-the-ground survey and represents only the approximate relative location of property boundaries.

NOV Notice of Violations

VERSION DATE: 02/24/16

This database containing Notice of Violations (NOV) is maintained by the Texas Commission on Environmental Quality. An NOV is a written notification that documents and communicates violations observed during an inspection to the business or individual inspected.

SIEC01 State Institutional/Engineering Control Sites

VERSION DATE: 05/22/20

The Texas Risk Reduction Program (TRRP) requires the placement of institutional controls (e.g., deed notices or restrictive covenants) on affected property in different circumstances as part of completing a response action. In its simplest form, an institutional control (IC) is a legal document that is recorded in the county deed records. In certain circumstances, local zoning or ordinances can serve as an IC. This listing may also include locations where Engineering Controls are in effect, such as a cap, barrier, or other engineering device to prevent access, exposure, or continued migration of contamination. The sites included on this list are regulated by various programs of the Texas Commission on Environmental Quality (TCEQ).

SPILLS Spills Listing

VERSION DATE: 04/10/20

This Texas Commission on Environmental Quality database includes releases of hazardous or potentially hazardous materials into the environment.

TIERII Tier I I Chemical Reporting Program Facilities

VERSION DATE: 12/31/12

The Texas Tier II Chemical Reporting Program in the Department of State Health Services (DSHS) is the state repository for EPCRA-required Emergency Planning Letters (EPLs), which are one-time notifications to the state from facilities that have certain extremely hazardous chemicals in specified amounts. The Program is also the state repository for EPCRA/state-required hazardous chemical inventory reports called Texas Tier Two Reports. This data contains those facility reports for the 2005 through the 2012 calendar years. Please contact the Texas Commission on Environmental Quality Tier II Chemical Reporting Division as the current source for this data, due to confidentiality and safety reasons details such as the location and capacity of on-site hazardous chemicals is only available to local emergency planning agencies, fire departments, and/or owners.

DCR Dry Cleaner Registration Database

VERSION DATE: 05/12/20

Environmental Records Definitions - STATE (TX)

The database includes dry cleaning drop stations and facilities registered with the Texas Commission on Environmental Quality.

IHW Industrial and Hazardous Waste Sites

VERSION DATE: 02/06/20

Owner and facility information is included in this database of permitted and non-permitted industrial and hazardous waste sites (this database excludes information for one time shipment requests). Industrial waste is waste that results from or is incidental to operations of industry, manufacturing, mining, or agriculture. Hazardous waste is defined as any solid waste listed as hazardous or possesses one or more hazardous characteristics as defined in federal waste regulations. The IHW database is maintained by the Texas Commission on Environmental Quality.

PIHW Permitted Industrial Hazardous Waste Sites

VERSION DATE: 02/06/20

Owner and facility information is included in this database of all permitted industrial and hazardous waste sites. Industrial waste is waste that results from or is incidental to operations of industry, manufacturing, mining, or agriculture. Hazardous waste is defined as any solid waste listed as hazardous or possesses one or more hazardous characteristics as defined in federal waste regulations. Permitted IHW facilities are regulated under 30 Texas Administrative Code Chapter 335 in addition to federal regulations. The IHW database is maintained by the Texas Commission on Environmental Quality.

PST Petroleum Storage Tanks

VERSION DATE: 05/12/20

The Petroleum Storage Tank database is administered by the Texas Commission on Environmental Quality (TCEQ). Both Underground storage tanks (USTs) and Aboveground storage tanks (ASTs) are included in this report. Petroleum Storage Tank registration has been a requirement with the TCEQ since 1986.

APAR Affected Property Assessment Reports

VERSION DATE: 05/20/20

As regulated by the Texas Commission on Environmental Quality, an Affected Property Assessment Report is required when a person is addressing a release of chemical of concern (COC) under 30 TAC Chapter 350, the Texas Risk Reduction Program (TRRP). The purpose of the APAR is to document all relevant affected property information to identify all release sources and COCs, determine the extent of all COCs, identify all transport/exposure pathways, and to determine if any response actions are necessary. The Texas Administrative Code Title 30 §350.4(a)(1) defines affected property as the entire area (i.e. on-site and off-site; including all environmental media) which contains releases of chemicals of concern at concentrations equal to or greater than the assessment level applicable for residential land use and groundwater classification.

Environmental Records Definitions - STATE (TX)

BSA Brownfields Site Assessments

VERSION DATE: 05/15/20

The Brownfields Site Assessments database is maintained by the Texas Commission on Environmental Quality (TCEQ). The TCEQ, in close partnership with the U.S. Environmental Protection Agency (EPA) and other federal, state, and local redevelopment agencies, and stakeholders, is facilitating cleanup, transferability, and revitalization of brownfields through the development of regulatory, tax, and technical assistance tools.

CALF Closed & Abandoned Landfill Inventory

VERSION DATE: 11/01/05

The Texas Commission on Environmental Quality, under a contract with Texas State University, and in cooperation with the 24 regional Council of Governments (COGs) in the State, has located over 4,000 closed and abandoned municipal solid waste landfills throughout Texas. This listing contains "unauthorized sites". Unauthorized sites have no permit and are considered abandoned. The information available for each site varies in detail and this historical information is not updated. Please refer to the specific regional COG for the most current information.

DCRPS Dry Cleaner Remediation Program Sites

VERSION DATE: 03/03/20

This list of DCRP sites is provided by the Texas Commission on Environmental Quality (TCEQ). According to the TCEQ, the Dry Cleaner Remediation Program (DCRP) establishes a prioritization list of dry cleaner sites and administers the Dry Cleaning Remediation fund to assist with remediation of contamination caused by dry cleaning solvents.

IOP Innocent Owner / Operator Database

VERSION DATE: 05/26/20

Texas Innocent Owner / Operator (IOP), created by House Bill 2776 of the 75th Legislature, provides a certificate to an innocent owner or operator if their property is contaminated as a result of a release or migration of contaminants from a source or sources not located on the property, and they did not cause or contribute to the source or sources of contamination. The IOP database is maintained by the Texas Commission on Environmental Quality.

LPST Leaking Petroleum Storage Tanks

VERSION DATE: 06/04/20

The Leaking Petroleum Storage Tank listing is derived from the Petroleum Storage Tank (PST) database and is maintained by the Texas Commission on Environmental Quality. This listing includes aboveground and underground storage tank facilities with reported leaks.

Environmental Records Definitions - STATE (TX)

MSWLF Municipal Solid Waste Landfill Sites

VERSION DATE: 06/05/20

The municipal solid waste landfill database is provided by the Texas Commission on Environmental Quality. This database includes active landfills and inactive landfills, where solid waste is treated or stored.

OCP Operator Cleanup Program Sites

VERSION DATE: 06/04/20

The Operator Cleanup Program oversees Operator-led cleanups to ensure compliance with RRC rules. The Sites in the Operator Cleanup Program enter the program on a case by-case basis through referral from the RRC District Offices or other RRC sections (e.g. Technical Permitting or Legal Enforcement) when groundwater has been impacted or has the potential to be impacted, risk-based site assessment is needed, or when the release consists of a unique or unusual contaminant. Operators can also choose to voluntarily enter their cleanup sites into the RRC's Operator Cleanup Program. Database is provided and maintained by the Railroad Commission of Texas (RRC) and location information is limited to what is available via the agency.

RRCVCP Railroad Commission VCP and Brownfield Sites

VERSION DATE: 06/10/20

According to the Railroad Commission of Texas, their Voluntary Cleanup Program (RRC-VCP) provides an incentive to remediate Oil & Gas related pollution by participants as long as they did not cause or contribute to the contamination. Applicants to the program receive a release of liability to the state in exchange for a successful cleanup.

RWS Radioactive Waste Sites

VERSION DATE: 07/11/06

This Texas Commission on Environmental Quality database contains all sites in the State of Texas that have been designated as Radioactive Waste sites.

STCV Salt Caverns for Petroleum Storage

VERSION DATE: 09/01/06

The salt caverns for petroleum storage database is provided by the Railroad Commission of Texas.

VCP Voluntary Cleanup Program Sites

VERSION DATE: 05/22/20

The Texas Voluntary Cleanup Program (VCP) provides administrative, technical, and legal incentives to encourage the cleanup of contaminated sites in Texas. Since all non-responsible parties, including future lenders

Environmental Records Definitions - STATE (TX)

and landowners, receive protection from liability to the state of Texas for cleanup of sites under the VCP, most of the constraints for completing real estate transactions at those sites are eliminated. As a result, many unused or underused properties may be restored to economically productive or community beneficial uses. The VCP database is maintained by the Texas Commission on Environmental Quality.

WMRF Recycling Facilities

VERSION DATE: 11/01/12

This listing of recycling facilities is provided by the Texas Commission on Environmental Quality's Recycle Texas Online service. The company information provided in this database is self-reported. Since recyclers post their own information, a facility or company appearing on the list does not imply that it is in compliance with TCEQ regulations or other applicable laws. This database is no longer maintained and includes the last compilation of the program participants before the Recycle Texas Online program was closed.

WSTMGMT Commercial Management Facilities for Hazardous Waste and Industrial Solid Wastes

VERSION DATE: 10/01/19

This publication lists facilities that have permits or authorizations from the Texas Commission on Environmental Quality (TCEQ) to receive, on a commercial basis, and manage hazardous waste, industrial nonhazardous waste, or both.

IHWCA Industrial and Hazardous Waste Corrective Action Sites

VERSION DATE: 01/21/20

This database is provided by the Texas Commission on Environmental Quality (TCEQ). According to the TCEQ, the mission of the industrial and hazardous waste corrective action program is to oversee the cleanup of sites contaminated from industrial and municipal hazardous and industrial nonhazardous wastes. The goals of this program are to: Ensure that sites are assessed and remediated to levels that protect human health and the environment; Verify that waste management units or facilities are taken out of service and closed properly; and to Facilitate revitalization of contaminated properties.

SF State Superfund Sites

VERSION DATE: 05/26/20

The state Superfund program mission is to remediate abandoned or inactive sites within the state that pose an unacceptable risk to public health and safety or the environment, but which do not qualify for action under the federal Superfund program (NPL - National Priority Listing). As required by the Texas Solid Waste Disposal Act, Texas Health and Safety Code, Chapter 361, the Texas Commission on Environmental Quality identifies and evaluates these facilities for inclusion on the state Superfund registry. This listing includes any recent developments and the anticipated action for these sites as documented in the annual state Superfund registry publication of the Texas Register as well as the Superfund Webpage on the TCEQ website.

Environmental Records Definitions - TRIBAL

USTR06 Underground Storage Tanks On Tribal Lands

VERSION DATE: 04/01/20

This database, provided by the United States Environmental Protection Agency (EPA), contains underground storage tanks on Tribal lands located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

LUSTR06 Leaking Underground Storage Tanks On Tribal Lands

VERSION DATE: 04/01/20

This database, provided by the United States Environmental Protection Agency (EPA), contains leaking underground storage tanks on Tribal lands located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ODINDIAN Open Dump Inventory on Tribal Lands

VERSION DATE: 11/08/06

This Indian Health Service database contains information about facilities and sites on tribal lands where solid waste is disposed of, which are not sanitary landfills or hazardous waste disposal facilities, and which meet the criteria promulgated under section 4004 of the Solid Waste Disposal Act (42 U.S.C. 6944).

INDIANRES Indian Reservations

VERSION DATE: 09/27/17

The Department of Interior and Bureau of Indian Affairs maintains this database that includes American Indian Reservations, off-reservation trust lands, public domain allotments, Alaska Native Regional Corporations and Recognized State Reservations.

APPENDIX E

CREDENTIALS

Ana Salamanca

STAFF SCIENTIST

PROFESSIONAL EXPERIENCE

Ms. Salamanca has technical experience in ordering environmental database reports, proper site identification, gathering and organizing data for historical investigations, interpretation of aerial and topographic maps as well as organizing project folders that will be used by the project manager.

Ms. Salamanca performs and conducts project management duties for Phase I Environmental Site Assessments. This includes site reconnaissance, historical interviews, city directory and regulatory agency file research and analysis; compilation, review and analysis of aerial photographs, fire insurance maps, and topographic maps.

PROJECT EXPERIENCE

Environmental Site Assessments & Investigations

Project Manager for numerous Phase I ESAs throughout North Texas conducted in conjunction with the acquisition of numerous undeveloped/vacant properties and including but not limited to restaurants, hotels, car-washes, apartment complexes, medical office buildings, industrial warehouses, commercial, and retail properties. Ms. Salamanca has experience reviewing regulatory files pertaining petroleum storage tanks (PSTs), leaking petroleum storage tanks (LPSTs), and Voluntary Cleanup Programs (VCPs), including analyzing groundwater gradients, and contaminant constituents relative to regulatory thresholds.

Ranch and Large-Scale Properties – Texas

Assisted in site reconnaissance for ESAs on multiple ranch and large-scale properties ranging in size from 100 acres to 3,400 acres.

Oil & Gas Due Diligence

Assisted with the site reconnaissance and report completion for Modified Phase I ESAs or ESA reports on numerous oil and gas well production locations, injection and disposal wells, tank batteries, compressor stations, gas plants, field offices, and pipe yards throughout Texas and Kansas.

Dallas Housing Acquisition and Development Corporation (DHADC) Portfolio

Project manager for several sites on the on-going City of Dallas DHADC Limited Environmental Site Assessment (LESA) portfolio.

Regulatory Compliance – Texas

Inspector on Storm Water Pollution Prevention Plan (SWPPP) construction sites in Princeton and Ringgold, Texas for Texas – New Mexico Power (TNMP).

EDUCATION

Bachelor of Science, Environmental Science, Texas A&M - Corpus Christi, December 2017

CERTIFICATIONS

40-Hour OSHA Hazardous Waste Operations Training and 8-Hr Refresher

TDSHS Licensed Asbestos Inspector (License No. 603794)

Medic First Aid & CPR Training

StormwaterOne Certified Stormwater Inspector

AFFILIATIONS

Women's in Energy Network (WEN)

WORK HISTORY

Terracon Consultants, Inc., Staff Scientist, 2018-Present

JACK A. MCCRANIE, P.G.

ENVIRONMENTAL DEPARTMENT MANAGER, PRINCIPAL

PROFESSIONAL EXPERIENCE

Mr. McCranie is responsible for managing environmental services in Terracon's Fort Worth office including environmental site assessments, subsurface investigations, remedial services, asbestos services and lead-based paint services. He has 19 years of professional experience in the environmental field.

Mr. McCranie has experience with chlorinated solvents, petroleum hydrocarbons, and metals at a variety of facilities including industrial and commercial facilities. Mr. McCranie has been involved in the evaluation of hundreds of petroleum hydrocarbon and chlorinated solvent releases, which included the installation of monitor wells, delineation of soil and groundwater contamination, sensitive receptor surveys, groundwater characterization, and risk-based assessment evaluations. Mr. McCranie has been involved in the investigation, oversight and closure of numerous Voluntary Cleanup Program and leaking petroleum storage tank sites, and has managed several EPA Brownfields Assessment Grants for cities.

Mr. McCranie is a Texas Department of State Health Services licensed asbestos inspector and license lead-based paint risk assessor. Mr. McCranie has conducted limited and comprehensive asbestos surveys, as well as limited and comprehensive lead-based paint inspections and risk assessments throughout the State of Texas.

PROJECT EXPERIENCE

Commercial

West 7th Development – Fort Worth, Texas

Project Manager for numerous Phase I Environmental Site Assessments (ESAs) and Limited Subsurface Investigations on a nine block area located just west of downtown Fort Worth. The project included the assessment of approximately 25 parcels of land covering 15 acres with development dating back to the early 1900s. As part of the assessment, four Phase I ESAs and several subsurface investigations were completed. The subsurface investigations included the advancement of approximately 75 soil borings, the installation of 27 monitoring wells, and the collection of numerous soil and groundwater samples. In addition, provided oversight for the removal of 13 underground storage tanks (USTs) discovered on-site in association with historical automotive facilities and service stations. Terracon obtained a Certificate of Completion for the site through the Voluntary Cleanup Program and closure on the 13 USTs removed from the site, two of which required soil remediation associated with releases.

Professional Services Completed: 2006-2012
Terracon Fee: \$350,000

Education

Master of Science, Environmental Science and Engineering, University of Texas at Arlington, 2010

Bachelor of Arts, Environmental Chemistry, University of California at San Diego, 1995

Registrations

Professional Geoscientists: Texas, No. 11204

Certified Hazardous Materials Manager: No. 14692

Certifications

40-Hour HAZWOPER

Texas Licensed Asbestos Inspector

Texas Licensed Lead Risk Assessor

Affiliations

Society of Texas Environmental Professionals

Society of American Military Engineers

Work History

Terracon Consultants, Inc., Environmental Department Manager, 2005-present

Mactec Engineering and Environmental, Inc., Project Manager, 1997-2005

Project Resources, Inc., Staff Scientist, 1995-1997

Federal

Brownfields Development – Arlington, Greenville and Lewisville, Texas

Brownfields Coordinator and Project Manager for the City of Arlington, City of Greenville and the City of Lewisville EPA Hazardous and Petroleum Substances Grants. Assisted the cities with grant writing efforts, Phase I and Phase II Environmental Site Assessments, corrective actions, site closure activities and interaction with EPA and the Texas Commission on Environmental Quality.

Professional Services Completed: 2005-2014

Terracon Fee: \$1,300,000

4,000 Acre Ranch – Thurber, Texas

Conducted Phase I and Phase II Environmental Site Assessments on an approximate 4,000-acre tract of ranchland for a proposed state park. Eight historic coal mines were located on-site, and observations of the historic coal mine areas indicated old foundations, boiler remnants, scattered bricks, mine spoils and one mine shaft. Based on historical information, the coal mines were operated on-site by Texas and Pacific Coal from the late 1800s to the early 1920s. Remnants of the historic on-site coal mining operations include several hundred thousand cubic yards of mining spoils or more on-site with stockpiles ranging up to several hundred feet high and up to 1,100 feet in length. Preliminary screening of the on-site mine spoil stockpiles did not indicate significant concerns from naturally occurring radioactive material (NORM). However, Phase II soil and surface water sampling identified elevated levels of arsenic and acid mine drainage associated with the mining spoil piles and adjacent ponds.

Professional Services Completed: 2010

Terracon Fee: \$32,000

Tinker Air Force Base – Oklahoma City, Oklahoma

Project Scientist and Field Supervisor for an environmental survey of a 2.5 million square foot Air Force engine aircraft maintenance depot located at Tinker Air Force Base in Oklahoma City, Oklahoma. The survey quantified asbestos piping, lead-based paint, heavy metal contaminated dust, and polychlorinated biphenyls (PCBs) in order to provide remediation costs for revitalization. Duties included coordinating and managing a field team of approximately 10 environmental scientist/engineers over a three-week period. Upon completion of the fieldwork, assisted in developing databases, schematic drawings, cost estimates, and a final report in order to assist the Corps of Engineers in revitalization of the engine aircraft maintenance facility over the next 20 years.

Professional Services Completed: 2004

Fee: \$75,000

Industrial

Former GE Aircraft Engine Repair Facility – Addison, Texas

Senior scientist for a subsurface investigation of a trichloroethylene (TCE) release at an aircraft engine parts facility. The subsurface investigation included horizontal and vertical delineation of TCE impacted soil and groundwater. Performed well yield tests to determine groundwater classification and prepared an Affected Property Assessment Report (APAR) for submittal to the TCEQ Voluntary Cleanup Program. The site received a voluntary cleanup program (VCP) Certificate of Completion from the TCEQ.

Professional Services Completed: 2002

Fee: \$40,000

APPENDIX F
DESCRIPTION OF TERMS AND ACRONYMS

Term/Acronym	Description
ACM	Asbestos Containing Material. Asbestos is a naturally occurring mineral, three varieties of which (chrysotile, amosite, crocidolite) have been commonly used as fireproofing or binding agents in construction materials. Exposure to asbestos, as well as ACM, has been documented to cause lung diseases including asbestosis (scarring of the lung), lung cancer and mesothelioma (a cancer of the lung lining). Regulatory agencies have generally defined ACM as a material containing greater than one (1) percent asbestos, however some states (e.g. California) define ACM as materials having 0.1% asbestos. In order to define a homogenous material as non-ACM, a minimum number of samples must be collected from the material dependent upon its type and quantity. Homogenous materials defined as non-ACM must either have 1) no asbestos identified in all of its samples or 2) an identified asbestos concentration below the appropriate regulatory threshold. Asbestos concentrations are generally determined using polarized light microscopy or transmission electron microscopy. Point counting is an analytical method to statistically quantify the percentage of asbestos in a sample. The asbestos component of ACM may either be friable or non-friable. Friable materials, when dry, can be crumbled, pulverized, or reduced to powder by hand pressure and have a higher potential for a fiber release than non-friable ACM. Non-friable ACM are materials that are firmly bound in a matrix by plastic, cement, etc. and, if handled carefully, will not become friable. Federal and state regulations require that either all suspect building materials be presumed ACM or that an asbestos survey be performed prior to renovation, dismantling, demolition, or other activities that may disturb potential ACM. Notifications are required prior to demolition and/or renovation activities that may impact the condition of ACM in a building. ACM removal may be required if the ACM is likely to be disturbed or damaged during the demolition or renovation. Abatement of friable or potentially friable ACM must be performed by a licensed abatement contractor in accordance with state rules and NESHAP. Additionally, OSHA regulations for work classification, worker training and worker protection will apply.
AHERA	Asbestos Hazard Emergency Response Act
AST	Aboveground Storage Tanks. ASTs are generally described as storage tanks less than 10% of which are below ground (i.e., buried). Tanks located in a basement, but not buried, are also considered ASTs. Whether, and the extent to which, an AST is regulated, is determined on a case-by-case basis and depends upon tank size, its contents and the jurisdiction of its location.
BGS	Below Ground Surface
Brownfields	State and/or tribal listing of Brownfield properties addressed by Cooperative Agreement Recipients or Targeted Brownfields Assessments.
BTEX	Benzene, Toluene, Ethylbenzene, and Xylenes. BTEX are VOC components found in gasoline and commonly used as analytical indicators of a petroleum hydrocarbon release.
CERCLA	Comprehensive Environmental Response, Compensation and Liability Act (a.k.a. Superfund). CERCLA is the federal act that regulates abandoned or uncontrolled hazardous waste sites. Under this Act, joint and several liability may be imposed on potentially responsible parties for cleanup-related costs.

Term/Acronym	Description
CERCLIS	Comprehensive Environmental Response, Compensation and Liability Information System. An EPA compilation of sites having suspected or actual releases of hazardous substances to the environment. CERCLIS also contains information on site inspections, preliminary assessments and remediation of hazardous waste sites. These sites are typically reported to EPA by states and municipalities or by third parties pursuant to CERCLA Section 103.
CESQG	Conditionally Exempt Small Quantity Generators
CFR	Code of Federal Regulations
CREC	Controlled Recognized Environmental Condition is defined in ASTM E1527-13 as “a recognized environmental condition resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority (for example, as evidenced by the issuance of a no further action letter or equivalent, or meeting risk-based criteria established by regulatory authority) , with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls (for example, property use restrictions, activity and use limitations, institutional controls, or engineering controls). A condition considered by the environmental professional to be a controlled recognized environmental condition shall be listed in the findings section of the Phase I Environmental Site Assessment report, and as a recognized environmental condition in the conclusions section of the Phase I Environmental Site Assessment report.”
DOT	U.S. Department of Transportation
EPA	U.S. Environmental Protection Agency
ERNS	Emergency Response Notification System. An EPA-maintained federal database which stores information on notifications of oil discharges and hazardous substance releases in quantities greater than the applicable reportable quantity under CERCLA. ERNS is a cooperative data-sharing effort between EPA, DOT, and the National Response Center.
ESA	Environmental Site Assessment
FRP	Fiberglass Reinforced Plastic
Hazardous Substance	As defined under CERCLA, this is (A) any substance designated pursuant to section 1321(b)(2)(A) of Title 33, (B) any element, compound, mixture, solution, or substance designated pursuant to section 9602 of this title; (C) any hazardous waste having characteristics identified under or listed pursuant to section 3001 of the Solid Waste Disposal Act (with some exclusions); (D) any toxic pollutant listed under section 1317(a) of Title 33; (E) any hazardous air pollutant listed under section 112 of the Clean Air Act; and (F) any imminently hazardous chemical substance or mixture with respect to which the EPA Administrator has taken action under section 2606 of Title 15. This term does not include petroleum, including crude oil or any fraction thereof which is not otherwise listed as a hazardous substance under subparagraphs (A) through (F) above, and the term include natural gas, or synthetic gas usable for fuel (or mixtures of natural gas and such synthetic gas).
Hazardous Waste	This is defined as having characteristics identified or listed under section 3001 of the Solid Waste Disposal Act (with some exceptions). RCRA, as amended by the Solid Waste Disposal Act of 1980, defines this term as a “solid waste, or combination of solid wastes, which because of its quantity, concentration, or physical, chemical, or infectious characteristics may (A) cause, or significantly contribute to an increase in mortality or an increase in serious irreversible, or incapacitating reversible illness; or (B) pose a substantial present or potential hazard to human health or the environment when improperly treated, stored, transported, or disposed of, or otherwise managed.”

Term/Acronym	Description
HREC	Historical Recognized Environmental Condition is defined in ASTM E1527-13 as “a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted residential use criteria established by a regulatory authority, without subjecting the property to any required controls (for example, property use restrictions, activity and use limitations, institutional controls, or engineering controls). Before calling the past release a historical recognized environmental condition, the environmental professional must determine whether the past release is a recognized environmental condition at the time of the Phase I Environmental Site Assessment is conducted (for example, if there has been a change in the regulatory criteria). If the EP considers the past release to be a recognized environmental condition at the time the Phase I ESA is conducted, the condition shall be included in the conclusions section of the report as a recognized environmental condition.”
IC/EC	A listing of sites with institutional and/or engineering controls in place. IC include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls. EC include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.
ILP	Innocent Landowner/Operator Program
LQG	Large Quantity Generators
LUST	Leaking Underground Storage Tank. This is a federal term set forth under RCRA for leaking USTs. Some states also utilize this term.
MCL	Maximum Contaminant Level. This Safe Drinking Water concept (and also used by many states as a ground water cleanup criteria) refers to the limit on drinking water contamination that determines whether a supplier can deliver water from a specific source without treatment.
MSDS	Material Safety Data Sheets. Written/printed forms prepared by chemical manufacturers, importers and employers which identify the physical and chemical traits of hazardous chemicals under OSHA's Hazard Communication Standard.
NESHAP	National Emissions Standard for Hazardous Air Pollutants (Federal Clean Air Act). This part of the Clean Air Act regulates emissions of hazardous air pollutants.
NFRAP	Facilities where there is “No Further Remedial Action Planned,” as more particularly described under the Records Review section of this report.
NOV	Notice of Violation. A notice of violation or similar citation issued to an entity, company or individual by a state or federal regulatory body indicating a violation of applicable rule or regulations has been identified.
NPDES	National Pollutant Discharge Elimination System (Clean Water Act). The federal permit system for discharges of polluted water.
NPL	The NPL is the EPA's database of uncontrolled or abandoned hazardous waste facilities that have been listed for priority remedial actions under the Superfund Program.
OSHA	Occupational Safety and Health Administration or Occupational Safety and Health Act
PACM	Presumed Asbestos-Containing Material. A material that is suspected of containing or presumed to contain asbestos but which has not been analyzed to confirm the presence or absence of asbestos.

Term/Acronym	Description
PCB	Polychlorinated Biphenyl. A halogenated organic compound commonly in the form of a viscous liquid or resin, a flowing yellow oil, or a waxy solid. This compound was historically used as dielectric fluid in electrical equipment (such as electrical transformers and capacitors, electrical ballasts, hydraulic and heat transfer fluids), and for numerous heat and fire sensitive applications. PCB was preferred due to its durability, stability (even at high temperatures), good chemical resistance, low volatility, flammability, and conductivity. PCBs, however, do not break down in the environment and are classified by the EPA as a suspected carcinogen. 1978 regulations, under the Toxic Substances Control Act, prohibit manufacturing of PCB-containing equipment; however, some of this equipment may still be in use today.
pCi/L	picoCuries per Liter of Air. Unit of measurement for Radon and similar radioactive materials.
PLM	Polarized Light Microscopy (see ACM section of the report, if included in the scope of services)
PST	Petroleum Storage Tank. An AST or UST that contains a petroleum product.
Radon	A radioactive gas resulting from radioactive decay of naturally-occurring radioactive materials in rocks and soils containing uranium, granite, shale, phosphate, and pitchblende. Radon concentrations are measured in picoCuries per Liter of Air. Exposure to elevated levels of radon creates a risk of lung cancer; this risk generally increases as the level of radon and the duration of exposure increases. Outdoors, radon is diluted to such low concentrations that it usually does not present a health concern. However, radon can accumulate in building basements or similar enclosed spaces to levels that can pose a risk to human health. Indoor radon concentrations depend primarily upon the building's construction, design and the concentration of radon in the underlying soil and ground water. The EPA recommended annual average indoor "action level" concentration for residential structures is 4.0 pCi/l.
RCRA	Resource Conservation and Recovery Act. Federal act regulating solid and hazardous wastes from point of generation to time of disposal ('cradle to grave'). 42 U.S.C. 6901 et seq.
RCRA Generators	The RCRA Generators database, maintained by the EPA, lists facilities that generate hazardous waste as part of their normal business practices. Generators are listed as either large (LQG), small (SQG), or conditionally exempt (CESQG). LQG produce at least 1000 kg/month of non-acutely hazardous waste or 1 kg/month of acutely hazardous waste. SQG produce 100-1000 kg/month of non-acutely hazardous waste. CESQG are those that generate less than 100 kg/month of non-acutely hazardous waste.
RCRA CORRACTS/TSDs	The USEPA maintains a database of RCRA facilities associated with treatment, storage, and disposal (TSD) of hazardous materials which are undergoing "corrective action". A "corrective action" order is issued when there is a release of hazardous waste or constituents into the environment from a RCRA facility.
RCRA Non-CORRACTS/TSDs	The RCRA Non-CORRACTS/TSD Database is a compilation by the USEPA of facilities which report storage, transportation, treatment, or disposal of hazardous waste. Unlike the RCRA CORRACTS/TSD database, the RCRA Non-CORRACTS/TSD database does not include RCRA facilities where corrective action is required.
RCRA Violators List	RAATS. RCRA Administrative Actions Taken. RAATS information is now contained in the RCRIS database and includes records of administrative enforcement actions against facilities for noncompliance.
RCRIS	Resource Conservation and Recovery Information System, as defined in the Records Review section of this report.
REC	Recognized Environmental Conditions are defined by ASTM E1527-13 as "the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: 1) due to any release to the environment; 2) under conditions indicative of a release to the environment. <i>De minimis</i> conditions are not recognized environmental conditions."

<i>Term/Acronym</i>	<i>Description</i>
SCL	State "CERCLIS" List (see SPL /State Priority List, below).
SEMS	The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs.
SEMSARCH	The Superfund Enterprise Management System Archive listing (SEMSARCH) has replaced the CERCLIS NFRAP reporting system in 2015. This listing reflects sites that have been assessed and no further remediation is planned and is of no further interest under the Superfund program.
SQG	Small Quantity Generator
SWF/LF	State and/or Tribal database of Solid Waste/Landfill facilities. The database information may include the facility name, class, operation type, area, estimated operational life, and owner.
TPH	Total Petroleum Hydrocarbons
TRI	Toxic Release Inventory. Routine EPA report on releases of toxic chemicals to the environment based upon information submitted by entities subject to reporting under the Emergency Planning and Community Right to Know Act.
TSCA	Toxic Substances Control Act. A federal law regulating manufacture, import, processing and distribution of chemical substances not specifically regulated by other federal laws (such as asbestos, PCBs, lead-based paint and radon). 15 U.S.C 2601 et seq.
USACE	United States Army Corps of Engineers
USC	United States Code
USGS	United States Geological Survey
USNRCS	United States Department of Agriculture-Natural Resource Conservation Service
UST	Underground Storage Tank. Most federal and state regulations, as well as ASTM E1527-13, define this as any tank, incl., underground piping connected to the tank, that is or has been used to contain hazardous substances or petroleum products and the volume of which is 10% or more beneath the surface of the ground (i.e., buried).
VCP	State and/or Tribal facilities included as Voluntary Cleanup Program sites.
VOC	Volatile Organic Compound

Term/Acronym	Description
Wetlands	Areas that are typically saturated with surface or ground water that creates an environment supportive of wetland vegetation (i.e., swamps, marshes, bogs). The <u>Corps of Engineers Wetlands Delineation Manual</u> (Technical Report Y-87-1) defines wetlands as areas inundated or saturated by surface or ground water at a frequency and duration sufficient to support, and that under normal circumstances do support, a prevalence of vegetation typically adapted for life in saturated soil conditions. For an area to be considered a jurisdictional wetland, it must meet the following criteria: more than 50 percent of the dominant plant species must be categorized as Obligate, Facultative Wetland, or Facultative on lists of plant species that occur in wetlands; the soil must be hydric; and, wetland hydrology must be present. The federal Clean Water Act which regulates “waters of the US,” also regulates wetlands, a program jointly administered by the USACE and the EPA. Waters of the U.S. are defined as: (1) waters used in interstate or foreign commerce, including all waters subject to the ebb and flow of tides; (2) all interstate waters including interstate wetlands; (3) all other waters such as intrastate lakes, rivers, streams (including intermittent streams), mudflats, sandflats, wetlands, sloughs, prairie potholes, wet meadows, playa lakes, or natural ponds, etc., which the use, degradation, or destruction could affect interstate/ foreign commerce; (4) all impoundments of waters otherwise defined as waters of the U. S., (5) tributaries of waters identified in 1 through 4 above; (6) the territorial seas; and (7) wetlands adjacent to waters identified in 1 through 6 above. Only the USACE has the authority to make a final wetlands jurisdictional determination.